
2. 양성교(상)

전경 및 작업사진



교면포장 전경



신축이음 전경



바닥판하면 전경



연석 및 난간 전경



거더 전경



교대 전경

전경 및 작업사진



교각 전경



교량받침 전경



작업전경



작업전경



작업전경

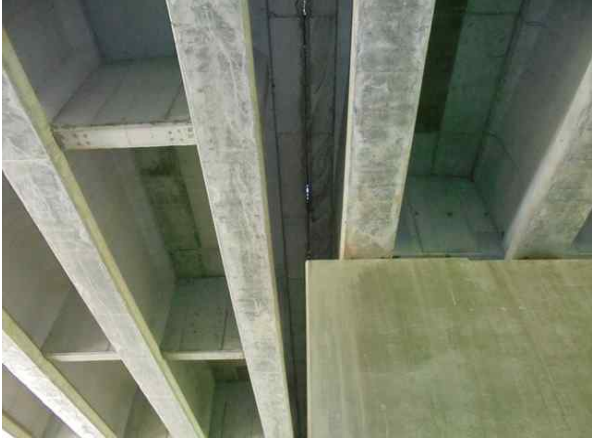


비파괴시험

손상현황 사진

	
S1 균열(0.1mm/1.0m)	S3S1 균열(0.1mm/1.6m) 망상균열 보수
	
S1 물끊기홈 미시공	S2 균열(0.1mm/1.6m)
	
S2 균열 보수	S2 재균열(0.2mm/2.5m)

손상현황 사진

	
S1 물끊기흠 미시공	S3 재균열(0.1mm/1.6m)
	
S3 백태 (0.5×0.5)	S3 물끊기흠 미시공
	
S4 재균열(0.1mm/1.0m)	S4 균열 보수

손상현황 사진

	
S4 박락 보수	S4 파손 (0.5×0.3)
	
S4 파손 및 철근노출 (0.5×0.3)	S5 재균열 (0.1mm/1.0m)
	
S5 균열 보수	S5 물끊기흙 미시공

손상현황 사진

	
S6 박락 (0.1×1.0)	S6 파손 및 철근노출 (0.5×0.5)
	
S6 파손 (0.2×0.4)	S7 균열(0.2mm/1.6m)
	
S7 물끓기흙 미시공	S8 균열(0.1mm/1.6m)

손상현황 사진

	
S8 균열 보수	S8 백태 보수
	
S3-G1 박락 및 백태 보수	S3-G3 균열 보수
	
S3-G1 박락(0.1×0.3)	S3-G1 백태(0.1×1.0)

손상현황 사진

	
S3-G1 백태(0.5×0.5)	S3-G1~6 들뜸(1.0×0.4)
	
S4-G5 박락 및 파손 보수	S4-G1~6 들뜸(1.0×0.4)
	
S6-G2 파손 보수	S6-G1~6 들뜸(1.0×0.3)

손상현황 사진

	
S6-G6 파손(0.2×0.4)	S7-G1 파손 보수
	
S7-G1~6 들뜸(1.0×0.3)	S7-G5 파손(0.4×0.2)
	
S7-G1~6 들뜸(1.0×0.3)	S7-G5 파손(0.4×0.2)

손상현황 사진

	
S7-G6 박락(1.0×0.3)	S7-G6 파손(0.2×0.2)
	
S8-G1 들뜸 보수	S8-G1 파손(0.1×1.5)
	
S8-G1 박락(0.1×0.8)	S8-G2 박락 보수

손상현황 사진

	
S8-G6 들뜸(1.0×0.1)	S8-G6 들뜸(1.0×0.1)
	
S2 보수부 박리(0.3×0.3)	S2 보수부 들뜸(0.3×0.3)
	
S2 보수부 들뜸(0.3×0.3)	S3 재균열 보수

손상현황 사진

	
S6 채균열(0.3mm/0.1m)	S6 박락(0.5×0.1)
	
S6 누수흔적(0.3×0.5)	S7 박리(0.3×1.0)
	
S7 박리(0.3×1.0)	S7 보수부 박락(0.3×0.3)

손상현황 사진

	
S7 보수부 들뜸(0.3×0.3)	S7 박리(0.3×1.0)
	
A1 녹오염(0.1×0.8)	A1 체수흔적(0.5×1.5)
	
A1 균열(0.2mm/0.6m)	A1 점검계단 고사목적치

손상현황 사진

	
A1 균열(0.2mm/0.4m)	A1 균열(0.2mm/0.8m)
	
A1 표면오염(1.0×2.0)	A1 표면오염(1.5×2.5)
	
A2 균열(0.2mm/0.6m)	A1 체수흔적(2.8×1.5)

손상현황 사진

	
A2 균열(0.3mm/0.3m)	A2 법면 배수로 하부 토사유실(1.5×1.2)
	
A2 법면 배수로 하부 토사유실(1.5×1.2)	A2 점검계단 미설치
	
A2 집수정 바닥콘크리트 파손(0.9×0.7)	A2 균열(0.2mm/0.9m)

손상현황 사진

	
A2 균열(0.2mm/1.0m)	A2 균열(0.3mm/2.0m)
	
A2 균열부백태(0.1×0.7)	A2 누수흔적(0.6×2.0)
	
A2 누수흔적(1.0×2.0)	A2 균열(0.2mm/1.5m)

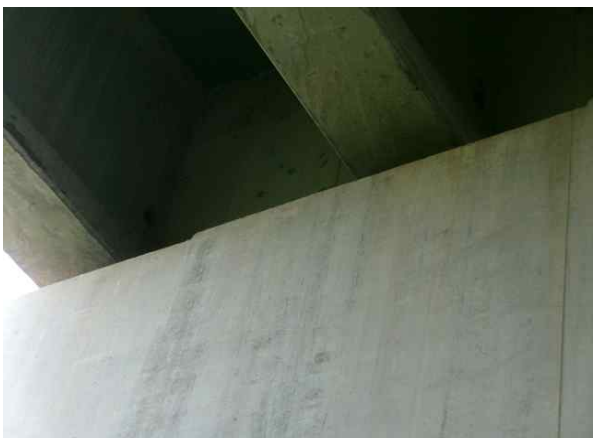
손상현황 사진

	
A2 파손(2.0×1.0)	A2 파손(2.0×1.0)
	
P1 코핑부 균열(0.2mm/0.4m)	P1 코핑부 균열(0.2mm/2.4m)
	
P2 코핑부 균열(0.2mm/1.5m)	P2 코핑부 균열(0.2mm/4.0m)

손상현황 사진

P3 기둥부 재료분리(0.3×0.3)	P3 기둥부 균열(0.2×0.8)
P3 기둥부 균열(1.6×1.5)	P3 교평부 누수흔적(0.3×2.5)
P3 교평부 누수흔적(0.5×2.5)	P3 교평부 상면 폐콘크리트 적치

손상현황 사진

	
P4 기둥부 균열(0.4×0.2)	P4 코핑부 재료분리(4.0×0.1)
	
P5 기둥부 파손(0.1×0.1)	P5 코핑부 균열(0.2mm/0.6m)
	
P6 기둥부 재균열(0.3mm/1.0m)	P6 기둥부 재균열(0.3mm/1.0m)

손상현황 사진



P6 코평부 누수흔적(0.2×2.0)



P6 코평부 박리(0.4×1.5)



P6 코평부 박리(0.6×2.5)



P6 코평부 박리(2.5×0.5)



P6 코평부 상면 체수(0.5×2.5)



P6 코평부 상면 체수1.2×2.5)

손상현황 사진

	
P6 코핑부 누수흔적(0.8×0.8)	P6 코핑부 재료분리(0.4×0.3)
	
P6 코핑부 누수흔적(1.0×0.5)	P6 코핑부 하면 철근노출(0.1×0.1)
	
P7 코핑부 균열(0.2mm/0.4m)	P7 코핑부 균열(0.2mm/1.5m)

손상현황 사진

	
P7 코핑부 망상균열(1.5×2.5)	P7 코핑부 망상균열(1.6×2.0)
	
P7 코핑부 채균열(0.2mm/1.2m)	P7 코핑부 균열(0.2mm/1.0m)
	
P7 하부 웬스 파손	A1-SH2 본체 부식

손상현황 사진

	
A1-SH3 본체 부식	A1-SH5 본체 부식
	
A2-SH5 본체 부식	P1-SH5 받침물탈 균열(0.1mm/0.1m)
	
P3-SH1 물탈 박락(0.1×0.1)	P3-SH1 받침물탈 균열(0.5mm/0.5m)

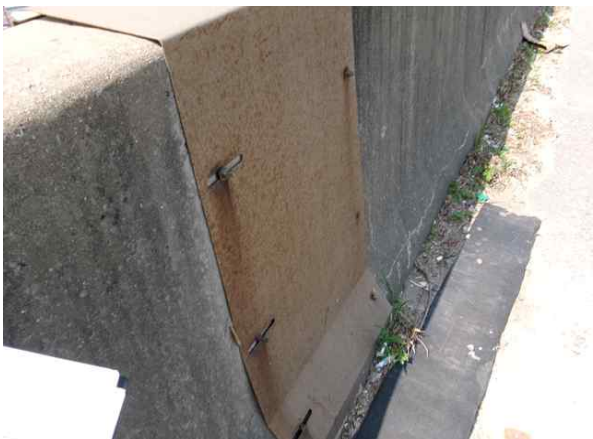
손상현황 사진

	
P3-SH2 본체 부식	P6-SH12 본체 부식
	
A1 후타재 파손 보수	A1 후타재 균열(0.2mm/0.6m)
	
A1 후타재 파손(0.2×2.0)	A1 후타재 파손(0.3×0.5)

손상현황 사진

	
A2 후타재 균열(0.1mm/0.5m)	A2 후타재 마모(0.5×1.0)
	
A2 후타재 파손(0.1×3.0)	A2 후타재 파손(0.2×1.0)
	
P3 차수판 볼트 체결불량 보수	P3 후타재 파손(0.2×0.5)

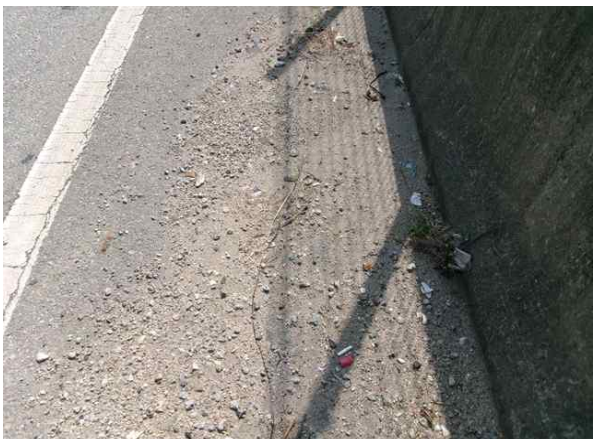
손상현황 사진

	
P3 후타재 파손(0.2×1.0)	P3 후타재 파손(0.3×1.0)
	
P6 본체부식	P6 하부 누수
	
P6 유간 토사퇴적(13.0)	P6 파수관 볼트탈락

손상현황 사진

	
P6 후타재 파손(0.1×0.4)	P6 후타재 파손(0.3×1.0)
	
S1 아스콘 파손 보수	S1 아스콘 균열(18.0)
	
S1 아스콘 균열(3.0)	S2 포장 균열(1.0)

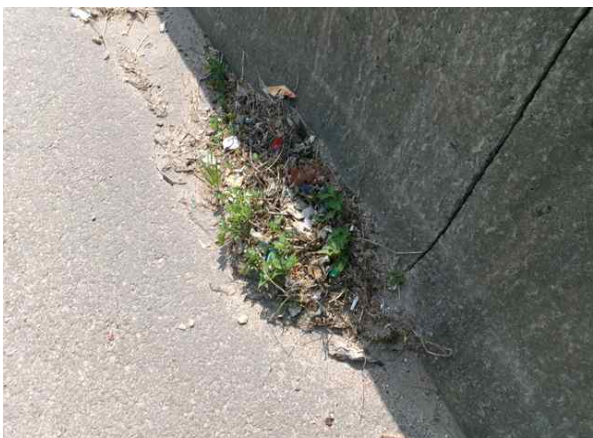
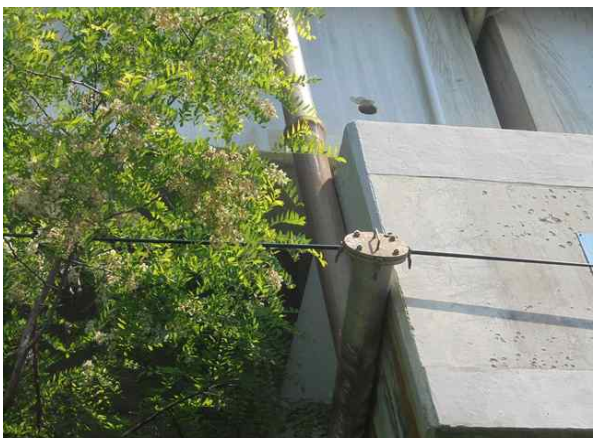
손상현황 사진

	
S3 포장 망상균열(10.0×1.0)	S3 포장 균열(1.0)
	
S3토사퇴적(1.8×0.8)	S4 아스콘 균열(2.0)
	
S4 아스콘 망상균열(10.0×3.0)	S4 토사퇴적(1.0×2.0)

손상현황 사진

	
S6 아스콘 망상균열(1.2×3.0)	S4 아스콘 균열(2.0)
	
A1 집수정 토사퇴적	S1 배수관 길이부족
	
S1 그레이팅 망실, 막힘	S2 배수구 막힘

손상현황 사진

	
S3 배수구 막힘	S4 배수구 막힘
	
S5 배수구 막힘	S6 배수관 막힘
	
S6 배수관 막힘, 부식	S7 배수구 막힘

손상현황 사진

	
S1 균열(0.2mm/2.0m)	S1 균열(0.2mm/2.5m)
	
S1 균열(0.2mm/5.0m)	S1 재균열(0.2mm/2.5m)
	
S1 중분대 파손(0.2×1.0)	S2 텔레이네이트 파손

손상현황 사진

	
S2 재균열 (0.2mm/2.5m)	S3 텔레이네이트 파손
	
S3 재균열 (0.2mm/2.5m)	S4 균열 (0.2mm/0.8m)
	
S4 텔레이네이트 파손	S4 중분대 파손 (0.2×2.5)

손상현황 사진

	
S5 재균열 (0.2mm/2.5m)	S6 균열 (0.2mm/3.0m)
	
S7 들뜸 (0.3×1.1)	S7 재균열 (0.2mm/3.0m)
	
S7 파손 (0.2×0.4)	S8 균열부 백태 (0.8)

손상현황 사진

	
S8 텔레이네이트 파손	S8 망상균열(1.1×1.5)
	—
S8 백태(0.2×1.0)	—
—	—
—	—