

역 동 교

바닥판하면 손상현황

	
역동교 바닥판하면 S1 중조인트부 박리 45.0*0.1	역동교 바닥판하면 S1-A1 박리 0.2*0.5

거더 및 가로보 손상현황

	
역동교 가로보 S1-G6~7 재료분리 0.2*0.2	역동교 가로보 S1-G7~8 재료분리 0.2*0.2
	
역동교 거더 S1-G4(A1) 파손 0.1*0.1	


교대 손상현황



역동교 교대 A1 구체 긁힘 0.3*0.5




역동교 교대 A1 구체 백태 0.1*0.1

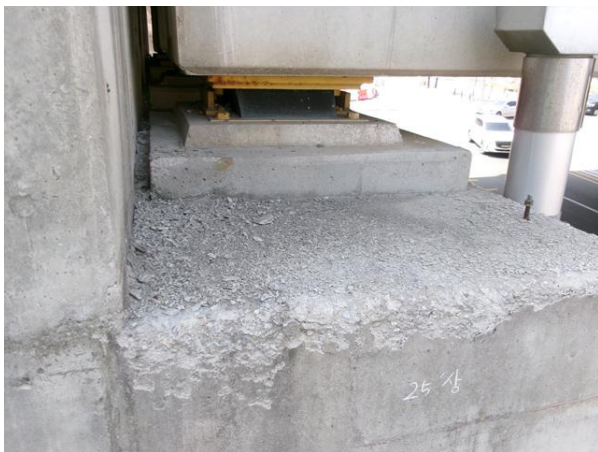

역동교 교대 A1 구체 상면 박리 1.0*1.5



역동교 교대 A1 구체 좌측 박리 1.5*0.3 - 사진 흔들렸네;;

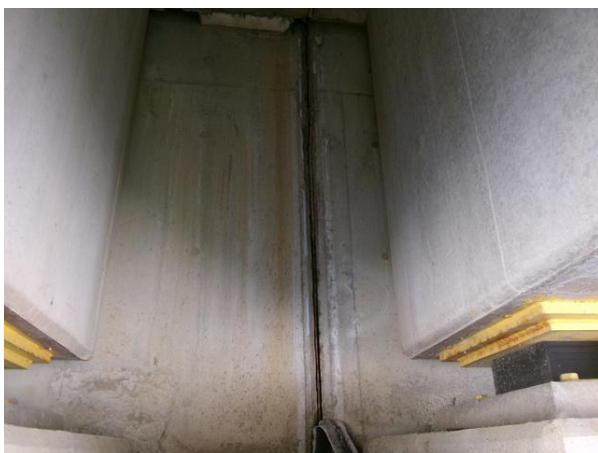

역동교 교대 A1 실란트 파손 5.0m



역동교 교대 A1 흉벽 박리 0.4*1.0

교대 손상현황

	
역동교 교대 A1 흉벽 백태 0.1*0.1*3EA	역동교 교대 A2 구체 망상균열 1.5*1.0
	
역동교 교대 A2 구체 백태 0.1*0.2*2EA	역동교 교대 A2 실란트 파손 5.0m
	
역동교 교대 A2 흉벽 백태 0.1*0.1*3EA	역동교 교대 A2 흉벽 백태 0.1*0.2

교량받침 손상현황



역동교 교량받침 A1-SH4 받침콘크리트 균열
0.1/0.3



H0410_0087



역동교 교량받침 A2-SH1 받침콘크리트 균열
0.1/0.3



역동교 교량받침 A2-SH3 무수축물탈 박락 0.1*0.1



역동교 교량받침 A2-SH4 받침콘크리트 충분리
0.3*0.1



역동교 교량받침 A2-SH7 무수축물탈 파손 0.1*0.1

난간 및 연석 손상현황



역동교 수원방향 방호벽 S1 긁힘 0.2*0.8_신규



역동교 수원방향 방호벽 S1 박리 0.3*0.3_신규



역동교 수원방향 방호벽 S1 열화 1.0*45.0_신규



역동교 이천방향 방호벽 S1 박리(열화) 0.3*45.0



역동교 이천방향 방호벽 S1 중분대 균열
0.3/1.0*3EA_신규



역동교 이천방향 방호벽 S1 중분대 균열
0.3/1.5_신규