

신기교

바닥판하면 손상현황



신기교 바닥판하면 S1-A1 재료분리 0.1*0.2



신기교 바닥판하면 S1-A1 재료분리 0.3*0.4

[illegible]

거더 및 가로보 손상현황

	
신기교 거더 S1-G09 박락 0.1*0.1 -신규-	

교대 손상현황



신기교 교대 A1 구체 박리 및 철근노출 0.5*0.5



신기교 교대 A1 구체 상면 콘크리트 박리 1.52*0.5



신기교 교대 A1 구체 우측면 콘크리트 박리 0.2*0.6



신기교 교대 A1 구체 좌측면 콘크리트 박리 0.2*1.5



신기교 교대 A1 구체 콘크리트 들뜸 0.1*0.1



신기교 교대 A1 구체 콘크리트 박리 0.1*0.8

교대 손상현황



신기교 교대 A1 흉벽 콘크리트 박리 0.3*0.3



신기교 교대 A2 균열 0.2/2.0 -신규-



신기교 교대 A2 균열 0.2/2.0 -신규-



신기교 교대 A2 박리 0.5*2.0 -신규-



신기교 교대 A2 표면오염 0.6*4.0 -신규-



신기교 교대 A2 표면오염 1.5*4.0 -신규-

교량받침 손상현황



신기교 교량받침 A1-SH1 무수축몰탈 균열 0.1/0.1



신기교 교량받침 A1-SH1 받침콘크리트 균열 0.1/0.2



신기교 교량받침 A1-SH10 받침콘크리트 박리 0.2*0.2



신기교 교량받침 A1-SH2 받침콘크리트 균열 0.1/0.2



신기교 교량받침 A1-SH8 무수축몰탈 균열 0.1/0.1



신기교 교량받침 A2-SH10 무수축몰탈 박락 0.2*0.5 -신규-

난간 및 연석 손상현황



신기교 수원방향 방호벽 S1 열화 40*0.5



신기교 이천방향 방호벽 S1 박리(열화)
1.2*40.0_신규



신기교 이천방향 방호벽 S1 중분대 균열
0.3/1.0_신규



신기교 이천방향 방호벽 S1 중분대 박리(열화)
0.5*40.0_신규