


화남고속선장구교-175(49.713~49.720km, S35-4)

49K713

49K720
35 SPAN - 4

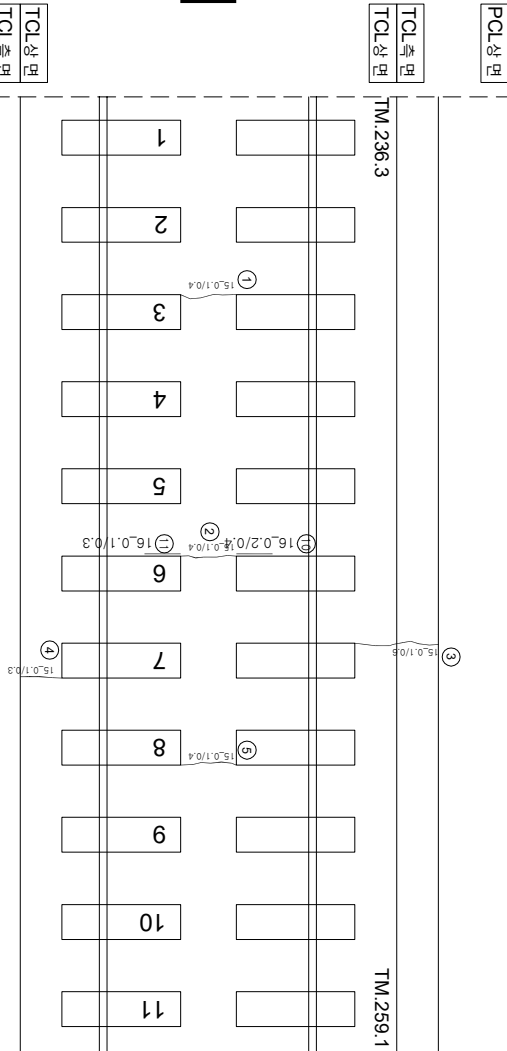


71 (하행)

(하오)



PCL 샘플

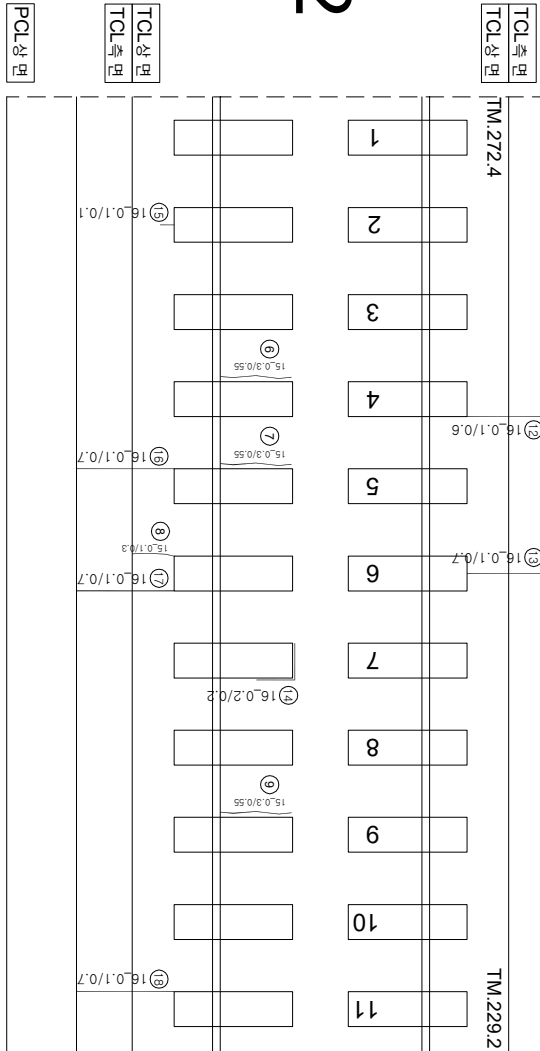

12 (04 05)

(유한)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		55				
2	균열	0.1 mm	0.75 m		56				
3	균열	0.1 mm	0.3 m		57				
4	균열	0.1 mm	0.3 m		58				
5	균열	0.1 mm	0.4 m		59				
6	경색부 균열	0.1 mm	0.75 m		60				
7	경색부 균열	0.1 mm	0.7 m		61				
8	균열	0.1 mm	0.3 m		62				
9	경색부 균열	0.3 mm	0.3 m		63				
10	경색부 균열	0.2 mm	0.4 m		64				
11	경색부 균열	0.1 mm	0.3 m		65				
12	균열	0.1 mm	0.6 m		66				
13	균열	0.1 mm	0.7 m		67				
14	경색부 균열	0.2 mm	0.2 m		68				
15	균열	0.1 mm	0.1 m		69				
16	균열	0.1 mm	0.7 m		70				
17	균열	0.1 mm	0.7 m		71				
18	균열	0.1 mm	0.7 m		72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	영 역	영 역	영역	사	이 부 영		구 분	
						과 일 전 임 지	장 분 이 별 책 임 지		
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트캐드 점검공역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 부 영	김 운 강 김 경 기 문 석 기	구 분	 0220 (0.3m이하 : 철석)	 점목도상판리	 재료판리
							 0420 (0.3m초과 0.5m이하 : 형석)	 망상	 철판노출
							 0620 (0.5m초과 1.0m미만 : 직석)	 박리, 박락, 파손	 누수, 습윤부
							 1020 (1.0m이상 : 불용석)	 백태	 오염
							 1020 (1.0m이상 : 불용석)	 백태	 시공이음판리, 종판리
							 1020 (1.0m이상 : 불용석)	 백태	 시공이음판리, 종판리