


신파주-송포인출 외관조사망도


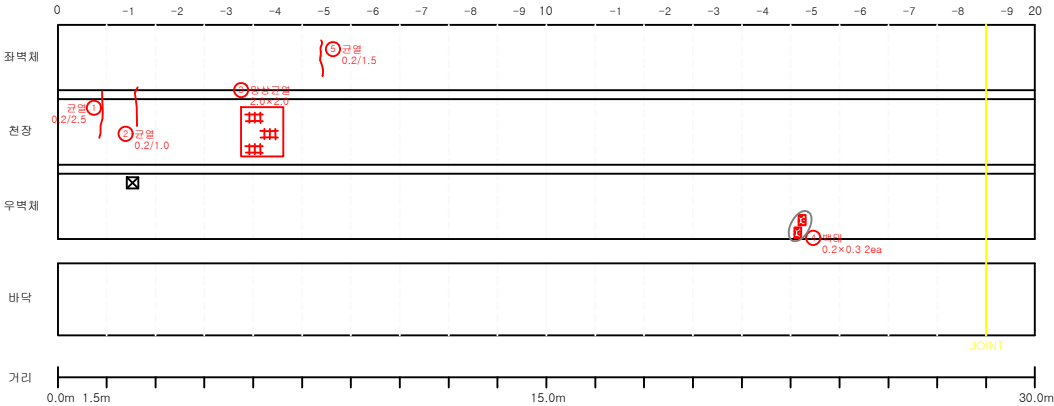


손상 현황 표

번호	손상내용	손상현황			단위	손상 물량	비 고
		폭	길이	개소			
1	균열	0.2	2.5	1	m	2.50	
2	균열	0.2	1.0	1	m	1.00	
3	망상균열	2.0	2.0	1	m ²	4.00	
4	백태	0.2	0.3	2	m ²	0.12	
5	균열	0.2	1.5	1	m	1.50	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							

※ 손상의 폭과 길이 단위는 m이며, 단 균열은 폭 단위 mm 임.


KEY
PLAN

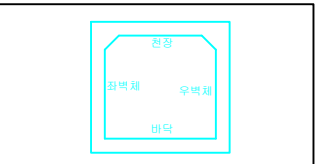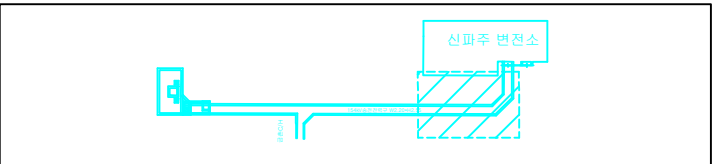

범
례

CW 0.2 균열	망상균열	재료분리	편칭, 공명	동 역 영 2023년 경기북부 송전전력구, 맨홀 철밀안전점검 구역
박리, 박락 파손	시공이음분리, 층분리, 이격	누수, 습윤부	백태	용 역 사 케이아이엠(주)
이물질퇴적 적지물퇴적	철근노출	침식	배관 폐관	정경원 차 2023.06
사석이완 사석탈락	세굴	강재부식	기타	망 도 영 호 신파주-송포인출 - 1

신파주-송포인출 외관조사망도


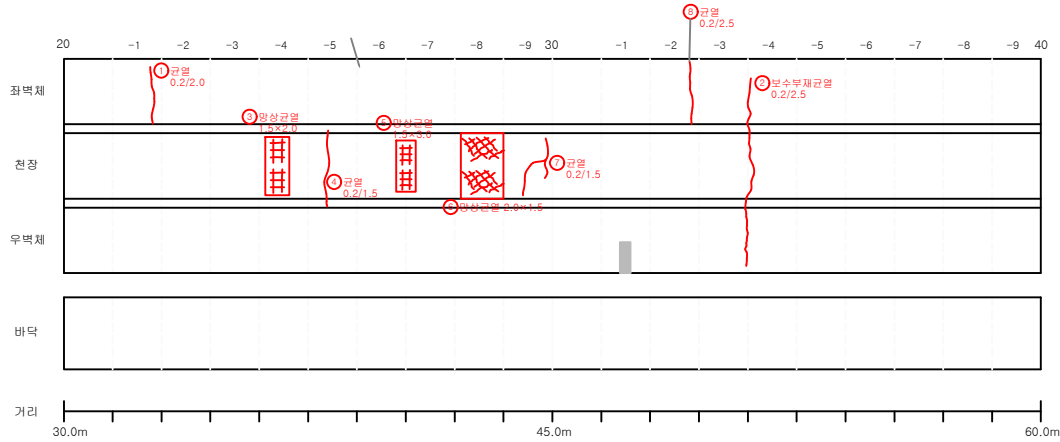


손상 현황 표

번호	손상내용	손상현황			단위	손상 수량	비 고
		폭	길이	개소			
1	균열	0.2	2.0	1	m	2.00	
2	보수부재균열	0.2	2.5	1	m	2.50	
3	망상균열	1.5	2.0	1	m	3.00	
4	균열	0.2	1.5	1	m	1.50	
5	망상균열	1.5	3.0	1	m	4.50	
6	망상균열	2.0	1.5	1	m	3.00	
7	균열	0.2	1.5	1	m	1.50	
8	균열	0.2	2.5	1	m	2.50	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							

※ 손상의 폭과 길이 단위는 m이며, 단 균열은 폭 단위 mm 임.


KEY
PLAN

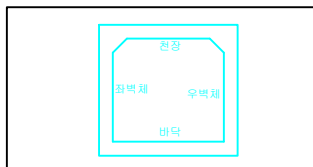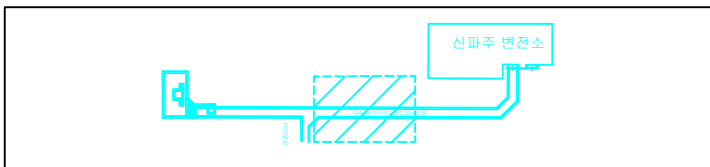

범
례

CW 0.2 균열	망상균열	재료분리	편형, 공동	동역영 2023년 경기북부 송전전력구, 태을 철밀안전점검 용역
벽리, 박락 파손	시공이음분리, 층분리, 이격	누수, 습윤부	벽태	동역사 케이아이엠(주)
이물침투적 적지물침투적	철근노출	침식	배관 폐관	정경원자 2023.06
사석이완 사석탈락	세굴	강재부식	기타	망도영호 신파주-송포인출 - 2

신파주-송포인출 외관조사망도

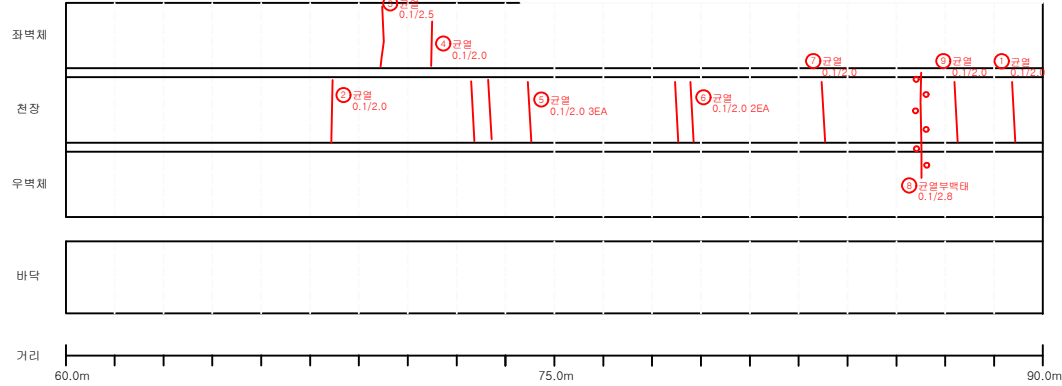


손상 현황 표

번호	손상내용	손상현황			단위	손상 수량	비 고
		폭	길이	개소			
1	균열	0.1	2.0	1	m	2.00	
2	균열	0.1	2.0	1	m	2.00	
3	균열	0.1	2.5	1	m	2.50	
4	균열	0.1	2.0	1	m	2.00	
5	균열	0.1	2.0	3	m	6.00	
6	균열	0.1	2.0	2	m	4.00	
7	균열	0.1	2.0	1	m	2.00	
8	균열부백태	0.1	2.8	1	m	2.80	
9	균열	0.1	2.0	1	m	2.00	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							


※ 손상의 폭과 길이 단위는 m이며, 단 균열은 폭 단위 mm 임.

KEY PLAN

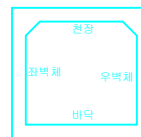

五 二

CW-0.2 균열		 망상균열	 재료분리	 변형, 균열	용역명 2023년 경기북부 순진전력국, 맨홀 정밀안전점검 용역
 박리, 박락 파손	 시공이음분리, 층분리, 이격	 누수, 습상부	 벽태	용역사 케이아이엔(주)	정밀점검자 2023.06 신다연 신다주-송보인출 - 3
 이물질침적 파손, 분탈	 철근 노출	 침식	 배관 파손	용역사 케이아이엔(주)	
 사석이온 사석탈락	 새굴	 강재부식	 기타	용역사 케이아이엔(주)	


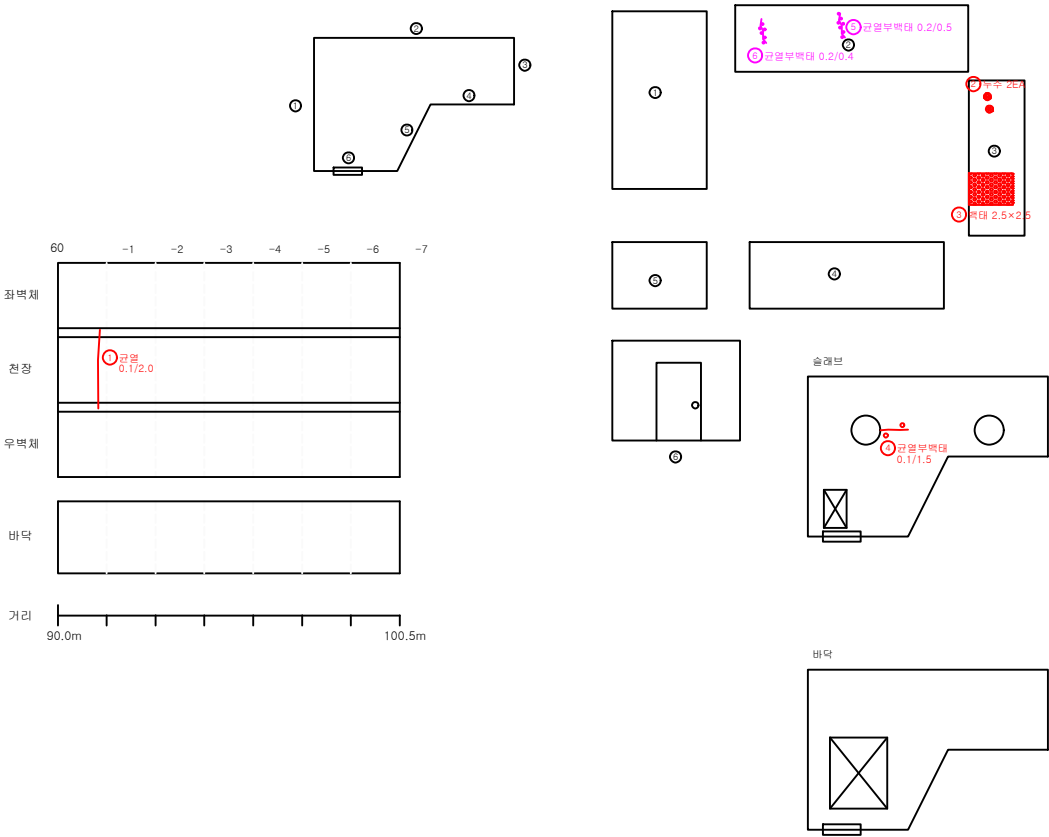


손상현황표

번호	손상내용	손상현황			단위	손상 물량	비 고
		폭	길이	개소			
1	균열	0.1	2.0	1	m	2.00	
2	누수			2	EA	2.00	
3	백태	2.5	2.5	1	㎡	6.25	
4	균열부백태	0.1	1.5	1	m	1.50	
5	균열부백태	0.2	0.5	1	m	0.50	
6	균열부백태	0.2	0.4	1	m	0.40	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							

※ 손상의 폭과 길이 단위는 m이며, 단 균열은 폭 단위 mm 임.

KEY
PLAN

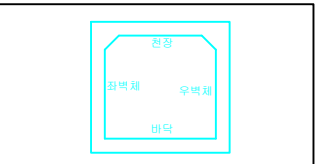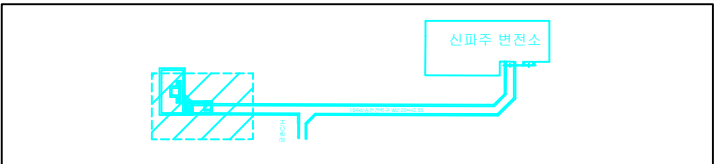

범
례

 CW0.2	 균열	 망상균열	 재료분리	 편청, 공청	동역사 2023년 경기북부 송전전력구, 매출 청밀안전점검 용역
 박리, 박락 파손	 시공이음분리, 층분리, 이격	 누수, 습윤부	 백태		동역사 케이아이엠(주)
 이물침투적 적지물침투적	 철근노출	 청식	 배관 폐관		경관원자 2023.06
 사석이완 사석탈락	 세굴	 강재부식	 기타		망도번호 신파주-송포인출 - 4