
1. 강매교

전 경



교면포장 전경



신축이음 전경



거더 전경



바닥판하면 전경



교대 전경



교각 전경

작업사진



작업전경



작업전경



제원조사



비파괴시험

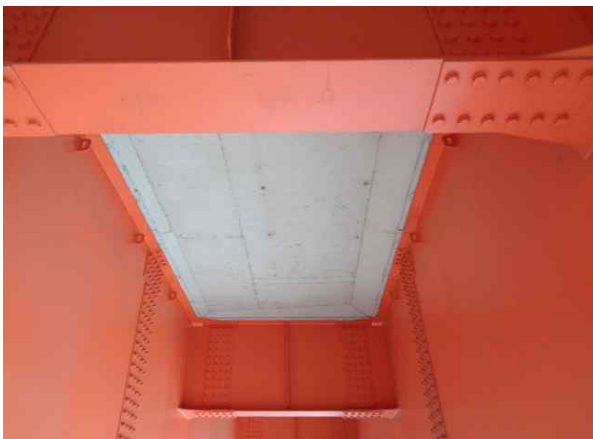


받침장치 연단거리 측정



신축이음 이동량 측정

손상현황 사진

	
S1 캔틸레버부 균열 (0.2mm/1.0m×2EA)	S1 캔틸레버부 균열 (0.2mm/1.0m×2EA)
	
S2 박리 (0.5m×2.0m×3EA)	S1 캔틸레버부 균열 (0.2mm/1.0m)
	
S3 망상균열 (2.0m×5.0m×10EA)	S3 망상균열 (2.0m×5.0m×10EA)

손상현황 사진

	
S4 망상균열 (2.0m×5.0m×10EA)	S5 망상균열 (2.0m×5.0m×10EA)
	
S6 균열 (0.2mm/2.0m)	S6 망상균열 (2.0m×5.0m×5EA)
	
S4-G3 도장손상 (0.1m×0.2m)	S6-G4 도장손상 (0.1m×0.3m)

손상현황 사진



S2-G4 도장손상(0.1m×0.1m)



가로보 상태양호



세로보 상태양호



세로보 상태양호



A2 균열(폭 0.2mm/1.0m)



A2 균열(폭 0.2mm/1.0m)

손상현황 사진



P1 코핑부 망상균열 (5.0m×1.0m)



P2 코핑부 상면 폐코크리트 적치



P5 코핑부 망상균열 (5.0m×1.0m)



P1-Sh1 받침콘크리트 파손 (0.1m×0.3m)



P35-Sh1 받침콘크리트 파손 (0.1m×0.3m×2EA)



P35-Sh1 받침콘크리트 파손 (0.1m×0.3m×2EA)

손상현황 사진



A2 후타재 균열 (0.2mm/0.3m×10EA)



A2 본체 이물질퇴적



A2 하부 누수



A2 하부 누수

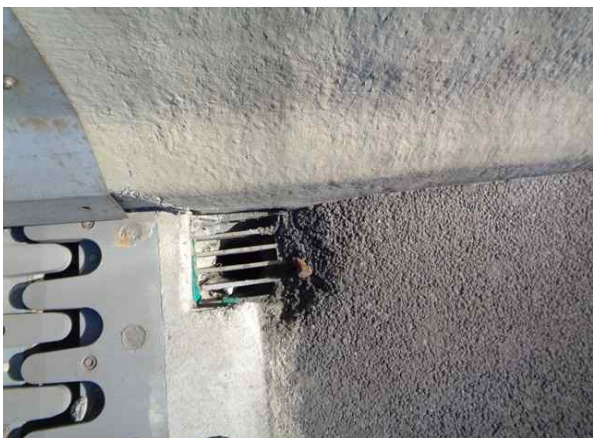


S1 라벨링(1.0m×45.0m)



S1 라벨링(1.0m×50.0m)

손상현황 사진

	
배수관 상태 양호	배수관 상태 양호
	
배수구 상태 양호	배수구 상태 양호
	
S1 방호벽 균열 (0.2mm/0.4m×5EA)	S1 방호벽 균열 (0.2mm/0.8m)

손상현황 사진

	
S2 방호벽 균열부 (0.2mm/7.0m)	S2 방호벽 균열부 (0.3mm/0.5m)
	
S3 방호벽 균열부 (0.2mm/2.5m)	S3 방호벽 균열부 (0.3mm/1.1m)
	
S4 방호벽 균열 (0.2mm/0.5m)	S5 방호벽 균열 (0.2mm/1.2m)

손상현황 사진

	
S6 방호벽 균열(0.3mm/1.2m)	S4 파손(1.0m×0.3m)
	—
P4 점검로 파손(1EA)	—
—	—
—	—