
8. 서문5교(문산방향)

전 경



교면포장 전경



신축이음 전경




거더 전경



바닥판하면 전경



교대 전경

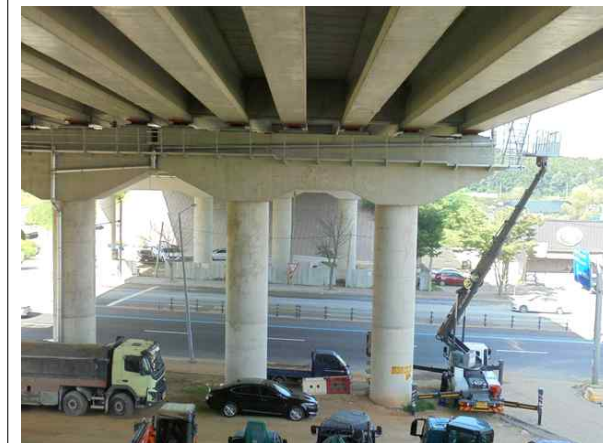

교각 전경

작업사진



작업전경



작업전경



작업전경



비파괴시험



받침장치 연단거리 측정



신축이음 이동량 측정

손상현황 사진

	
바닥판 하면 상태양호	바닥판 하면 상태양호
	
바닥판 하면 상태양호	바닥판 하면 상태양호
	
S1-G5 파손 (0.3m×0.3m)	S1-G5 파손 (0.3m×0.3m)

손상현황 사진

	
S2-G2 파손 (1.0m×0.2m)	S1 G5~6 박리 (0.4m×0.4m)
	
S1 G2~3 균열 (0.2mm/1.2m)	S2 G2~3 균열 (0.2mm/1.2m)
	
S1 G5~6 박리 (0.4m×0.4m)	A1 콘크리트 박락 (0.1m×0.5m)

손상현황 사진

	
A1 콘크리트 박락(0.1m×0.3m)	A1 콘크리트 박락(0.1m×0.3m)
	
P1 기둥부 균열(0.2mm/0.7m)	P1 코핑부 망상균열(10.0m×1.0m)
	
P2 기둥부 균열(0.2mm/1.0m)	P2 기둥부 균열(0.2mm/1.0m)

손상현황 사진

	
P2 코핑부 망상균열 (6.0m×1.0m)	P2 코핑부 망상균열 (6.0m×1.0m)
	
P2 코핑부 망상균열 (8.0m×1.0m)	P1-Sh2 받침 몰탈균열 (0.2mm/0.3m)
	
P1-Sh5 받침 몰탈균열 (0.2mm/0.3m)	P1-Sh5 받침 몰탈균열 (0.2mm/0.3m)

손상현황 사진

	
P1-Sh8 받침 몰탈균열 (0.2mm/0.3m)	P1-Sh8 받침 몰탈균열 (0.2mm/0.3m)
	
P1-Sh10 받침 몰탈균열 (0.2mm/0.3m)	A2-Sh4 받침 콘크리트 파손 (0.2m×0.2m)
	
A2-Sh4 받침 콘크리트 파손 (0.2m×0.2m)	A2 하부 누수 (0.5m/5EA)

손상현황 사진

A2 하부 누수(0.5m/5EA)	A2 하부 누수(0.5m/5EA)
A2 하부 누수(0.5m/5EA)	A1 접속부 파손(2.0m×1.0m)
A1 접속부 이격(12.0m)	A1 접속부 이격(12.0m)

손상현황 사진

	
배수구 상태 양호	배수구 상태 양호
	
배수관 상태 양호	배수구 상태 양호
	
S1 방호벽 균열(0.3mm/1.0m)	S1 방호벽 균열(0.3mm/1.0m)

손상현황 사진



S3 방호벽 균열(0.2mm/1.5m)




S3 방호벽 균열(0.2mm/1.5m)



점검로 상태양호



점검로 상태양호

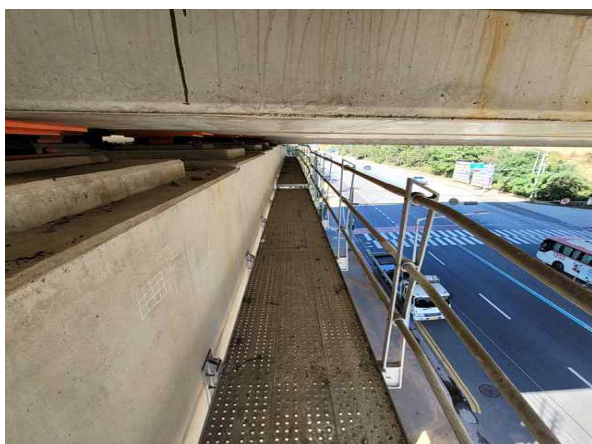

점검로 상태양호



점검로 상태양호