
9. 서문9교(서울방향)

전 경



교면포장 전경



신축이음 전경



거더 전경



바닥판하면 전경



교대 전경



교각 전경

작업사진




작업전경



작업전경



작업전경

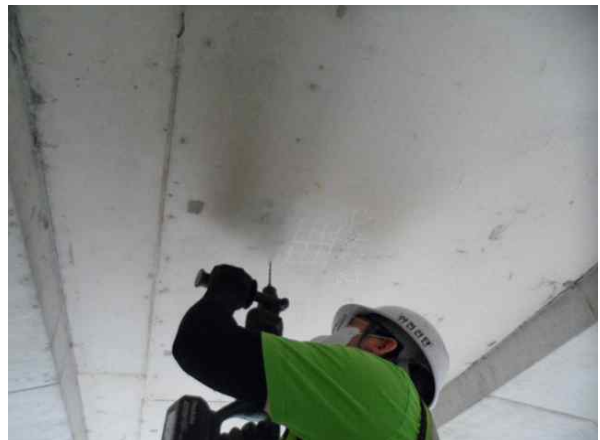

비파괴시험




받침장치 연단거리 측정



신축이음 이동량 측정

손상현황 사진

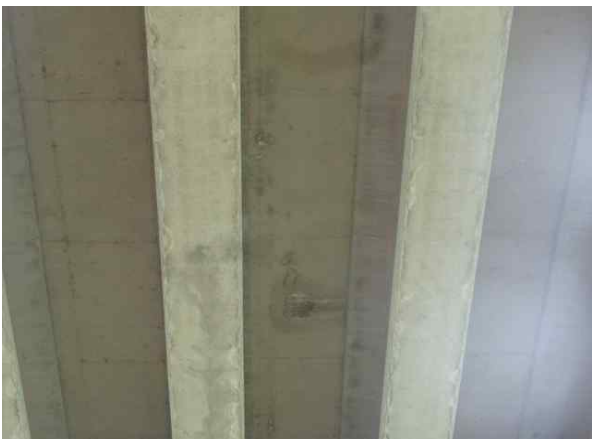	
S1 망상균열 (3.0m×10.0m×2EA)	S5 균열부백태 (0.2m×1.0m)
	
S5 균열부백태 (0.2m×1.0m)	S5 균열부백태 (0.2m×1.5m)
	
S5 균열부백태 (0.2m×1.5m)	S5 백태 (0.3m×0.5m)

손상현황 사진

	
S5 백태 (1.0m×1.0m)	S6 망상균열 (15.0m×10.0m×4EA)
	
S6 망상균열 (15.0m×10.0m×4EA)	거더외부 상태양호
	
거더외부 상태양호	거더외부 상태양호

손상현황 사진

거더내부 상태양호	거더내부 상태양호
거더내부 상태양호	거더 상태양호
거더 상태양호	거더 상태양호

손상현황 사진

	
거더 상태양호	S6 타설블량(0.2m×0.4m)
	
가로보 상태양호	가로보 상태양호
	
가로보 상태양호	A1 균열부백태(0.2m×1.5m)

손상현황 사진



A1 망상균열 (1.0m x 2.0m)



A1 균열부백태 (0.2m x 1.5m)



A2 균열 (0.2mm/3.0m)



A2 균열 (0.2mm/3.0m)



A2 균열 (0.2mm/5.5m)



A2 날개벽 침하 (1.0m)

손상현황 사진

A photograph showing a concrete wing wall (날개벽) with a visible vertical crack and a measurement of 1.0m indicating settlement (침하).	A photograph of a concrete coping (코핑부) showing a vertical crack with a width of 0.2mm, extending over a length of 2.0m across 4EA.
A2 날개벽 침하(1.0m)	P5 코핑부 균열(0.2mm/2.0m×4EA)
A photograph of a concrete coping (코핑부) showing a vertical crack with a width of 0.2mm, extending over a length of 1.0m across 4EA.	A photograph of a concrete coping (코핑부) showing a vertical crack with a width of 0.2mm, extending over a length of 10.0m across 5EA.
P5 코핑부 균열(0.2mm/1.0m×4EA)	P6 코핑부 균열(0.2mm/10.0m)
A photograph of a concrete coping (코핑부) showing a vertical crack with a width of 0.2mm, extending over a length of 10.0m across 5EA.	A photograph of a concrete support (받침물탈) showing a vertical crack with a width of 0.2mm, extending over a length of 0.4m across 5EA.
P6 코핑부 균열(0.2mm/10.0m)	P1-Sh1 받침물탈 균열(0.2mm/0.4m×5EA)

손상현황 사진



P1-Sh3 받침물탈 균열 (0.2mm/0.4m×4EA)



P1-Sh2 받침물탈 균열 (0.2mm/0.4m×3EA)



P2-Sh1 받침물탈 파손 (0.1m×0.1m)



P3-Sh5 플레이트 부식 (1EA)



P3-Sh8 받침물탈 균열 (0.2mm/0.2m×2EA)



P4-Sh8 받침물탈 균열 (0.2mm/0.2m×2EA)

손상현황 사진



P5-Sh10 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh1 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh11 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh12 받침물탈 파손 (0.1m×0.1m)



P5-Sh2 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh3 받침물탈 균열 (0.1mm/0.2m×2EA)

손상현황 사진



P5-Sh5 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh4 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh6 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh9 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh7 받침물탈 균열 (0.1mm/0.2m×2EA)



P5-Sh8 받침물탈 균열 (0.1mm/0.2m×2EA)

손상현황 사진

	
A1 차수판 앵커탈락(1EA)	A1 후타재 균열 (0.2mm/0.3m×20EA)
	
A1 후타재 균열 (0.2mm/0.3m×20EA)	A1 후타재 균열 (0.2mm/0.5m×20EA)
	
A1 후타재 균열 (0.2mm/0.5m×20EA)	P3 차수판 앵커탈락(2EA)

손상현황 사진



S7 접속부 이격(12.0m)



S7 접속부 이격(12.0m)



S7 접속부 이격(12.0m)



배수구 상태 양호



배수구 상태 양호



배수구 상태 양호 - 금회

손상현황 사진



배수구 상태 양호 - 22년 상반기



S1 균열 (0.2mm/1.5m×8EA)



S1 균열 (0.2mm/1.0m)



S1 균열 (0.2mm/1.5m)



S1 균열부 백태 (0.1m×1.0m)



S2 균열 (0.2mm/1.5m×14EA)

손상현황 사진



S2 균열 (0.2mm/1.5m×10EA)




S3 균열 (0.2mm/1.5m×16EA)



S4 균열 (0.2mm/1.5m×17EA)



S5 균열 (0.2mm/1.5m×24EA)

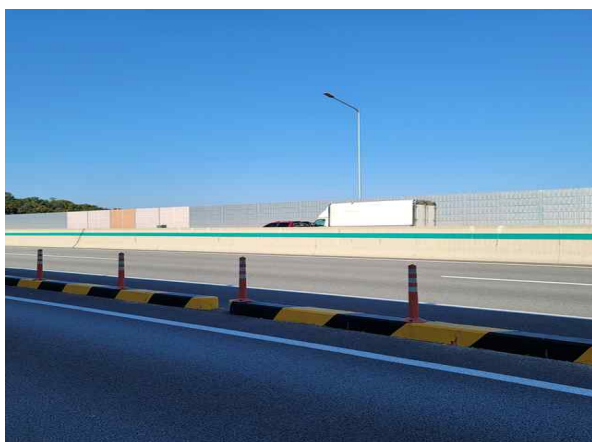

S5 균열 (0.2mm/1.5m×13EA)



S6 균열 (0.2mm/1.5m×12EA)

손상현황 사진

	
S6 균열 (0.2mm/1.5m)	S6 균열부백태 (0.2m×1.5m)
	
S7 균열 (0.2mm/1.5m×6EA)	S7 접속부 단차 (1.5m)
	
S7 접속부 단차 (1.5m)	P4 점검로 폐자재 적치 (15.0m×1.0m)

손상현황 사진

	
P4 점검로 폐자재 적치 (15.0m×1.0m)	P4 점검로 폐자재 적치 (15.0m×1.0m)
	-
P4 점검로 폐자재 적치 (15.0m×1.0m)	-
-	-
-	-