

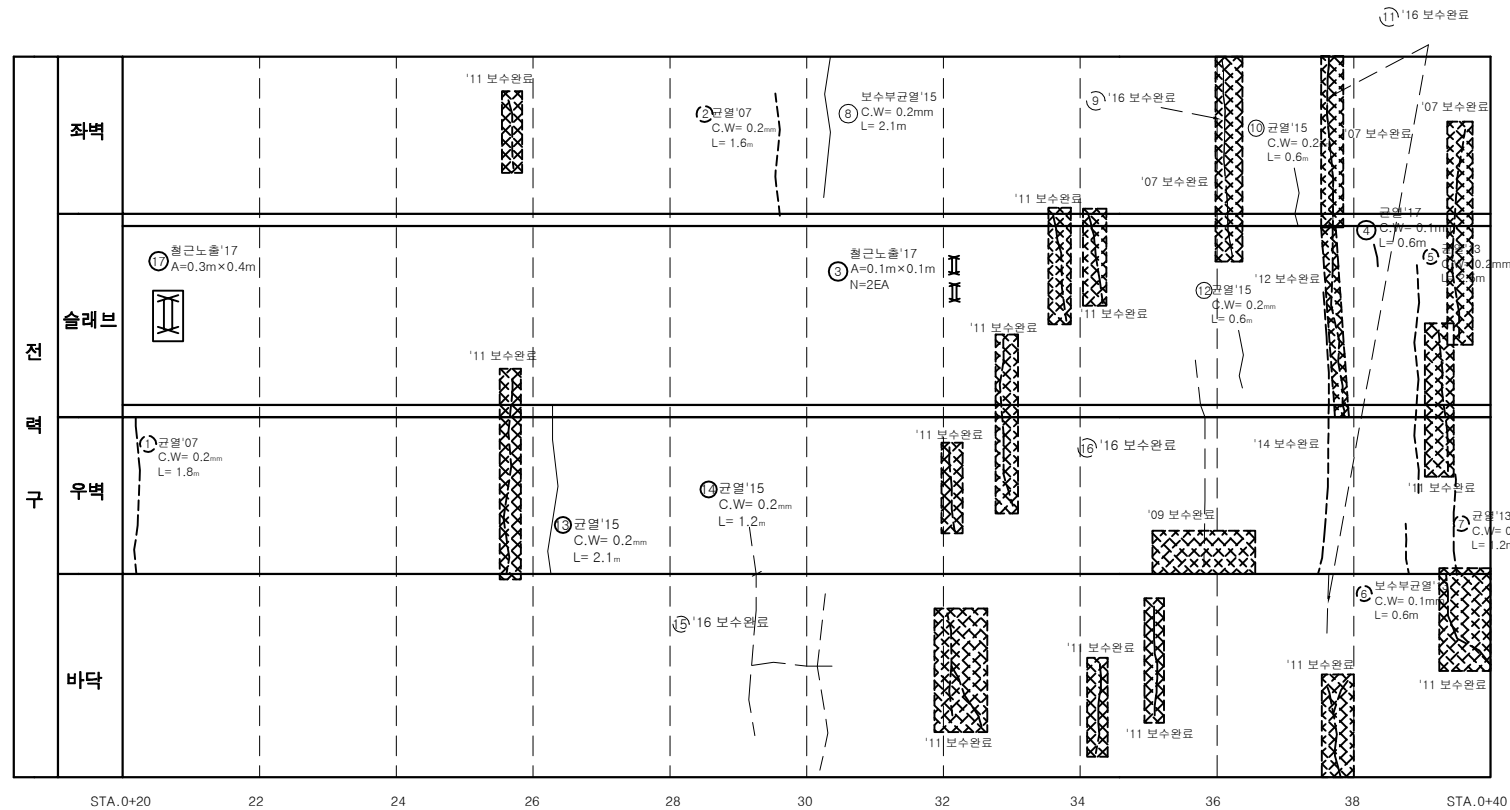


여의도공동구 (의사당로A)

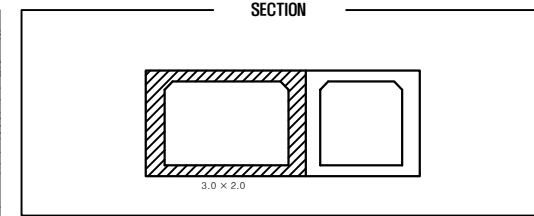

여의도 공동구 - 의사당로 A 전력구 (STA. 0+020 m ~ 0+040m)

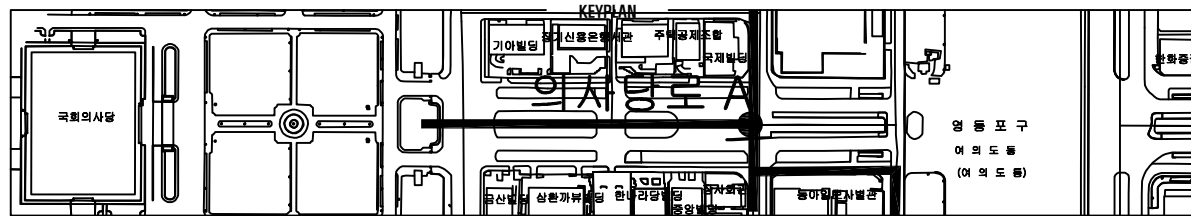

손상률량표

연번	연도	행위내용	정밀검역					최종보수내역		비고
			목	길이	단면	단위	개수	공법명	비고	
1	2007	관설	0.2	1.80	1.80	m	1		-	
2	2007	관설	0.2	1.80	1.80	m	1		-	
3	2017	철근노출	0.1	0.10	0.02	m	2		-	중요
4	2017	관설	0.1	0.80	0.80	m	1		-	
5	2013	관설	0.2	2.50	2.50	m	1		-	
6	2013	관설	0.1	0.80	0.80	m	1		-	
7	2013	관설	0.2	1.20	1.20	m	1		-	
8	2015	보수부 관설	0.2	2.10	2.10	m	1		-	재결합
9	2015	보수부 관설	0.5	2.80	2.80	m	1	2016 주입보수공법	3.36	
10	2015	관설	0.2	0.80	0.80	m	1		-	
11	2015	보수부 관설	0.4	3.20	3.20	m	1	2016 주입보수공법	3.84	
12	2015	관설	0.2	0.80	0.80	m	1		-	
13	2015	관설	0.2	2.10	2.10	m	1		-	
14	2015	관설	0.2	1.20	1.20	m	1		-	
15	2015	관설	0.4	4.00	4.00	m	1	2016 주입보수공법	4.80	
16	2015	보수부 관설	0.5	3.10	3.10	m	1	2016 주입보수공법	3.72	
17	2017	철근노출	0.3	0.40	0.12	m	1		-	중요


서울시 시설관리공단


TITLE OF PROJECT

2019년 공동구 정밀점검용역 (여의도공동구)



TITLE OF SHIFT

의사당로 A 전력구 외관조사망도

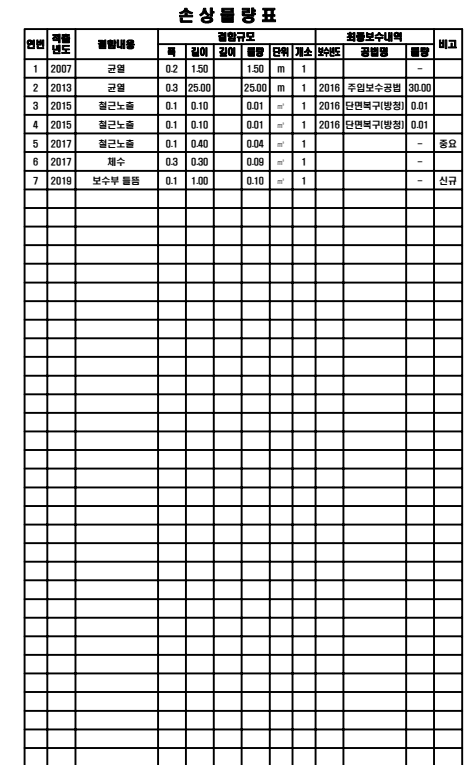

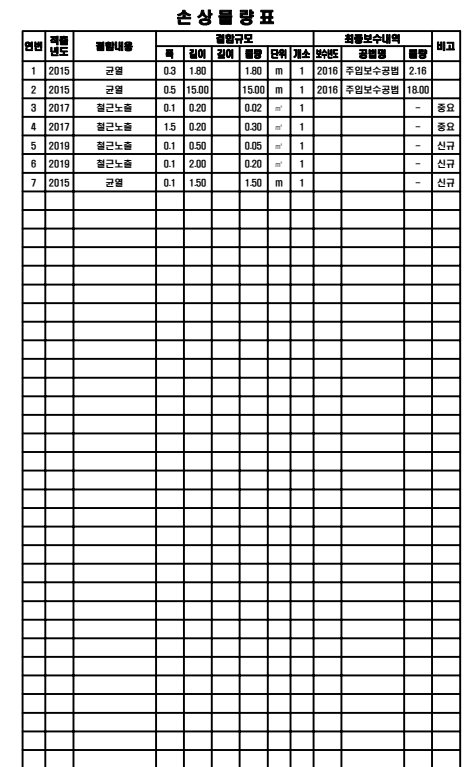

여의도 공동구 - 의사당로 A 전력구 (STA. 0+100 m ~ 0+120m)

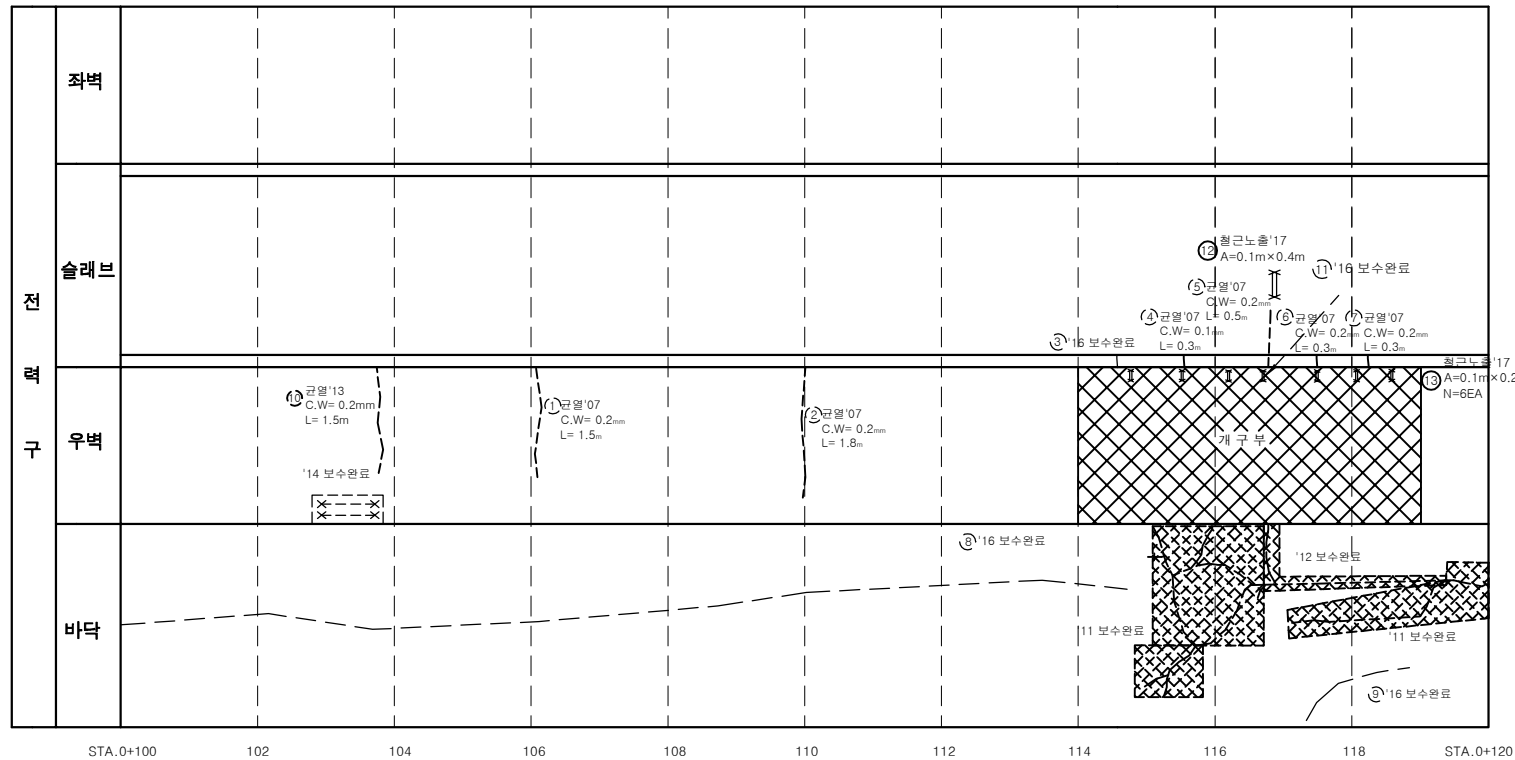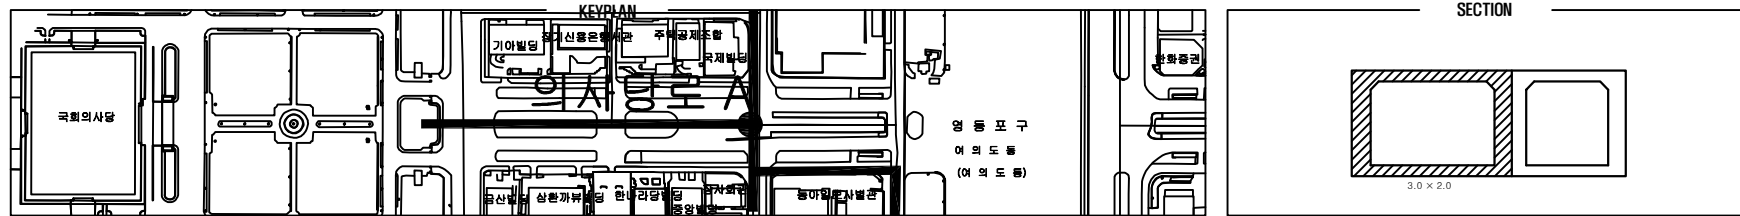

손상량량표

연번	연도	행위내용	결함구도				최종보수내역		비고
			목	길이	깊이	수량	구분	구분명	
1	2007	균열	0.2	1.50	1.50	m	1		-
2	2007	균열	0.2	1.80	1.80	m	1		-
3	2007	균열	0.2	0.30	0.30	m	1	표면치리공법	0.36
4	2007	균열	0.1	0.30	0.30	m	1		-
5	2007	균열	0.2	0.50	0.50	m	1		-
6	2007	균열	0.2	0.30	0.30	m	1		-
7	2007	균열	0.2	0.30	0.30	m	1		-
8	2015	균열	0.3	15.00	15.00	m	1	주입보수공법	18.00
9	2013	균열	0.3	2.00	2.00	m	1		중요
10	2013	균열	0.2	1.50	1.50	m	1		-
11	2015	철근노출	0.1	0.10	0.01	m	1	단면복귀방정	0.01
12	2017	철근노출	0.1	0.40	0.04	m	1		중요
13	2017	철근노출	0.1	0.20	0.12	m	6		중요


서울시 시설관리공단


TITLE OF PROJECT


2019년 공동구 정밀점검용역 (여의도공동구)

TITLE OF SHIFT

의사당로 A 전력구 외관조사망도

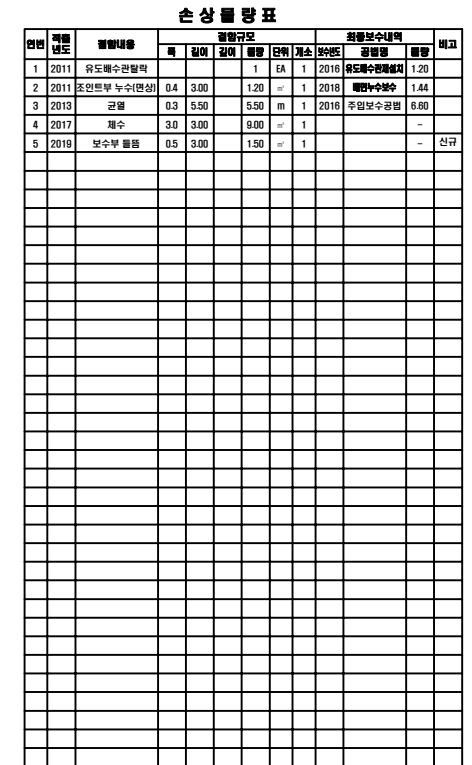


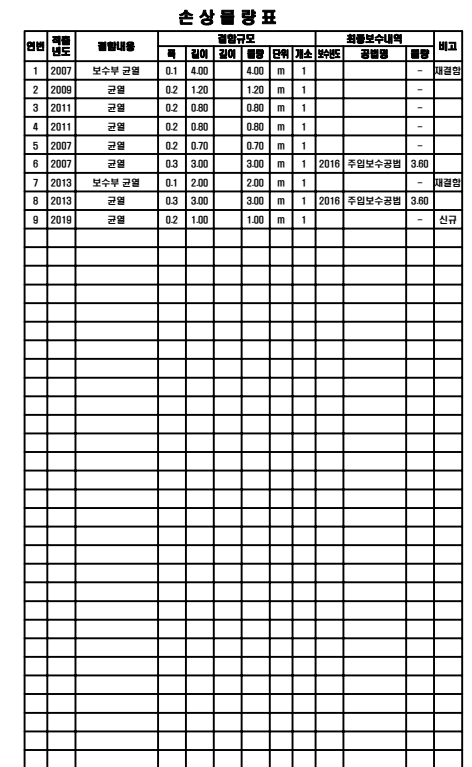
[illegible]

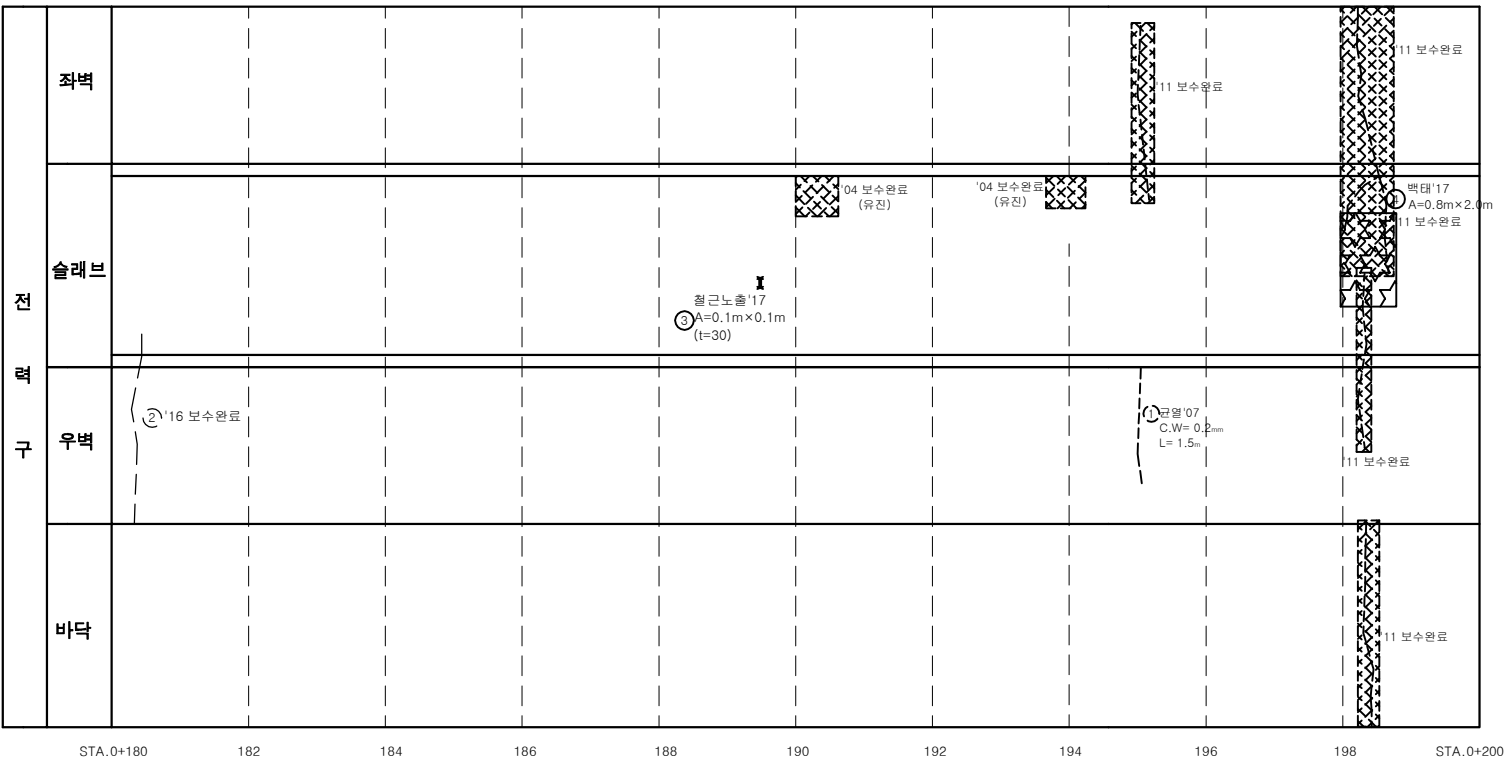[illegible][illegible]



The figure contains three architectural drawings. On the left is a 'KEY PLAN' showing a site layout with various labeled areas such as '국회의사당' (National Assembly Building), '국립중앙박물관' (National Central Museum), and '국립현대미술관' (National Modern Museum). A thick black line indicates a specific path or boundary. In the center is a 'SECTION' drawing showing a cross-section of a building with a hatched area representing a specific material or structure. Below the section is a scale indicator '3.0 x 2.0'.

[illegible]

여의도 공동구 - 의사당로 A 전력구 (STA. 0+220 m ~ 0+240 m)

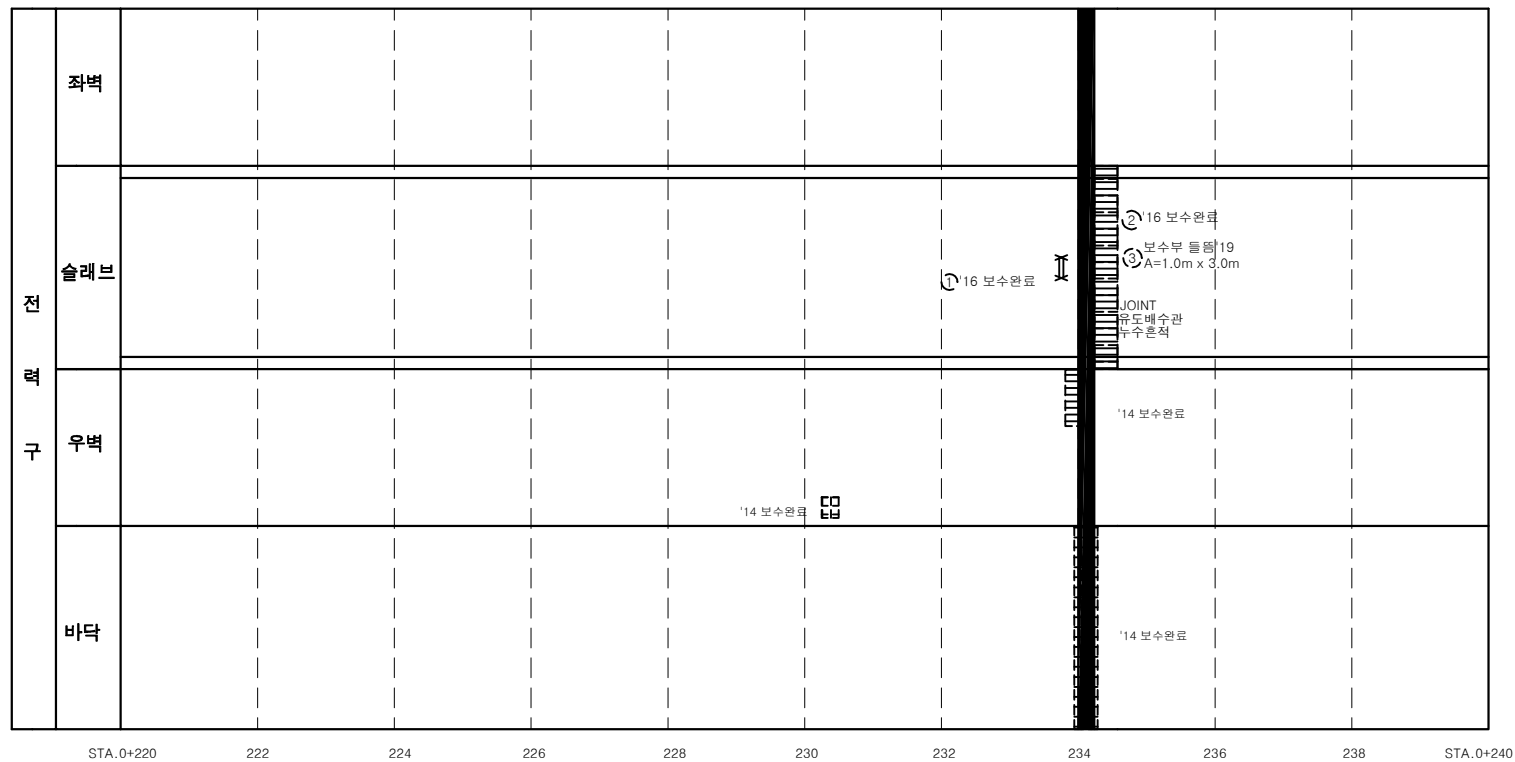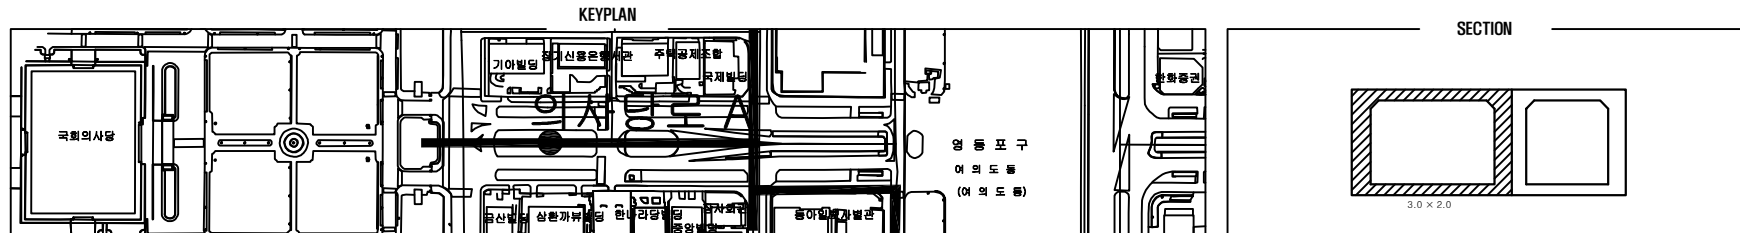[illegible]

여의도 공동구 - 의사당로 A 전력구 (STA. 0+280 m ~ 0+300 m)

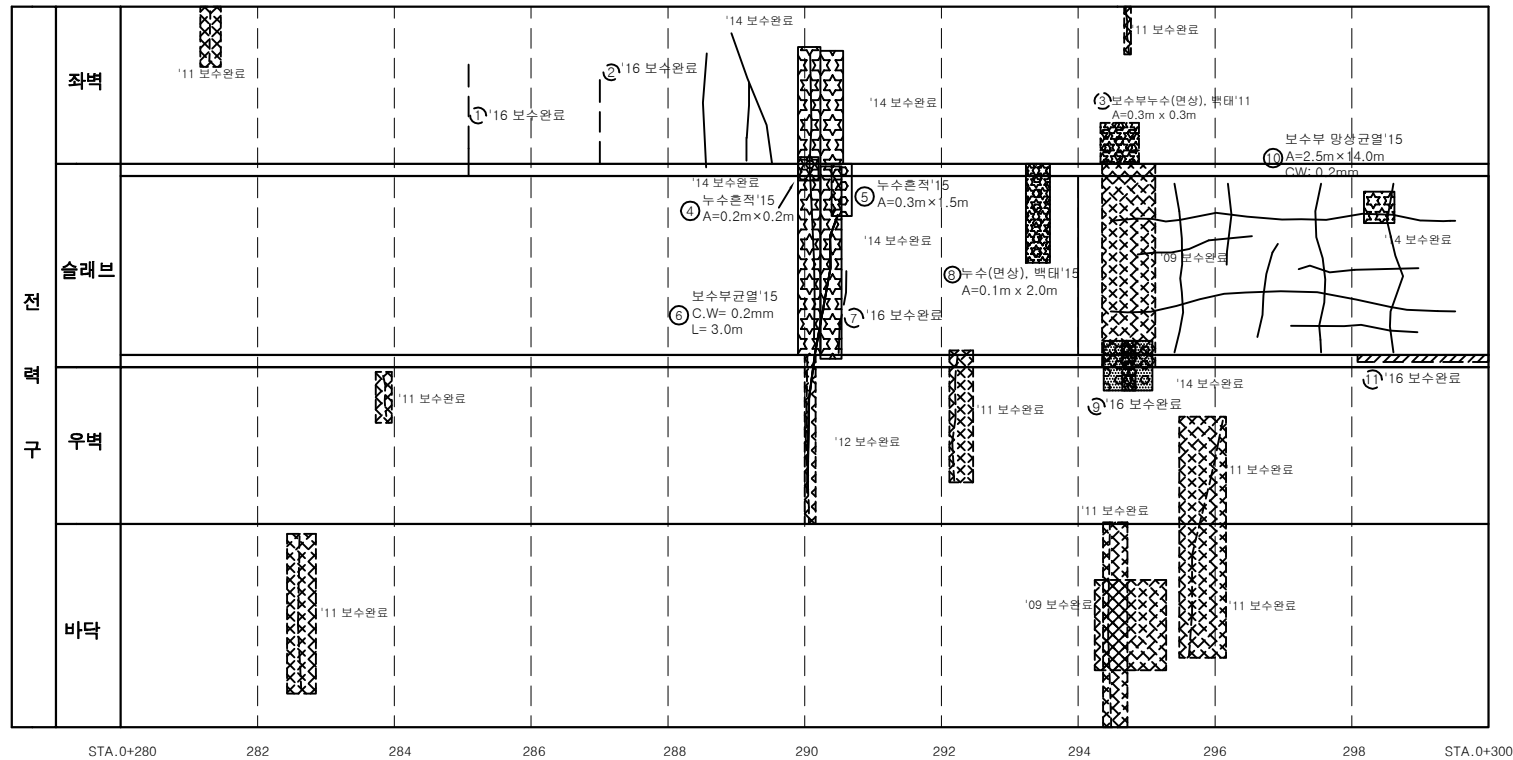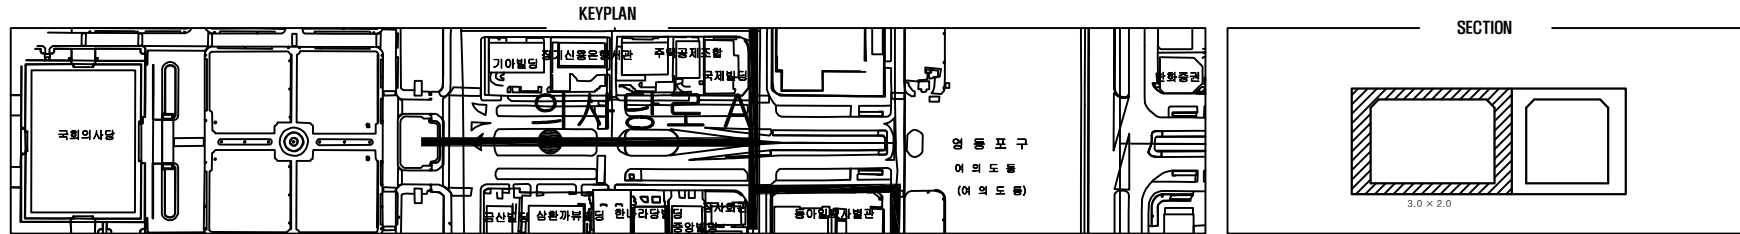

손상량량표

연번	연도	행위내용	정밀구분				최종보수내역				비고
			구분	길이	단위	개수	구분	길이	단위	개수	
1	2007	구분	0.1	1.50	m	1	2016	표면처리공법	1.80		
2	2007	구분	0.1	0.80	m	1	2016	표면처리공법	0.72		
3	2011	보수부(면상) 백태	0.3	0.30	m	1				-	재결합
4	2015	누수흔적	0.2	0.20	m	1				-	
5	2015	누수흔적	0.3	1.50	m	1				-	
6	2015	보수부 구분	0.2	3.00	m	1				-	재결합
7	2015	보수부 구분	0.3	0.70	m	1	2016	주입보수공법	0.84		
8	2015	누수(면상) 백태	0.1	2.00	m	1				-	
9	2015	보수부 누수 백태	0.1	1.00	m	1	2016	누수보수공법	0.12		
10	2015	보수부 양상구분	2.5	14.00	m	1				-	재결합
11	2015	재결합	0.5	2.00	m	1	2016	단면복구공법	1.20		

서울시 시설관리공단

TITLE OF PROJECT

2019년 공동구 정밀점검용역 (여의도공동구)

TITLE OF SHIFT

의사당로 A 전력구 외관조사망도

