
3. 양성교(하)

전경 및 작업사진



교면포장 전경



신축이음 전경



바닥판하면 전경



연석 및 난간 전경



거더 전경



교대 전경

전경 및 작업사진



교각 전경



교량받침 전경



작업전경



작업전경



작업전경



비파괴시험

손상현황 사진

	
S1 균열(0.1mm/1.7m)	S1 박락 보수
	
S1 백태 (0.2×0.2)	S2 균열(0.1mm/1.6m)
	
S2 균열 보수	S2 균열(0.2mm/1.5m)

손상현황 사진

	
S2 균열부 백태 보수	S2 물끓기흠 미시공
	
S2 균열 보수	S4 박락 및 철근노출(0.3×0.2)
	
S4 박락 보수	S4 물끓기흠 미시공

손상현황 사진

	
S4 파손, 재료분리 보수	S4 파손 (0.6×0.1)
	
S5 균열(0.2mm/1.6m)	S5 그을음 발생
	
S6 균열(0.2mm/0.3m)	S6 박락 (0.1×0.3)

손상현황 사진

	
S6 물끓기흙 미시공	S6 파손 및 철근노출(0.2×0.6)
	
S6 균열(0.2mm/1.6m)	S7 박락 보수
	
S7 파손 (0.2×0.5)	S8 균열(0.1mm/1.6m)

손상현황 사진

	
S1-G1 백태(0.3×0.2)	S3-G1 박락(0.7×0.2)
	
S3-G1 박락 보수	S3-G1 박락 및 철근노출(0.5×0.5)
	
S3-G1~6 보수부 들뜸(0.5×0.2)	S4-G1 박락 및 철근노출(0.5×0.5)

손상현황 사진

	
S4-G1~6 보수부 들뜸(0.5×0.3)	S6-G1 박리 보수
	
S6-G1~5 들뜸(1.0×0.3)	S7-G2 박락(0.3×0.1)
	
S7-G3 균열 보수	S7-G1~6 들뜸(1.0×0.3)

손상현황 사진

	
S7-G6 들뜸(0.5×2.0)	S8-G2 박락 보수
	
S8-G1 들뜸(0.8×0.2)	S8-G1 들뜸(0.8×0.2)
	
S3 재료분리(0.1×1.5)	S3 재료분리(0.1×1.5)

손상현황 사진

A photograph showing exposed steel reinforcement bars (rebar) on a concrete surface, with some rust and peeling paint visible.	A photograph showing a concrete surface with a visible crack and a repair patch applied along the crack line.
S6 철근노출(0.1×0.6)	S7 균열 보수
A photograph showing a concrete surface with a significant area of delamination or lifting, where the top layer of concrete has separated.	A photograph showing a large, irregular area of concrete damage or spalling, with exposed aggregate and rebar.
S8 들뜸(0.2×0.6)	A1 파손(0.8×0.5)
A photograph showing a concrete surface with significant rust staining and corrosion, particularly around a vertical joint or crack.	A photograph showing a concrete surface with water marks and staining, indicating past water leakage or pooling.
A1 녹오염	A1 체수흔적

손상현황 사진

	
A1 균열(0.3mm)	A1 법면배수로 토사퇴적
	
A1 법면 배수로 파손 및 공동	A1 법면 배수로 파손 및 공동
	
A1 균열(0.2mm)	A1 재료분리(0.6×0.2)

손상현황 사진

	
A2 박리(0.6×0.6)	A2 파손(0.1×0.8)
	
A2 파손 및 철근노출	A2 균열(0.3mm)
	
A2 균열(0.3mm)	A2 보호블럭 침하

손상현황 사진

	
P1 코핑부 재료분리(0.1×4.0)	P1 코핑부 배면 균열 보수
	
P2 코핑부 파손(0.3×0.1)	P2 코핑부 균열(0.2mm/0.5m)
	
P3 코핑부 파손(1.5×1.0)	P3 기둥부 철근노출(0.1×0.2)

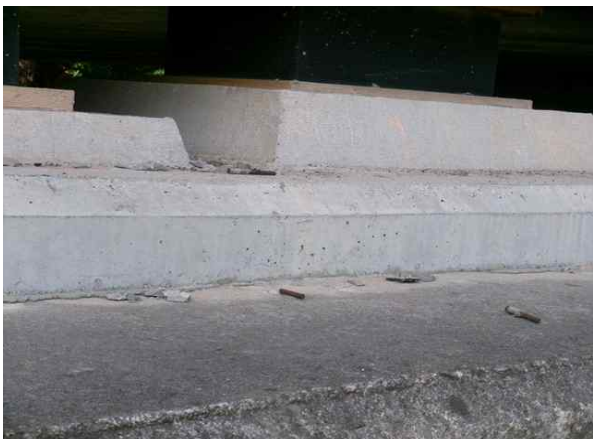
손상현황 사진

	
P3 코평부 누수흔적(0.3×3.0)	P3 페콘크리트 적치
	
P4 코평부 파손(0.1×0.2)	P4 코평부 파손(0.6×0.1)
	
P5 기둥부 망상균열(0.2mm)	P5 기둥부 균열(0.2mm)

손상현황 사진

	
P5 코핑부 재료분리(3.0×0.1)	P6 기둥부 균열(0.3mm)
	
P6 코핑부 망상균열(0.2mm)	P6 코핑부 균열부백태(0.1×0.1)
	
P6 코핑부 재료분리(1.0×0.2)	P7 기둥부 균열(0.5×0.5)

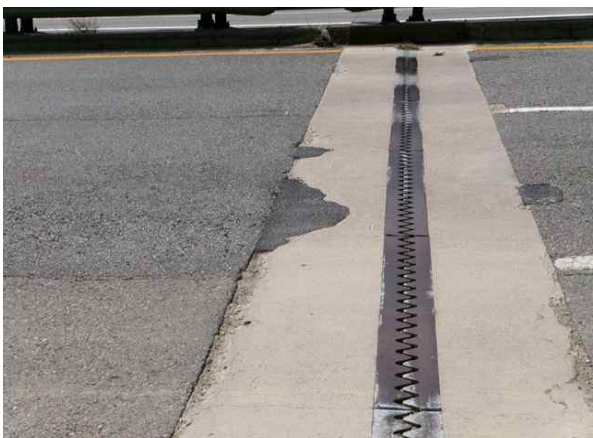
손상현황 사진

	
P7 코평부 하면 균열(0.5×0.5)	A2-SH1 받침몰탈 균열(0.1mm/0.1m)
	
A2-SH1 본체 부식	P1-SH6 받침몰탈 균열(0.3mm/0.3m)
	
P2-SH12 받침몰탈 균열(0.2mm/0.1m)	P3-SH5 본체 부식

손상현황 사진

	
P3-SH6 받침몰탈 균열(0.2mm/0.1m)	P4-SH6 몰탈 파손(0.1×0.5)
	
P6-SH12 받침몰탈 균열(1.0mm/0.2m)	A1 차수판 볼트탈락
	
A1 후타재 균열(0.2mm/0.4m)	A1 후타재 파손(0.1×4.0)

손상현황 사진

	
A2 유간 토사퇴적(13.0)	A2 차수판 볼트탈락
	
A2 후타재 균열(0.2mm/0.5m)	A2 후타재 파손(0.1×0.8)
	
A2 후타재 파손(0.1×2.0)	P3 신축이음 본체 탈락

손상현황 사진

	
P3 신축이음 하부 누수	P3 유간 토사퇴적(13.0)
	
P3 차수판 볼트탈락	P3 후타재 균열(0.2mm/0.4m)
	
P3 후타재 파손(0.2×0.5)	P6 후타재 파손(0.1×2.0)

손상현황 사진

	
P6 후타재 박리(0.1×1.2)	P6 후타재 파손(0.1×1.2)
	
S1 아스콘 균열(4.0)	S1 아스콘 마모(2.0×0.6)
	
S1 아스콘 균열(20.0)	S2 아스콘 균열(1.4)

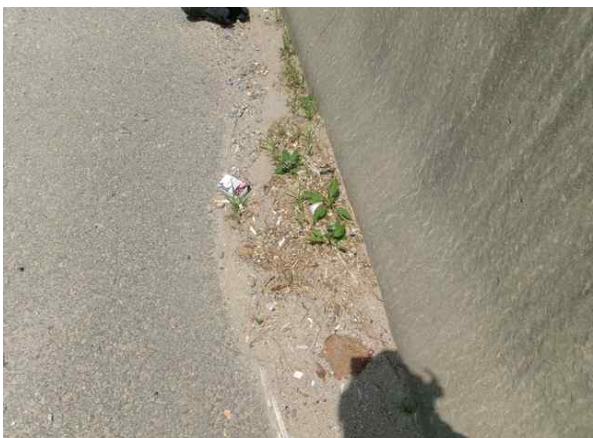
손상현황 사진

	
S3 아스콘 균열(7.0)	S4 아스콘 망상균열(1.5×11.0)
	
S4 아스콘 망상균열(2.0×2.0)	S5 아스콘 망상균열(1.5×9.0)
	
S5 아스콘 균열(5.0)	S6 아스콘 망상균열(1.5×5.0)

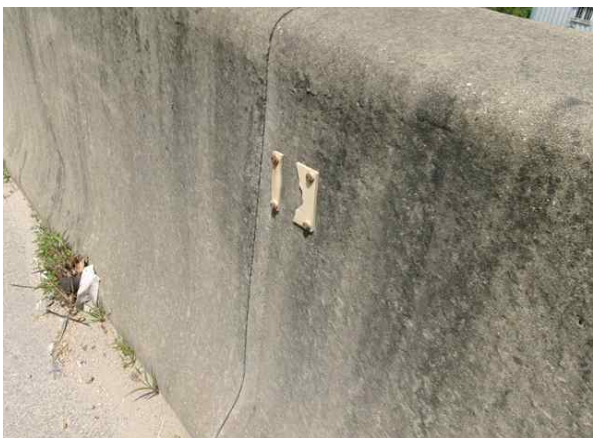
손상현황 사진

	
S6 아스콘 균열(1.5)	S6 아스콘 패임 보수
	
S6 포장 균열(30.0)	S7 아스콘 망상균열(0.2×0.2)
	
S7 포장 균열(1.5)	S8 아스콘 패임 보수

손상현황 사진

	
S1 배수관 길이부족	S1 배수구 막힘
	
P2 배수관 길이부족	S3 배수구 막힘
	
S6 배수구 막힘	S7 배수구 막힘

손상현황 사진

	
S1 균열부 백태(0.1×0.2)	S1 균열부 백태(0.2×1.0)
	
S1 텔레이네이트 파손	S1 백태(0.1×0.2)
	
S1 파손(0.3×0.3)	S2 균열(0.1mm/5.0m)

손상현황 사진

	
S2 균열(0.3mm/0.8m)	S3 망상균열(0.2×25.0)
	
S4 균열(0.2mm/2.0m)	S4 망상균열(1.2×1.0)
	
S4 중분대 파손(0.2×0.6)	S5 망상균열(1.2×1.2)

손상현황 사진

	
S5 보수부 들뜸 및 파손(0.8×1.5)	S5 중분대 파손(0.5×2.0)
	
S5 충분리(0.1×1.0)	S4 균열(0.1mm/0.3m)
	
S6 균열부 백태(0.1×0.5)	S6 델리네이트파손

손상현황 사진

	
S6 중분대 파손(0.3×0.6)	S7 균열부 백태(0.1×0.2)
	
S7 방음벽 파손	S7 균열(0.1mm/0.5m)
	
S8 균열부 백태(0.2×30.0)	S8 텔리네이트 파손

손상현황 사진

	
S5 망상균열(1.0×1.0)	S5 박락(0.2×0.2)
	
S8 백태(0.1×0.2)	S8 철근노출(0.1×0.1)
—	—
—	—