
2. 천안2교

전 경



교면포장 전경



난간 및 연석 전경



배수구 전경



바닥판하면 전경



교대 전경



교각 전경

작업사진



제원조사



작업사진



작업사진



작업사진



비파괴시험



비파괴시험

손상현황 사진

	
바닥판 하면 전경	바닥판 하면 전경
	
S1 재료분리 (0.4m×0.2m)	S1 파손 (0.3m×2.0m)
	
S1 파손 (0.3m×2.0m)	S1 파손 및 철근노출

손상현황 사진

	
S1 균열 (CW=0.1mm)	S2 균열 (CW=0.1mm)
	
S2 균열 (CW=0.1mm)	S2 균열 (CW=0.2mm)
	
S2 누수 및 백태 (0.8m×1.8m)	S2 누수 및 백태 (1.5m×1.5m)

손상현황 사진

	
S2 철근노출 (0.1m×0.1m×2EA)	S2 철근노출 (0.1m×0.1m×2EA)
	
S2 파손 (2.0m×0.3m)	S2 파손 및 철근노출 (0.3m×0.3m)
	
S2 파손 및 철근노출 (2.0m×1.0m)	S3 균열 (CW=0.2mm)

손상현황 사진

	
S3 균열 (CW=0.2mm)	S3 균열 (CW=0.2mm)
	
S3 균열 (CW=0.2mm)	S3 누수 및 백태 (0.8m×2.0m)
	
S3 실링미처리	S3 누수 및 백태 (1.0m×1.0m)

손상현황 사진



S3 박리 (0.1m×0.6m)




S3 파손 (4.0m×0.3m)



교대 전경 (A1)



교대 전경 (A2)

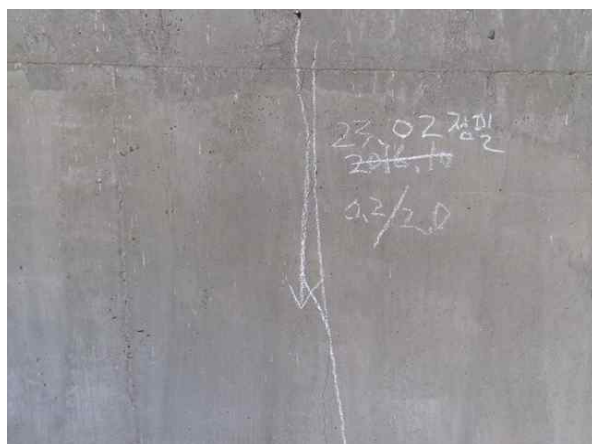

A1 균열 (CW=0.2mm)




A1 하단 박리 (0.3m×2.0m)

손상현황 사진

	
A1 측면 상단 파손(0.8m×1.0m)	A1 측면 상단 파손(0.8m×1.0m)
	
A1 접속부 실링재 박리(0.1m×5.0m)	A2 누수흔적(0.3m×2.0m)
	
A2 균열 (CW=0.2mm)	A2 균열 (CW=0.2mm)


손상현황 사진

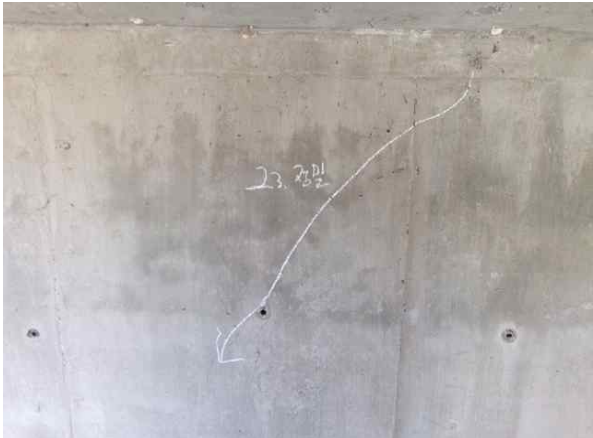	
교각 전경	교각 전경
	
P1 균열 (CW=0.1mm)	P1 균열 (CW=0.2mm)
	
P1 균열 (CW=0.3mm)	P1 균열 (CW=0.5mm)

손상현황 사진

	
P1 균열 (CW=0.2mm)	P2 폐자재적치
	
P1 하단부 침식 (3.0m×0.4m)	P1 하단부 침식 (3.0m×0.4m)
	
P2 박락 (0.3m×3.5m)	P2 박락 및 철근노출 (0.8m×2.0m)

손상현황 사진

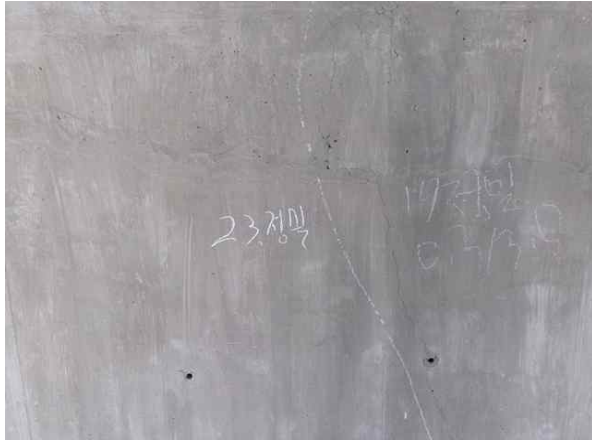

P2 균열 (CW=0.3mm)



P2 균열 (CW=0.2mm)




P2 균열 (CW=0.3mm)



P1 하단부 침식(9.0m×0.4m)




교면포장 전경

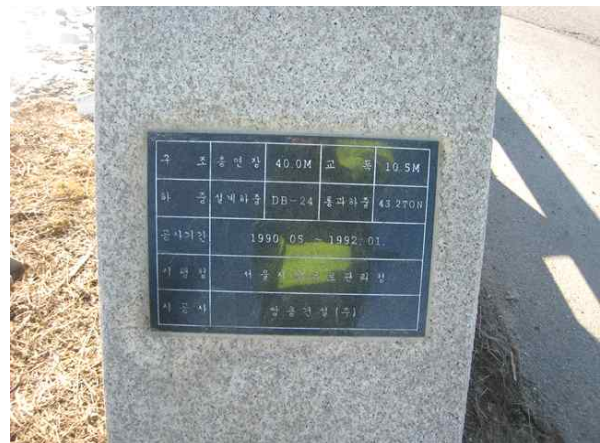

현황판 전경

손상현황 사진

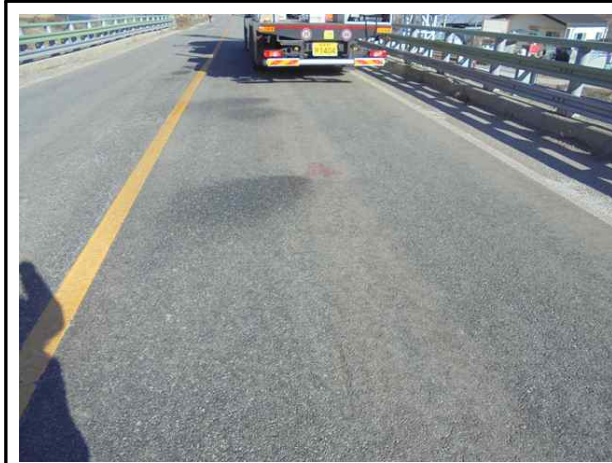


S1 굽힘 (0.1m×0.3m×4EA)



S1 굽힘 (0.1m×0.3m×4EA)



S1 접속부 균열 (3.0m)

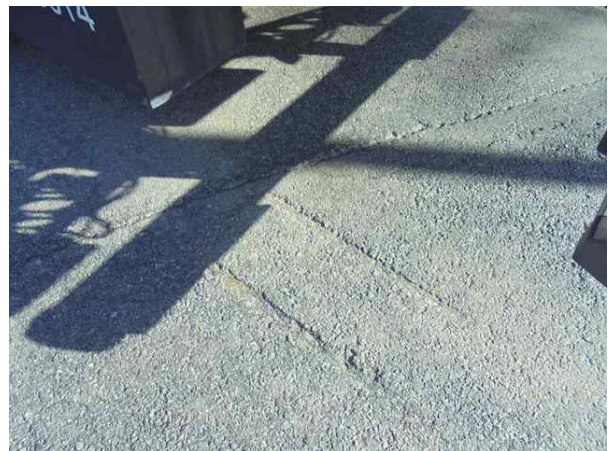

S1 접속부 굽힘 (0.1m×0.5m×2EA)



배수구 전경



배수관 전경

손상현황 사진

	
S1 배수구 상태 양호	S2 배수관 상태 양호
	
배수관 상태 양호	배수관 상태 양호
	
난간 및 연석 전경	난간 및 연석 전경

손상현황 사진



S1 외측 철근노출 (0.1m×2.0m)



S1 연석 이격 (30.0mm)



S1 연석 표면박리 (0.7m×12.5m)



S1 연석 표면박리 (0.7m×12.5m)



S1 접속부 연석 파손 (0.2m×0.2m×2EA)



S1 접속부 연석 파손 (0.8m×0.3m)

손상현황 사진

	
S2 연석 박락 (0.6m×0.1m×2EA)	S2 외측 철근노출 (0.1m×1.0m)
	
S2 외측 철근노출 (0.1m×3.0m)	S2 연석 표면박리 (0.7m×15.0m)
	
S3 난간 변형 (2.0m)	S3 지주파손 (1EA)

손상현황 사진



S3 연석 박락(0.2m×0.2m)



S3 외측 철근노출(0.1m×2.0m)



S3 외측 철근노출(0.1m×3.0m)



S3 외측 파손(0.2m×0.5m)



S3 연석 표면박리(0.7m×12.5m)



S3 연석 표면박리(0.7m×12.5m)