


ID:


문산- 선유 #1

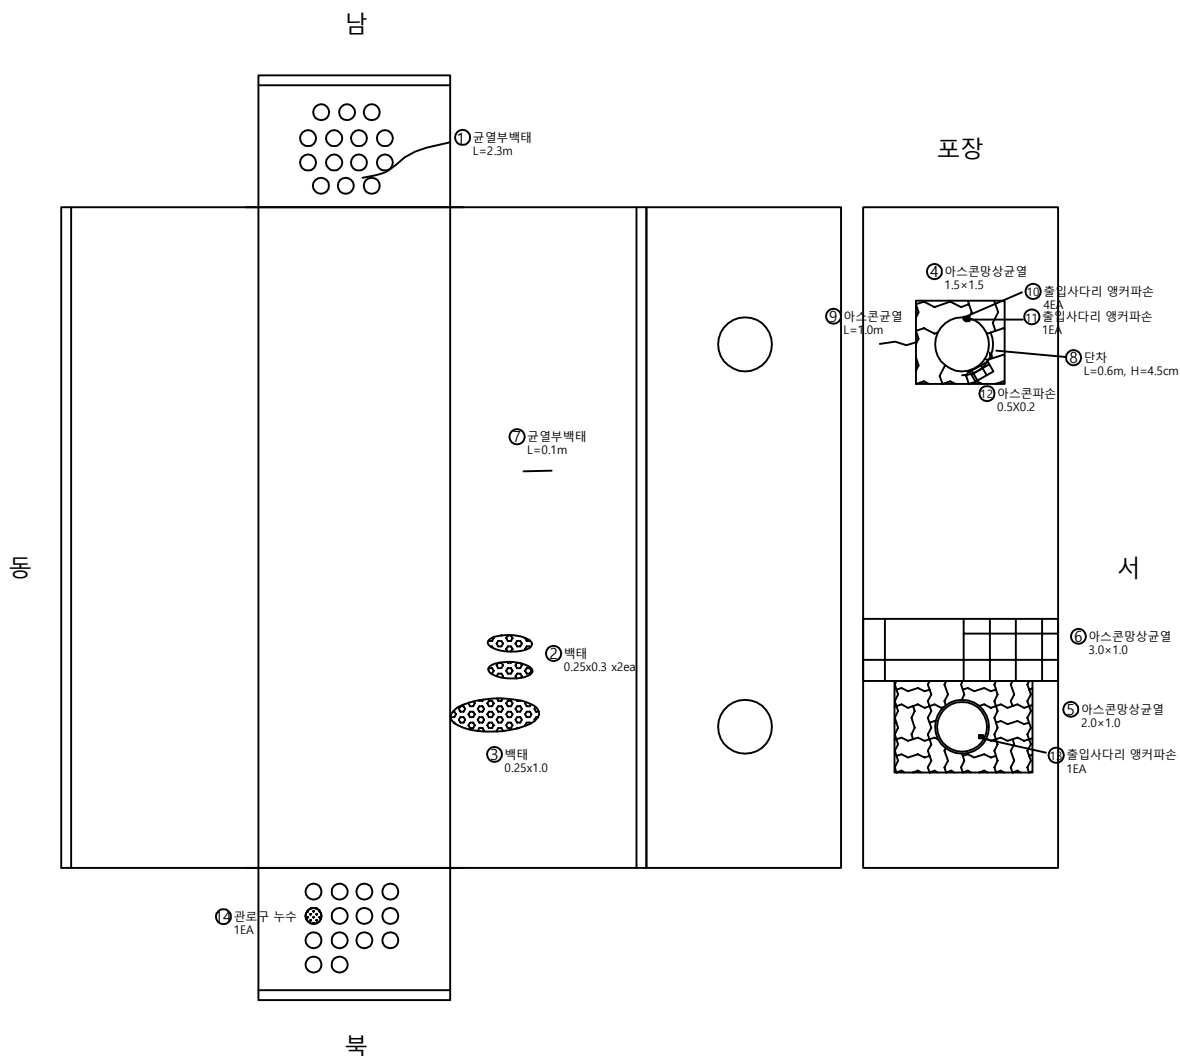

손상물량표


번호	신(0) 구(P)	손상내용	손상규모			개소	수량	단위	비고
			폭 (mm)	너비 (m)	길이 (m)				
1	구	균열부백테			2.30	1	2.30	m	
2	구	백테		0.25	0.30	2	0.15	m'	
3	구	백테		0.25	1.00	1	0.25	m'	
4	구	아스콘망상균열		1.50	1.50	1	2.25	m'	
5	구	아스콘망상균열		2.00	1.00	1	2.00	m'	
6	구	아스콘망상균열		3.00	1.00	1	3.00	m'	
7	구	균열부백테			0.10	1	0.10	m	
8	구	단차		0.60		1	0.60	m	
9	구	아스콘균열			1.00	1	1.00	m	
10	구	출입사다리 앵커파손				4	4.00	EA	
11	신	출입사다리 앵커파손				1	1.00	EA	
12	신	아스콘파손		0.50	0.20		0.10	m'	
13	신	출입사다리 앵커파손				1	1.00	EA	
14	신	관로구 누수				1	1.00	EA	
15									
16									
17									
18									
19									
20									
21									
22									
23									
24									
25									
26									
27									
28									
29									
30									
31									
32									
33									
34									
35									
36									
37									
38									
39									
40									

KEY PLAN

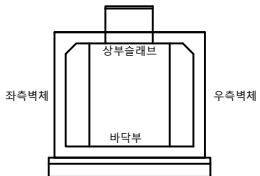

범 례	균열	망상균열	재료분리	용역명
	편청,공동	박리,파손	시공이음분리, 용분리	
	누수,습윤부	백테	퇴적물	발주처 한국전력공사 경기북부본부
	철근노출	침하	배수구	
	강제부식	좌굴,변형	신축이음 본체	용역사 (주)명성엔지니어링
				도면번호 1

문산- 선유 #4

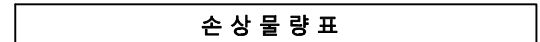

KEY PLAN



	관 입		망상균열		재료부리	용역명 2025년도 경기북부 지중구조물 ·2중시설을 정밀안전점검 용역
	편칭,공동		바닥,파손		시공이음부리, 창문리	
	누수,습윤부		벽,터		퇴적물	발주처 한국전력공사 경기북부본부
	철근노출		침하		배수구	용역사 (주)명성엔지니어링
	강제부식		좌굴,변형		신축이음 본체	도면번호 3

