

15. 태리IC램프A교

전경



교면포장 전경



신축이음장치 전경



바닥판하면 전경



교대 전경



교각 전경



교량받침 전경

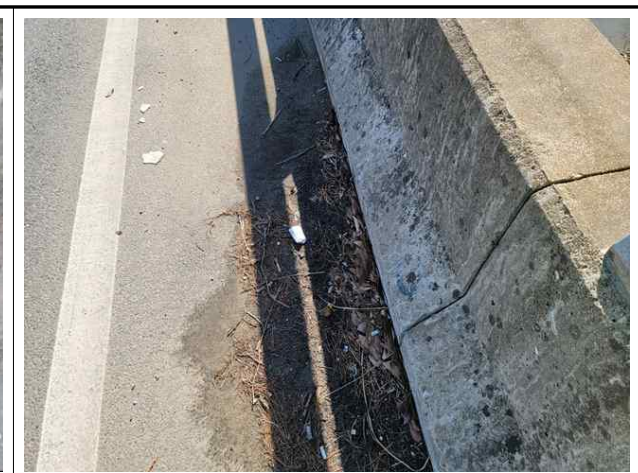




손상현황

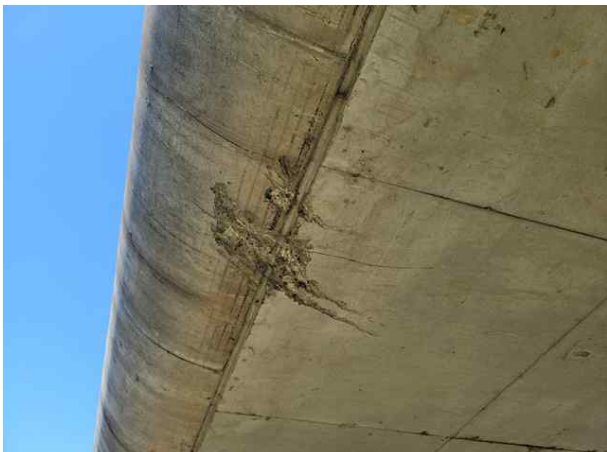
			
01 (25년 하반기)	바닥판(S1) 잡철근 노출 및 박락	01 (26년 상반기)	바닥판(S1) 잡철근 노출 및 박락
			
02 (25년 하반기)	바닥판(S1) 배수관 주변 백태	02 (26년 상반기)	바닥판(S1) 배수관 주변 백태
			
03 (25년 하반기)	바닥판(S1) 파손	03 (26년 상반기)	바닥판(S1) 파손

			
04 (25년 하반기)	바닥판(S2) 파손	04 (26년 상반기)	바닥판(S2) 파손
			
05 (25년 하반기)	교량받침(A2-Sh8) 몰탈 파손/경미	05 (26년 상반기)	교량받침(A2-Sh8) 몰탈 파손/경미
			
06 (25년 하반기)	교대(A1) 벽체→산책로 균열(cw=0.2mm, 0.3mm)	06 (26년 상반기)	교대(A1) 벽체→산책로 균열(cw=0.2mm, 0.3mm)

			
07 (25년 하반기)	교대(A2) 균열부백태	07 (26년 상반기)	교대(A2) 균열부백태
			
08 (25년 하반기)	교대(A2) 균열부백태	08 (26년 상반기)	교대(A2) 균열부백태
			
09 (25년 하반기)	교각(P2) 기둥 파손/경미	09 (26년 상반기)	교각(P2) 기둥 파손/경미

			
10 (25년 하반기)	신축이음(A1) 후타재 균열(0.3mm미만)	10 (26년 상반기)	신축이음(A1) 후타재 균열(0.3mm미만)
			
11 (25년 하반기)	신축이음장치(A2) 유간 이물질퇴적	11 (26년 상반기)	신축이음장치(A2) 유간 이물질퇴적
			
12 (25년 하반기)	신축이음(A2) 차수판 변형	12 (26년 상반기)	신축이음(A2) 차수판 변형

	
13 (25년 하반기)	13 (26년 상반기)
배수구(S1~S3) 막힘	배수구(S1~S3) 막힘
	
14 (25년 하반기)	14 (26년 상반기)
배수관(A2) 부식 및 막힘	배수관(A2) 부식 및 막힘
	
15 (25년 하반기)	15 (26년 상반기)
방호벽(S2) 균열(0.3mm미만)	방호벽(S2) 균열(0.3mm미만)

			
16 (25년 하반기)	교량받침 상태양호	16 (26년 상반기)	교량받침 상태양호
			
17 (25년 하반기)	바닥판 미세균열(S3)	17 (26년 상반기)	바닥판 미세균열(S3)
			
18 (26년 상반기)	바닥판하면(S3) 파손	19 (26년 상반기)	바닥판하면(S3) 파손