


18. 태리IC육교(하)

전경



교면포장 전경

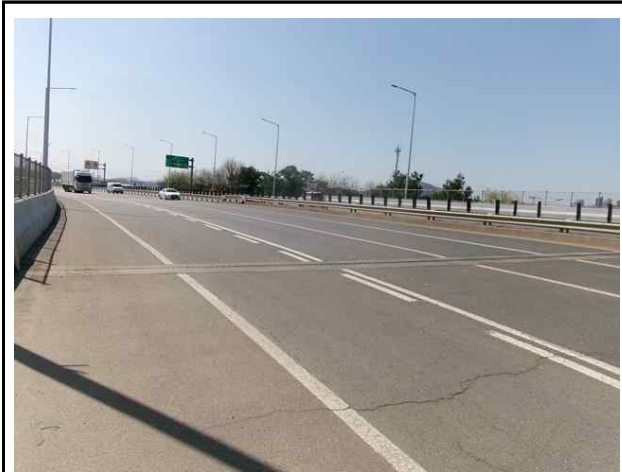

신축이음장치 전경



바닥판하면 전경



거더외부 전경



교대 전경




교량받침 전경

손상현황

01
(25년 하반기)

거더(G1) 내부 부식

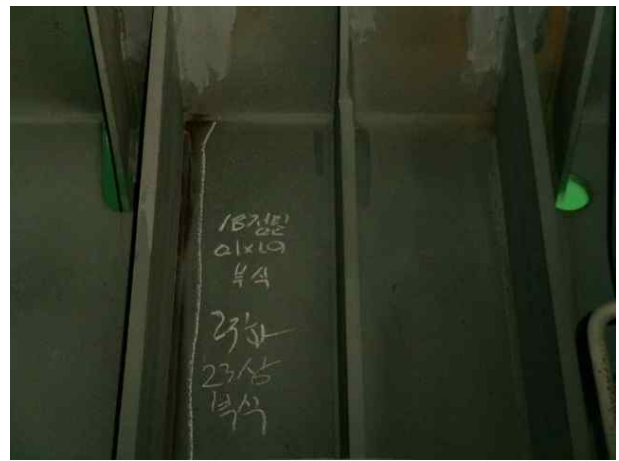01
(26년 상반기)

거더(G1) 내부 부식

02
(25년 하반기)

바닥판(S1) 단부 파손 및 철근노출

02
(26년 상반기)

바닥판(S1) 단부 파손 및 철근노출

03
(25년 하반기)

바닥판(S1) 하면 파손

03
(26년 상반기)

바닥판(S1) 하면 파손

			
04 (25년 하반기)	받침 (A1-Sh2) 부식/경미	04 (26년 상반기)	받침 (A1-Sh2) 부식/경미
			
05 (25년 하반기)	받침 콘크리트 (A1-Sh2) 균열 (0.3mm미만)	05 (26년 상반기)	받침 콘크리트 (A1-Sh2) 균열 (0.3mm미만)
			
06 (25년 하반기)	받침 (A2-Sh1) 몰탈 파손	06 (26년 상반기)	받침 (A2-Sh1) 몰탈 파손

	
07 (25년 하반기)	07 (26년 상반기)
	
08 (25년 하반기)	08 (26년 상반기)
	
09 (25년 하반기)	09 (26년 상반기)

			
10 (25년 하반기)	교대(A1) 균열(0.3mm미만)	10 (26년 상반기)	교대(A1) 균열(0.3mm미만)
			
11 (25년 하반기)	교대(A1) 흠벽 균열(0.3mm이상)	11 (26년 상반기)	교대(A1) 흠벽 균열(0.3mm이상)
			
12 (25년 하반기)	교대(A1) 망상균열	12 (26년 상반기)	교대(A1) 망상균열

			
13 (25년 하반기)	교대(A1) 홍벽 파손	13 (26년 상반기)	교대(A1) 홍벽 파손
			
14 (25년 하반기)	교대(A1) 범면 상부 몰탈 파손	14 (26년 상반기)	교대(A1) 범면 상부 몰탈 파손
			
15 (25년 하반기)	교대(A2) 홍벽 누수흔적 및 망상균열	15 (26년 상반기)	교대(A2) 홍벽 누수흔적 및 망상균열

	
16 (25년 하반기)	16 (26년 상반기)
	
17 (25년 하반기)	17 (26년 상반기)
	
18 (25년 하반기)	18 (26년 상반기)
교대(A2) 재료분리	교대(A2) 재료분리
교대(A2) 토사유실(t=1.0m)	교대(A2) 토사유실(t=1.0m)
교대(A2) 법면 상부 몰탈 파손	교대(A2) 법면 상부 몰탈 파손

			
19 (25년 하반기)	교대(A2) 법면 이격	19 (26년 상반기)	교대(A2) 법면 이격
			
20 (25년 하반기)	교면포장(A1) 접속부 균열	20 (26년 상반기)	교면포장(A1) 접속부 균열
			
21 (25년 하반기)	신축이음(A1) 유간 토사퇴적	21 (26년 상반기)	신축이음(A1) 유간 토사퇴적

			
22 (25년 하반기)	신축이음(A2) 후타재 파손	22 (26년 상반기)	신축이음(A2) 후타재 파손
			
23 (25년 하반기)	차수관(A2) 볼트 탈락	23 (26년 상반기)	차수관(A2) 볼트 탈락
			
24 (25년 하반기)	배수구 퇴적물(막힘)	24 (26년 상반기)	배수구 퇴적물(막힘)

			
25 (25년 하반기)	방호벽 균열(0.3mm미만)	25 (26년 상반기)	방호벽 균열(0.3mm미만)
			
26 (25년 하반기)	텔리네이터 파손	26 (26년 상반기)	텔리네이터 파손
			
27 (25년 하반기)	교대 측방이동 자동측정 변위계 부착	27 (26년 상반기)	교대 측방이동 자동측정 변위계 부착