


ID : 복정고가교 본선-상행선 box외부(S1)



손상물량표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	백태	0.20	0.30	0.06	m²	1	
2	백태	1.00	0.10	0.10	m²	1	
3	균열(0.2mm)	0.20	2.50	12.50	m	5	
4	표면오염(누수흔적)	0.50	3.00	1.50	m²	1	
5	균열(0.2mm)	0.20	1.20	1.20	m	1	
6	균열(0.2mm)	0.20	3.00	3.00	m	1	
7	균열(0.2mm)	0.20	2.00	6.00	m	3	
8	신축하부누수		14.00	14.00	m	1	
9	박락	0.10	0.30	0.03	m²	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

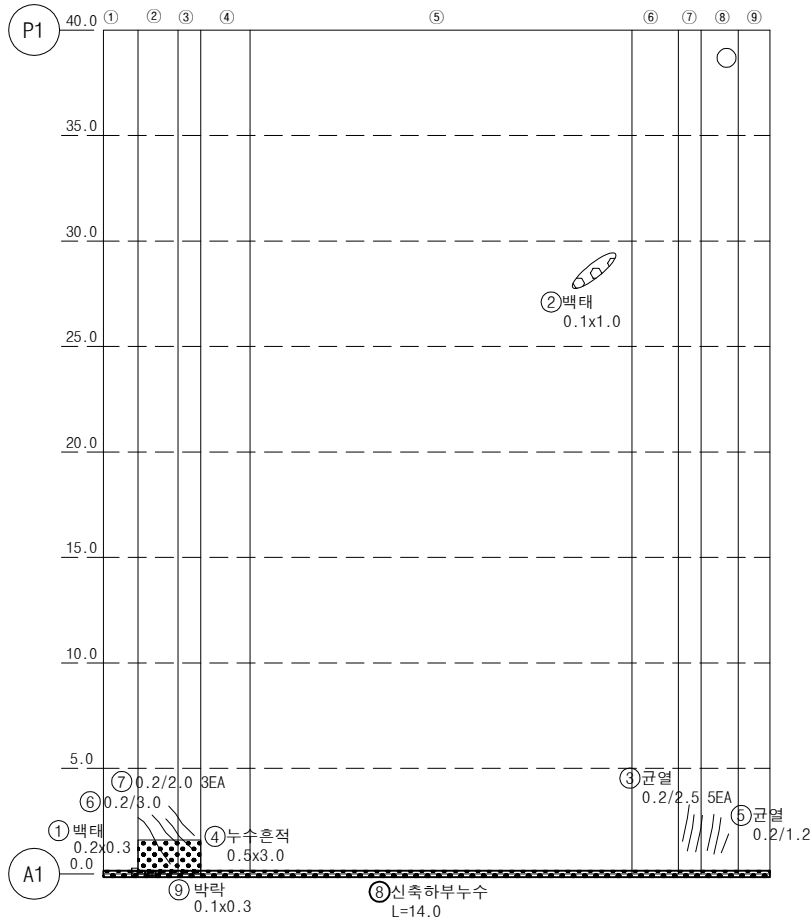

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송판리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	131	


ID : 복정고가교 본선-상행선 box외부(S2)

손 상 물 량 표

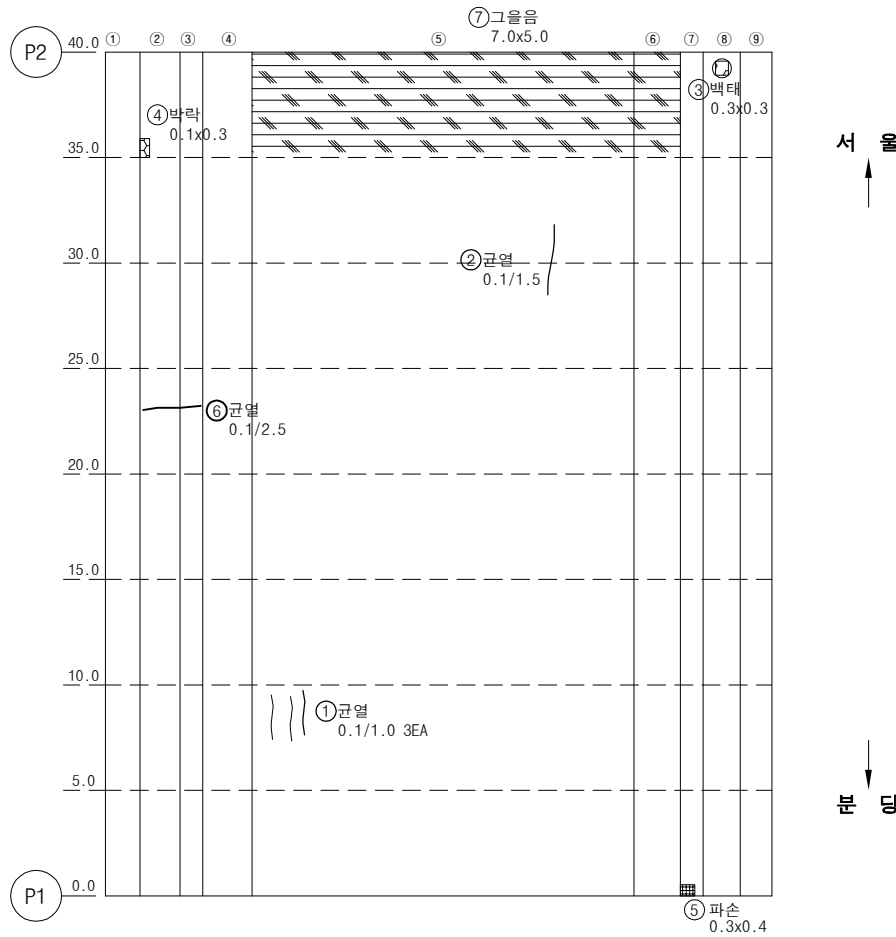


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.10	1.00	3.00	m	3	
2	균열(0.1mm)	0.10	1.50	1.50	m	1	
3	백태	0.30	0.30	0.09	m²	1	
4	박락	0.30	0.10	0.03	m²	1	
5	파손	0.30	0.40	0.12	m²	1	
6	균열(0.1mm)	0.10	2.50	2.50	m	1	
7	그늘음	5.00	7.00	35.00	m²	1	
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	132	


ID : 복정고가교 본선-상행선 box외부(S3)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.20	1.80	9.00	m	5	
2	균열(0.2mm)	0.20	1.50	1.50	m	1	
3	박리	0.10	7.50	0.75	m ²	1	
4	균열(0.1mm)	0.10	1.00	1.00	m	1	
5	재료분리	2.20	1.00	2.20	m ²	1	
6	배수관누수			1.00	EA	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

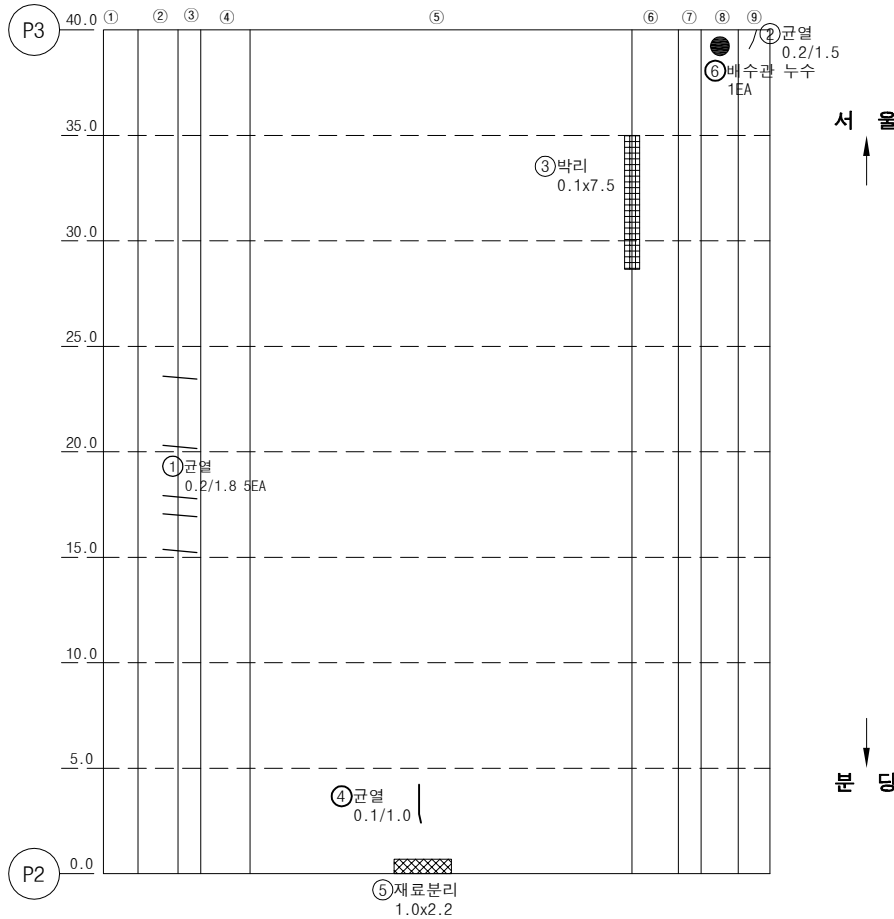

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 박리	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	133	


ID : 복정고가교 본선-상행선 box외부(S4)

손상물량표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	상대양호						
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

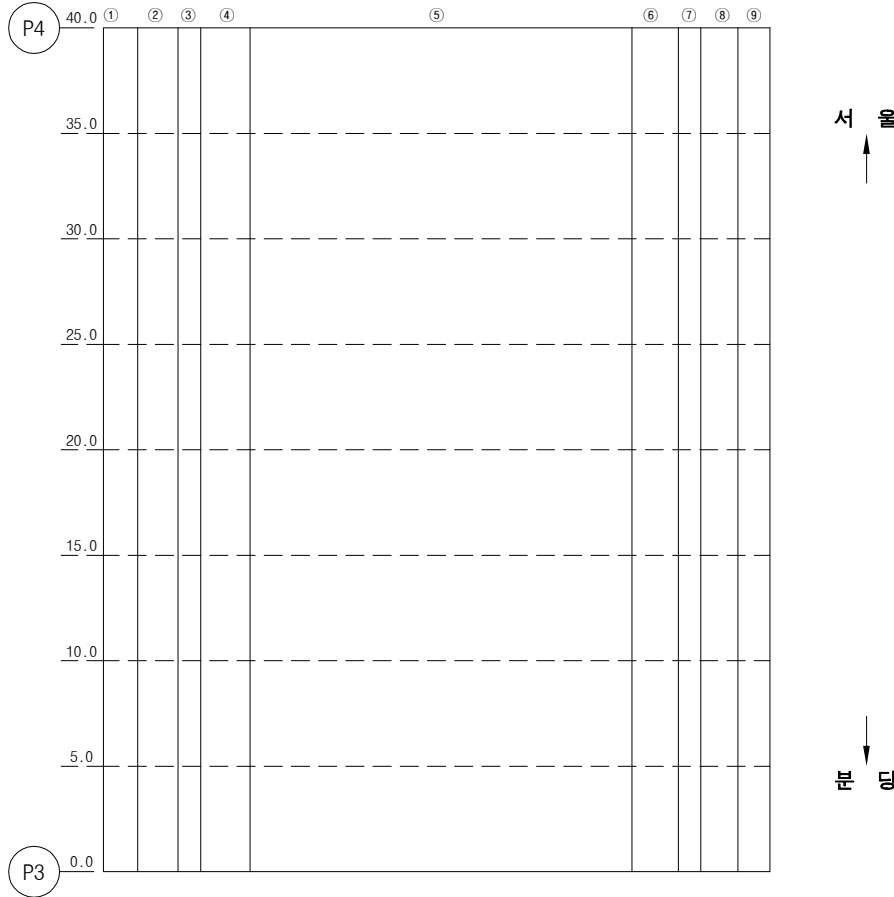

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김찬구	
	누수, 변색	배수구	포장파괴	기타	도면번호	134	


ID : 복정고가교 본선-상행선 box외부(S5)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	상대양호						
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

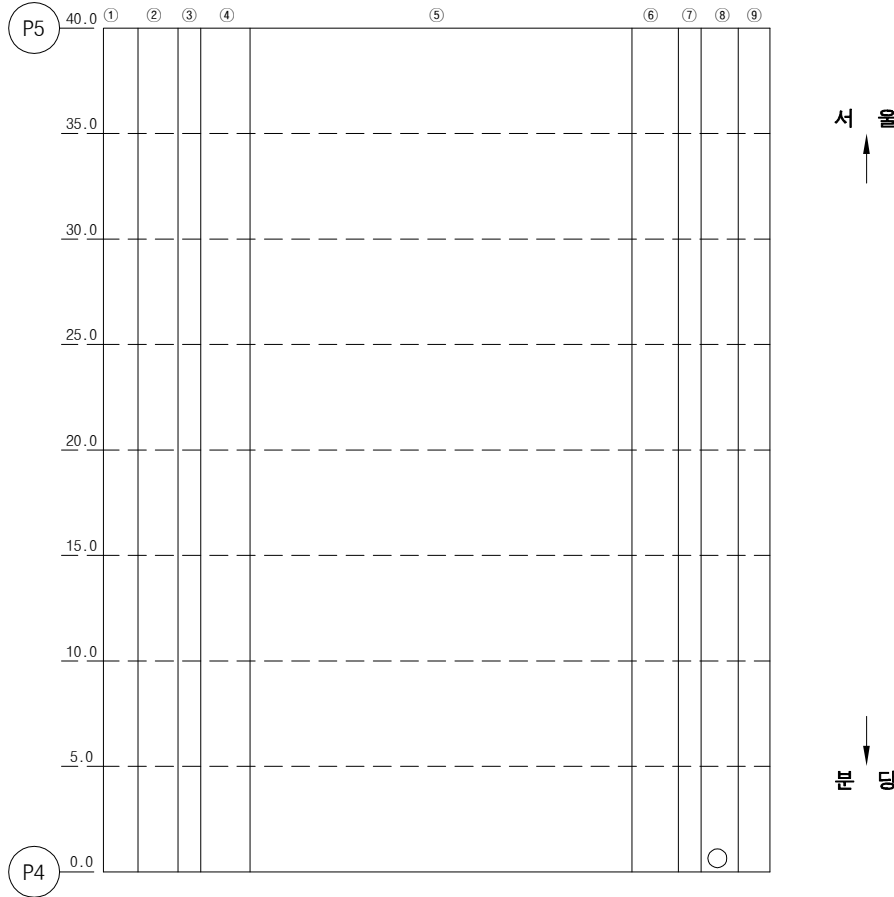

KEY PLAN




SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	균열	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이음열외력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장의 요철	기타	도면번호	135	

ID : 복정고가교 본선-상행선 box외부(S6)



손 상 물 량 표

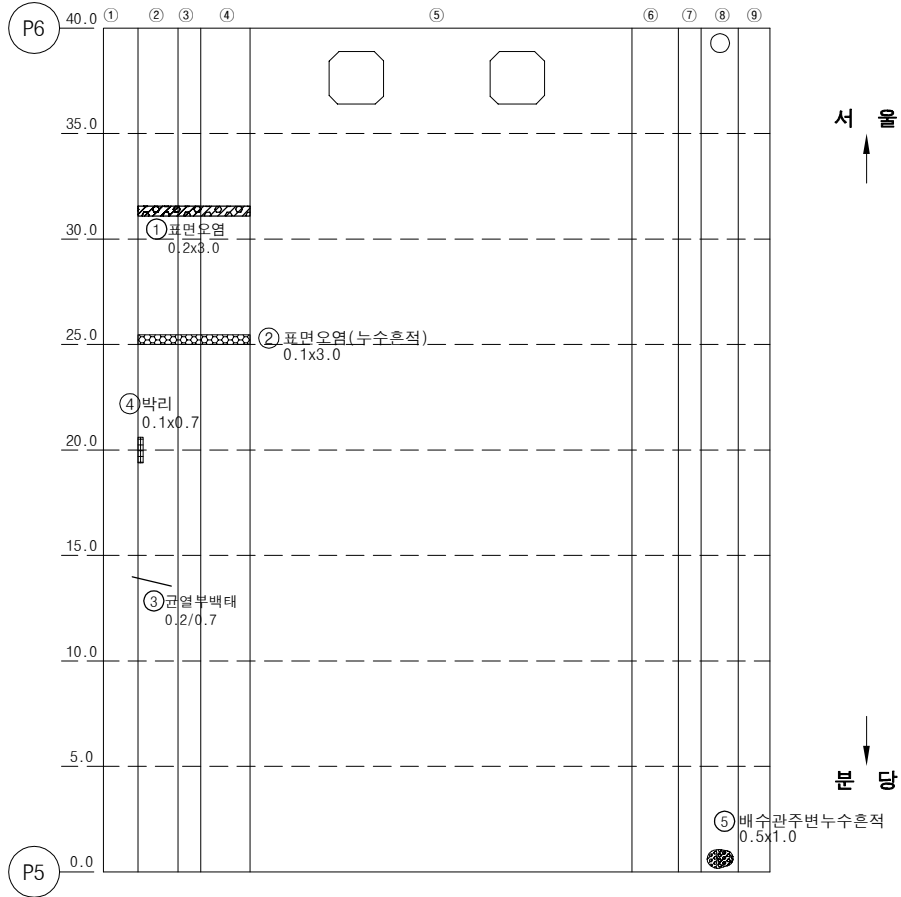

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	누수흔적	0.20	3.00	0.60	m ²	1	
2	표면오염(누수흔적)	0.10	3.00	0.30	m ²	1	
3	균열부백태	0.20	0.70	0.70	m	1	
4	박리	0.70	0.10	0.07	m ²	1	
5	배수관주변누수흔적	0.50	1.00	0.50	m ²	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송판리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	136	

ID : 복정고가교 본선-상행선 box외부(S7)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관주변누수흔적	2.00	0.50	1.00	m ²	1	
2	누수흔적	1.00	7.00	7.00	m ²	1	
3	누수흔적	5.00	7.00	35.00	m ²	1	
4	표면오염(누수흔적)	0.10	2.00	0.20	m ²	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

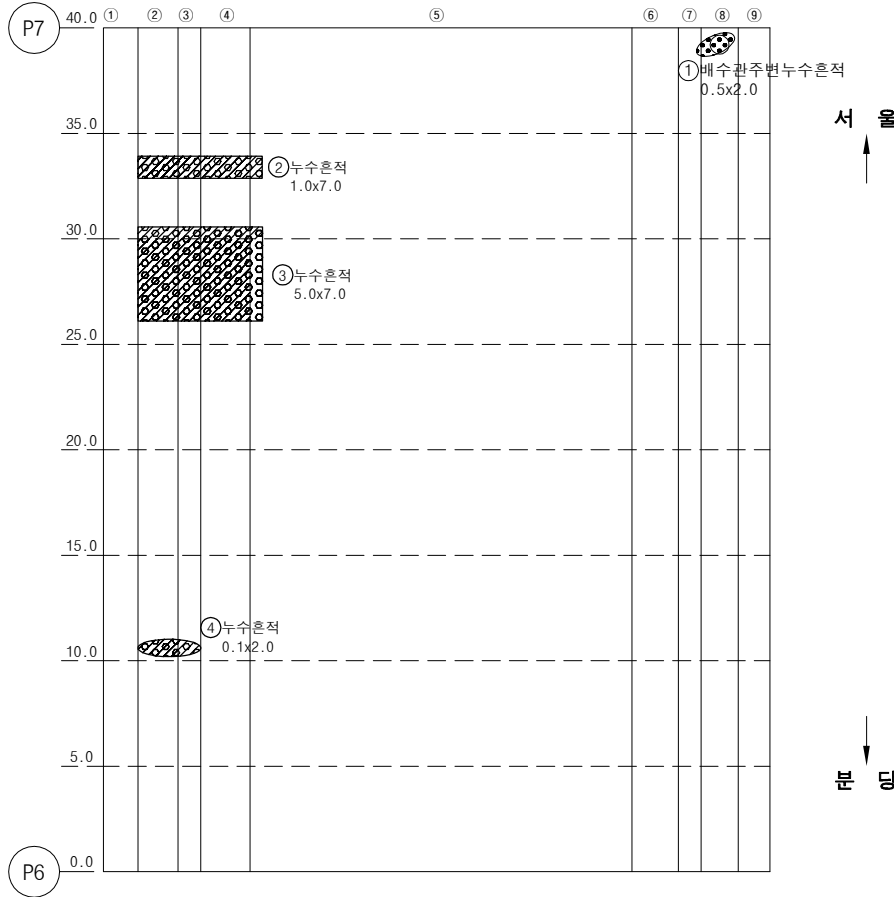

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송판리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장의 요철	기타	도면번호	137	


ID : 복정고가교 본선-상행선 box외부(S8)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	표면오염(누수흔적)	2.00	3.00	6.00	m²	1	
2	재료분리	0.50	0.50	0.25	m²	1	
3	배수관주변누수흔적	0.50	0.50	0.25	m²	1	
4	균열부백태	0.20	0.70	2.80	m	4	
5	들뜸	0.50	0.10	0.05	m²	1	
6	균열부백태	0.20	0.60	3.00	m	5	
7	균열(0.2mm)	0.20	1.50	1.50	m	1	
8	균열부백태	0.20	0.40	1.20	m	3	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

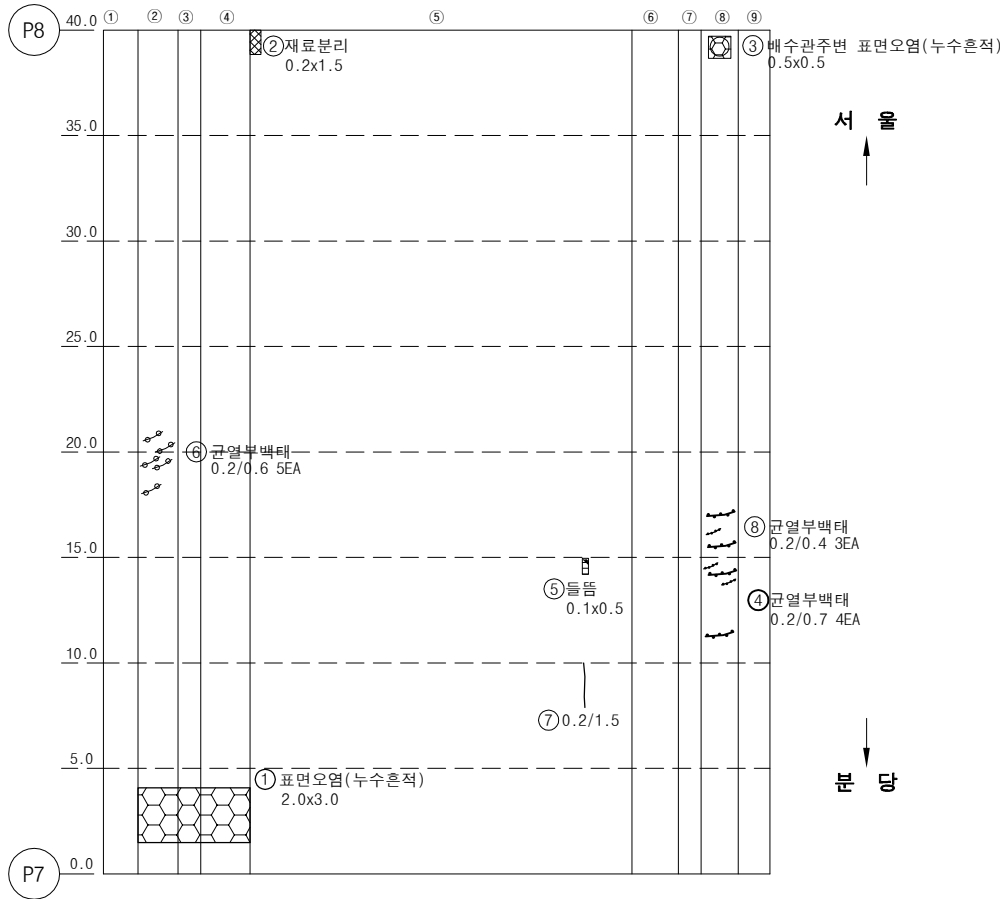

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이음열외력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	138	

ID : 복정고가교 본선-상행선 box외부(S9)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.50	1.00	0.50	m ²	1	
2	재료분리	0.10	1.50	0.15	m ²	1	
3	균열(0.1mm)	0.10	1.70	1.70	m	1	
4	표면오염(누수흔적)	0.30	2.00	1.20	m ²	2	
5	누수, 백태	2.00	1.00	2.00	m ²	1	
6	망상균열, 백태	1.00	1.00	1.00	m ²	1	
7	백태	0.30	1.50	0.45	m ²	1	
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

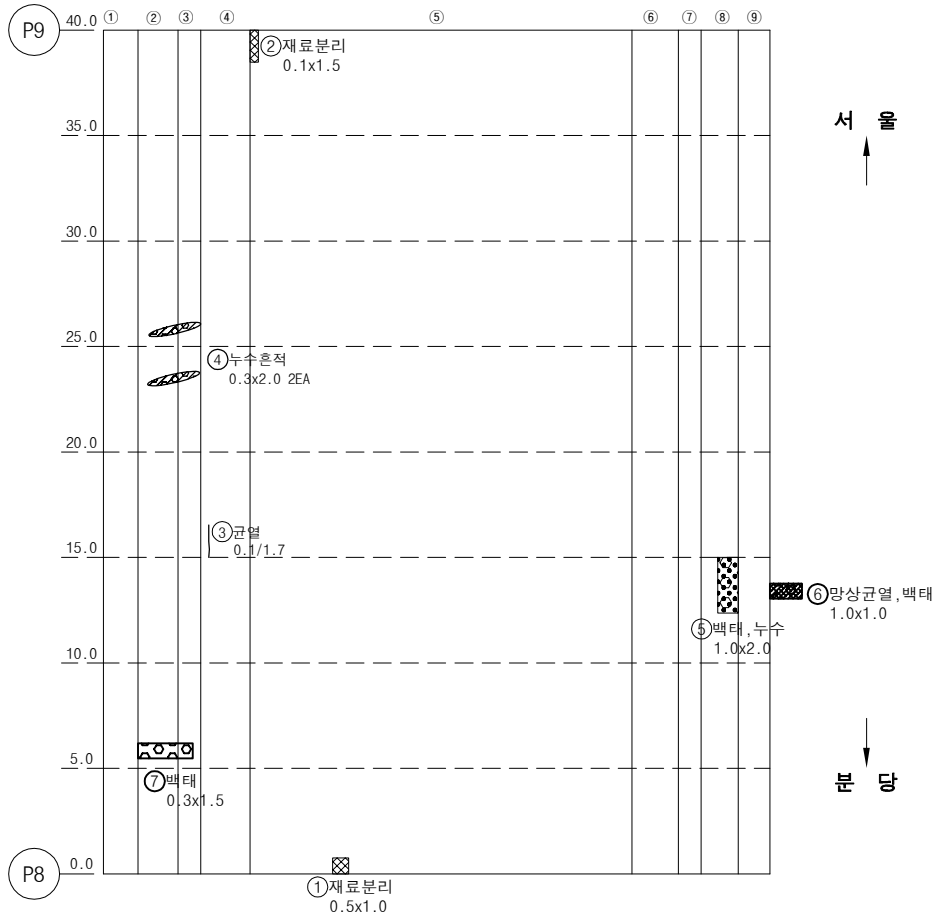

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 망상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물열외력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	139	


ID : 복정고가교 본선-상행선 box외부(S10)

손 상 물 량 표

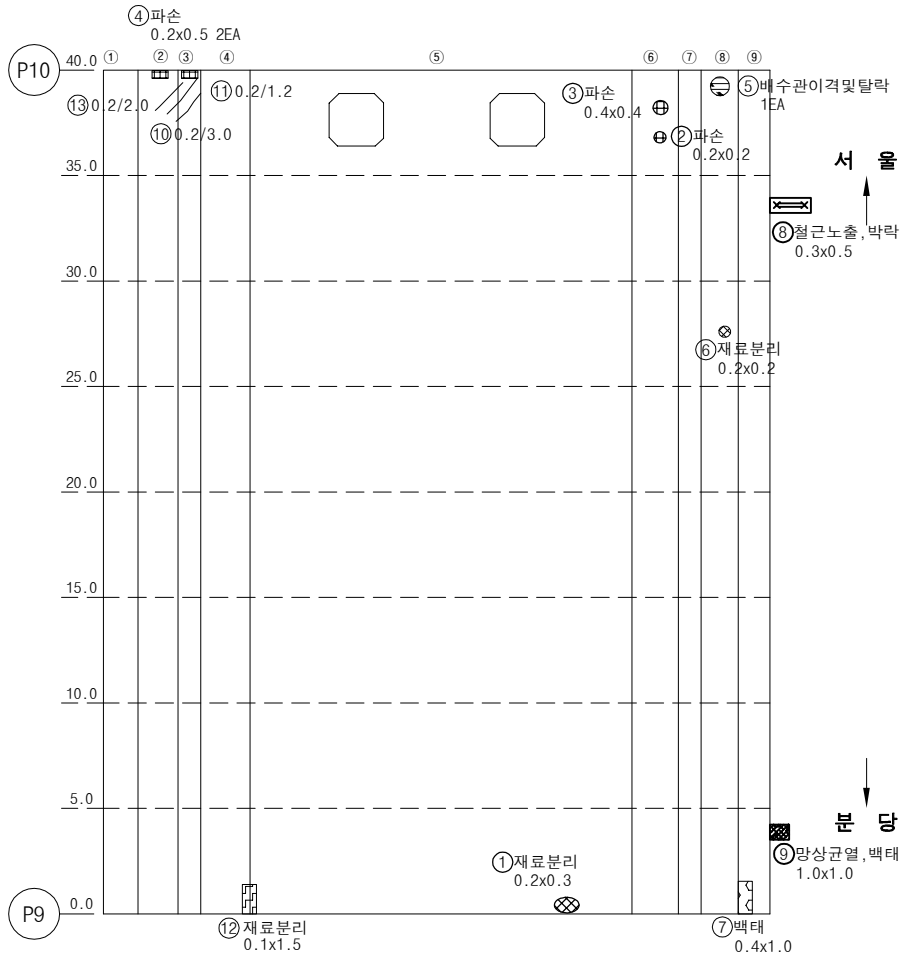


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.20	0.30	0.06	m²	1	
2	파손	0.20	0.20	0.04	m²	1	
3	파손	0.40	0.40	0.16	m²	1	
4	파손	0.50	0.20	0.20	m²	2	
5	배수관이격및탈락			1.00	EA	1	
6	재료분리	0.20	0.20	0.04	m²	1	
7	백태	1.00	0.40	0.40	m²	1	
8	철근노출, 박락	0.30	0.50	0.15	m²	1	
9	망상균열, 백태	1.00	1.00	1.00	m²	1	
10	균열(0.2mm)	0.20	3.00	3.00	m	1	
11	균열(0.2mm)	0.20	1.20	1.20	m	1	
12	재료분리	0.10	1.50	0.15	m²	1	
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 망상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	140	

ID : 복정고가교 본선-상행선 box외부(S11)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	박리	0.60	0.70	0.42	m ²	1	
2	층분리	0.40	0.50	0.20	m ²	1	
3	시공이음부균열	0.30	2.50	2.50	m	1	
4	파손	0.50	0.20	0.20	m ²	2	
5	표면오염(누수흔적)	3.00	1.00	3.00	m ²	1	
6	철근노출	0.30	0.50	0.15	m ²	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

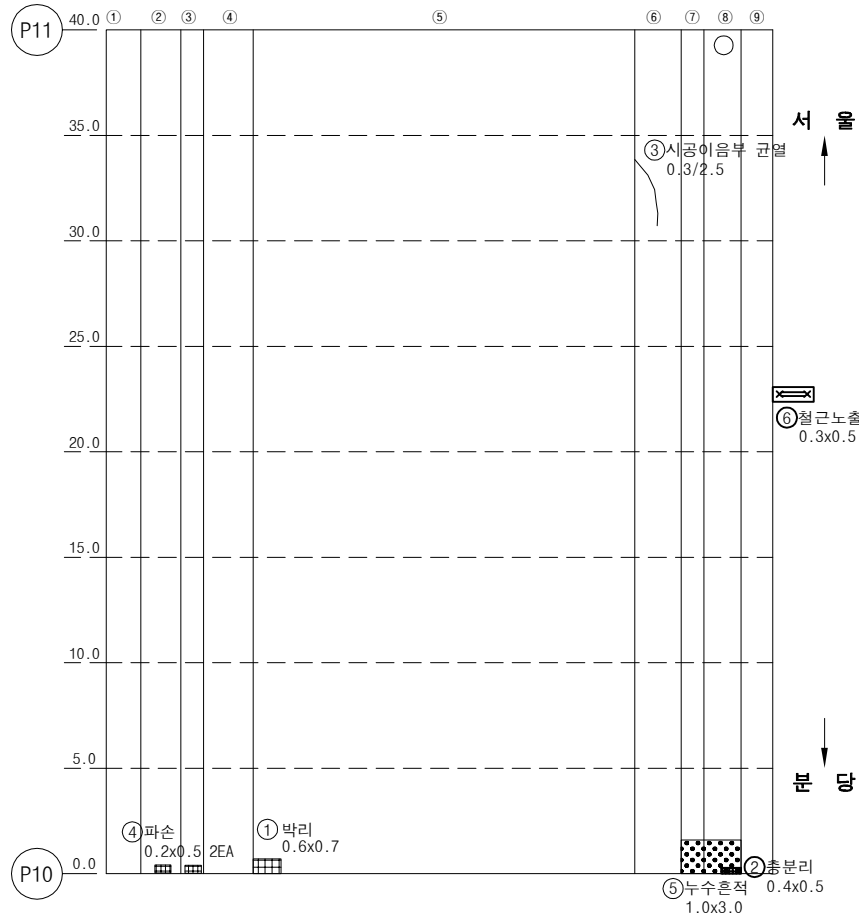

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음부, 층분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	141	

ID : 복정고가교 본선-상행선 box외부(S12)



손 상 물 량 표

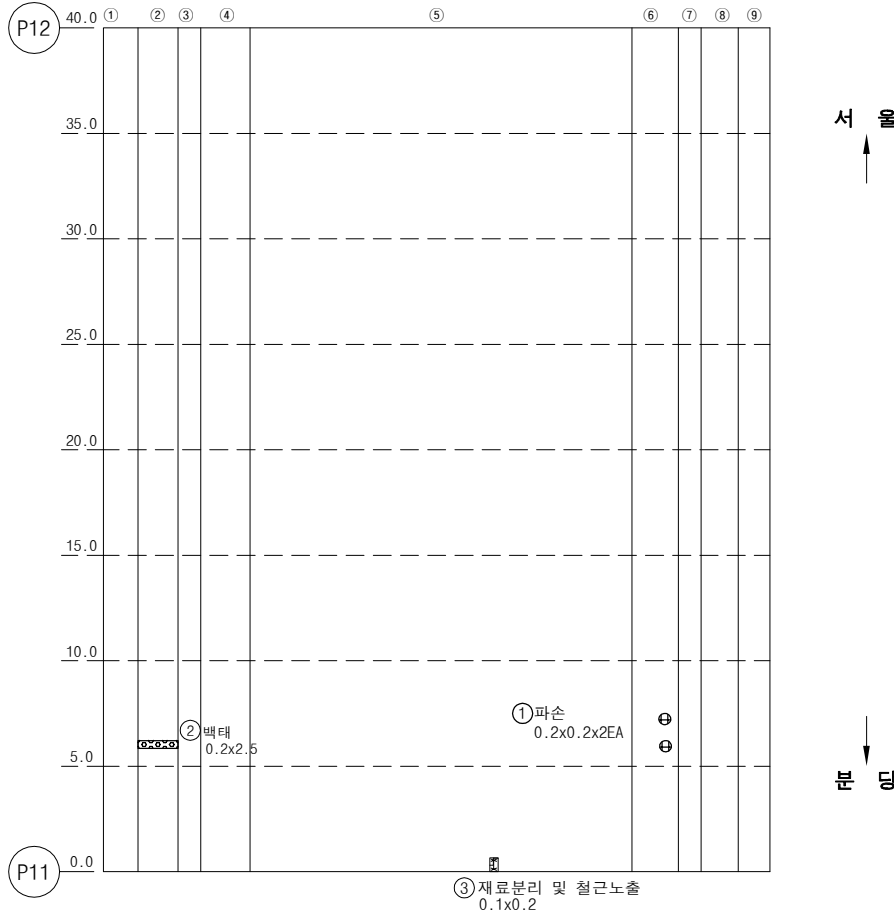

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.20	0.20	0.08	m ²	2	
2	백태	0.20	2.50	0.50	m ²	1	
3	재료분리및철근노출	0.10	0.20	0.02	m ²	1	
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	142	

ID : 복정고가교 본선-상행선 box외부(S13)



손상물량표

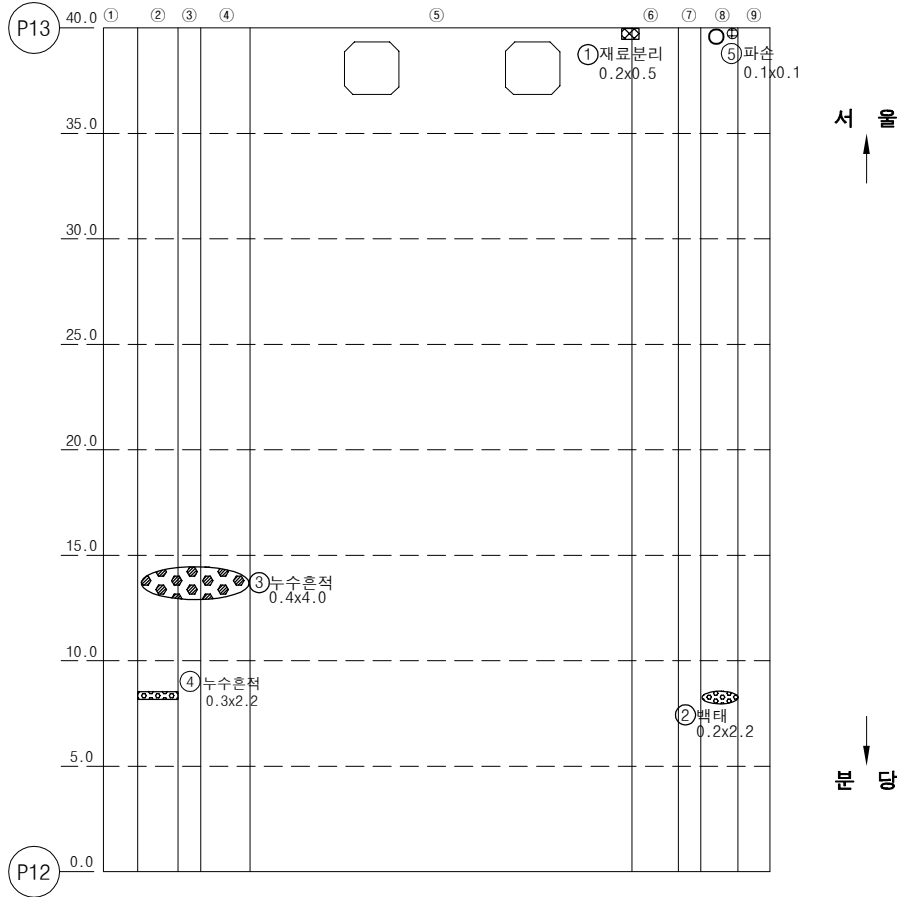

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.20	0.50	0.10	m ²	1	
2	백태	0.20	2.20	0.44	m ²	1	
3	표면오염(누수흔적)	0.40	4.00	1.60	m ²	1	
4	표면오염(누수흔적)	0.30	2.20	0.66	m ²	1	
5	파손	0.10	0.10	0.01	m ²	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	143	


ID : 복정고가교 본선-상행선 box외부(S14)

손 상 물 량 표

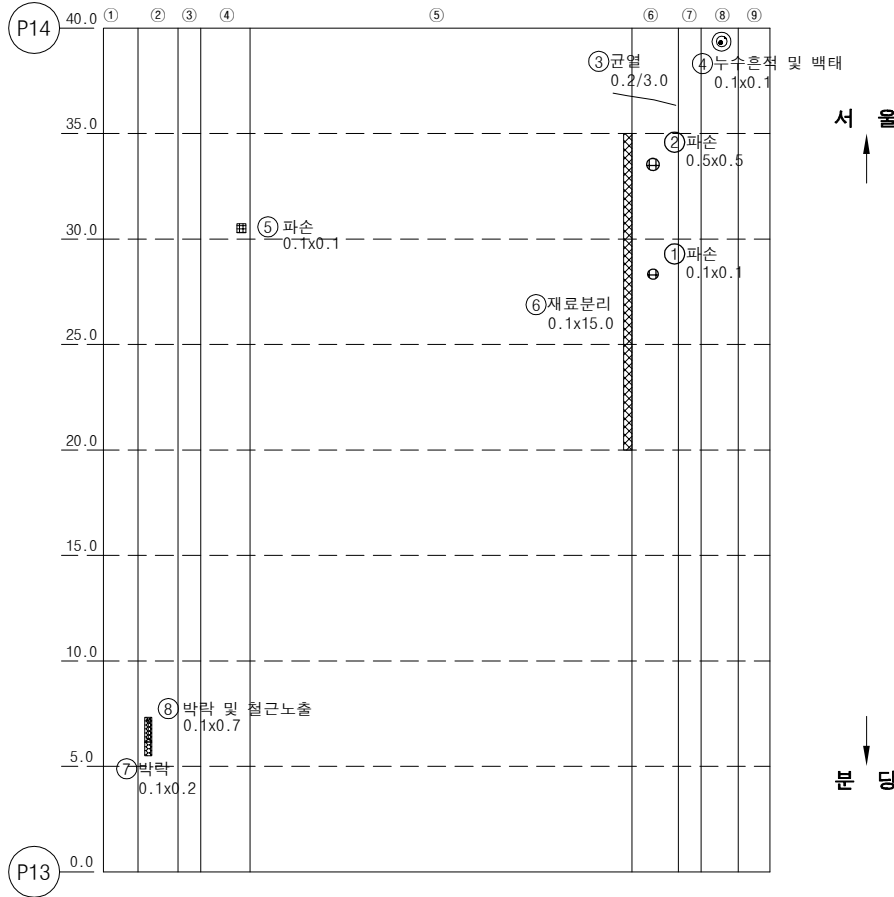


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.10	0.10	0.01	m ²	1	
2	파손	0.50	0.50	0.25	m ²	1	
3	균열(0.2mm)	0.20	3.00	3.00	m	1	
4	배수관주변누수흔적및백태	0.10	0.10	0.01	m ²	1	
5	파손	0.10	0.10	0.01	m ²	1	
6	재료분리	15.00	0.10	1.50	m ²	1	
7	박락	0.20	0.10	0.02	m ²	1	
8	박락및철근노출	0.10	0.70	0.07	m ²	1	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역							
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월			
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인			
	⑨ 박락, 파손	⑩ 시공이음분리, 송분리	⑪ 어물결외력	⑫ 신축이음 본체	확인자	김 찬 구			
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	144			

ID : 복정고가교 본선-상행선 box외부(S15)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	1.20	0.10	0.12	m ²	1	
2	망상균열	0.50	1.00	0.50	m ²	1	
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

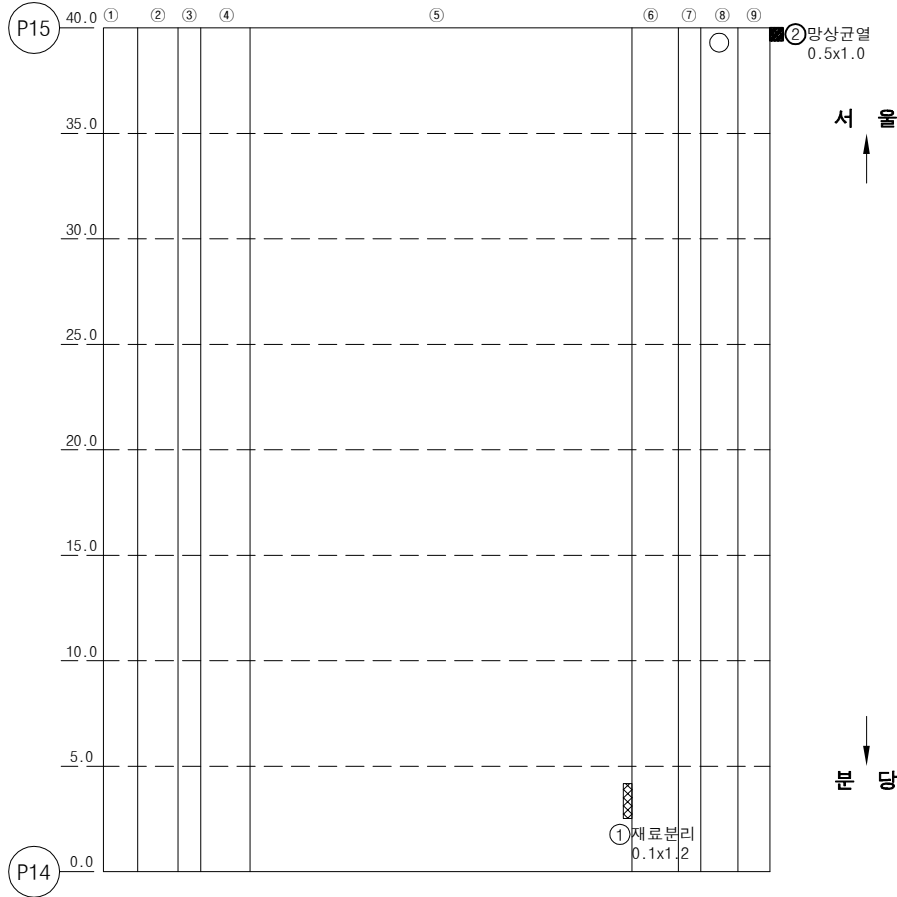

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	망상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	145	

ID : 복정고가교 본선-상행선 box외부(S16)



손 상 물 량 표

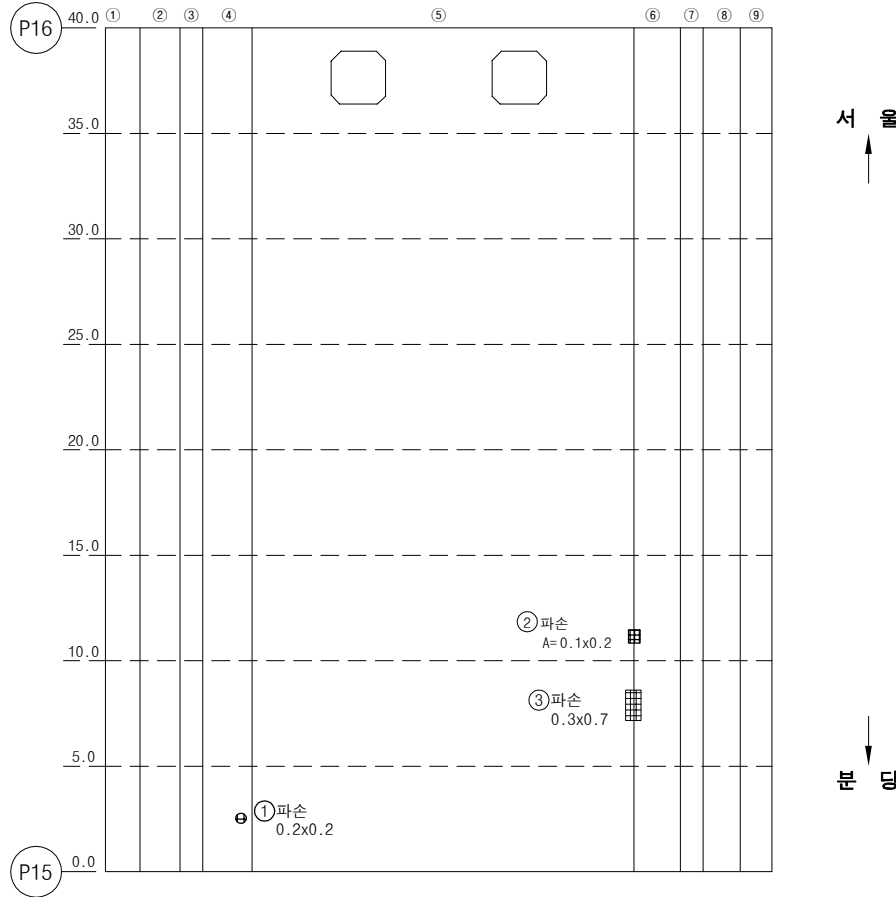

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.20	0.20	0.04	m ²	1	
2	파손	0.10	0.20	0.02	m ²	1	
3	파손	0.70	0.30	0.21	m ²	1	
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	146	

ID : 복정고가교 본선-상행선 box외부(S17)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.20	0.20	0.04	m ²	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

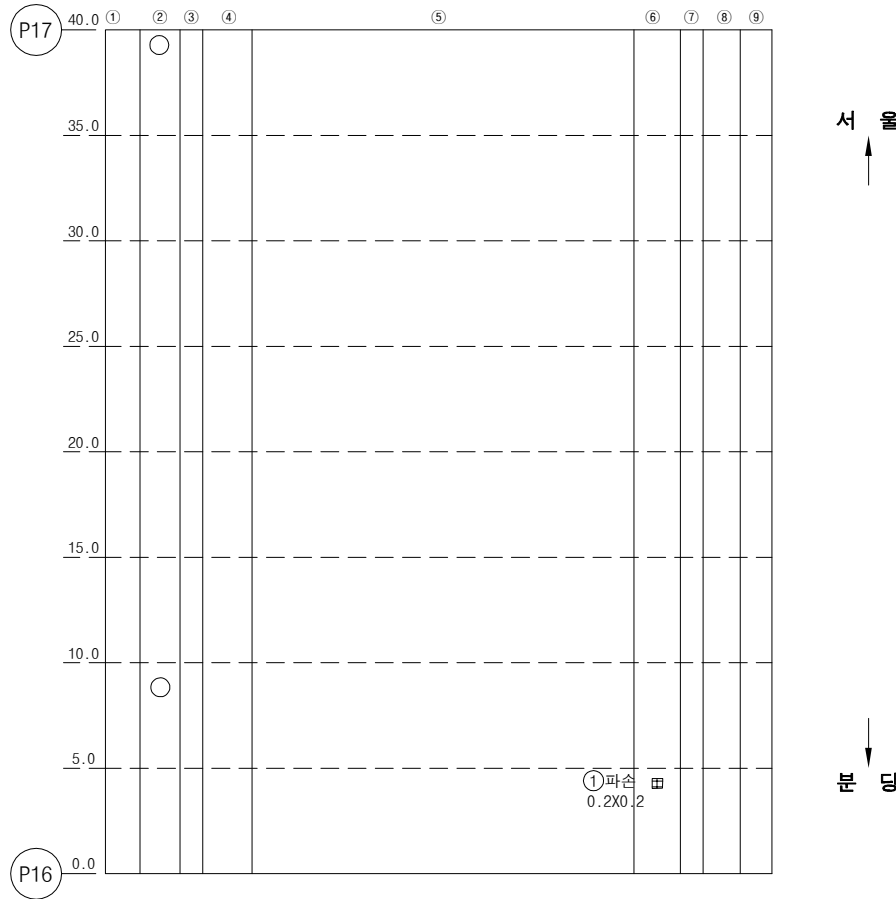

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	147	


ID : 복정고가교 본선-상행선 box외부(S18)

손 상 물 량 표

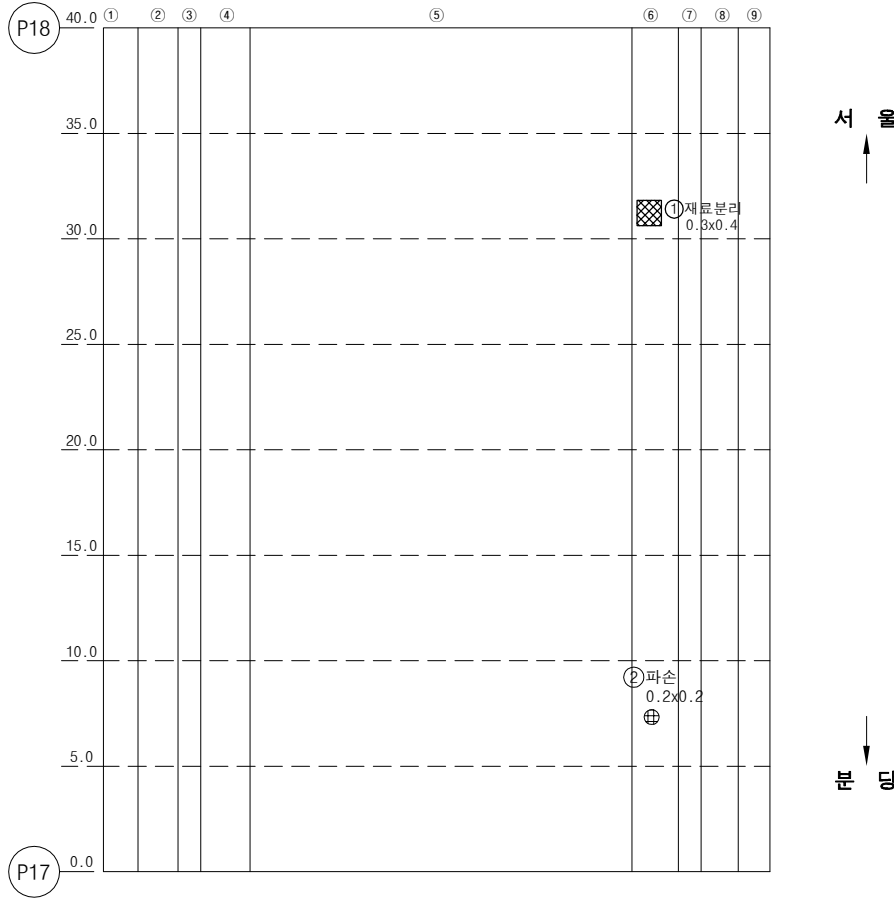


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.30	0.40	0.12	m ²	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN




SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	148	


ID : 복정고가교 본선-상행선 box외부(S19)

손 상 물 량 표

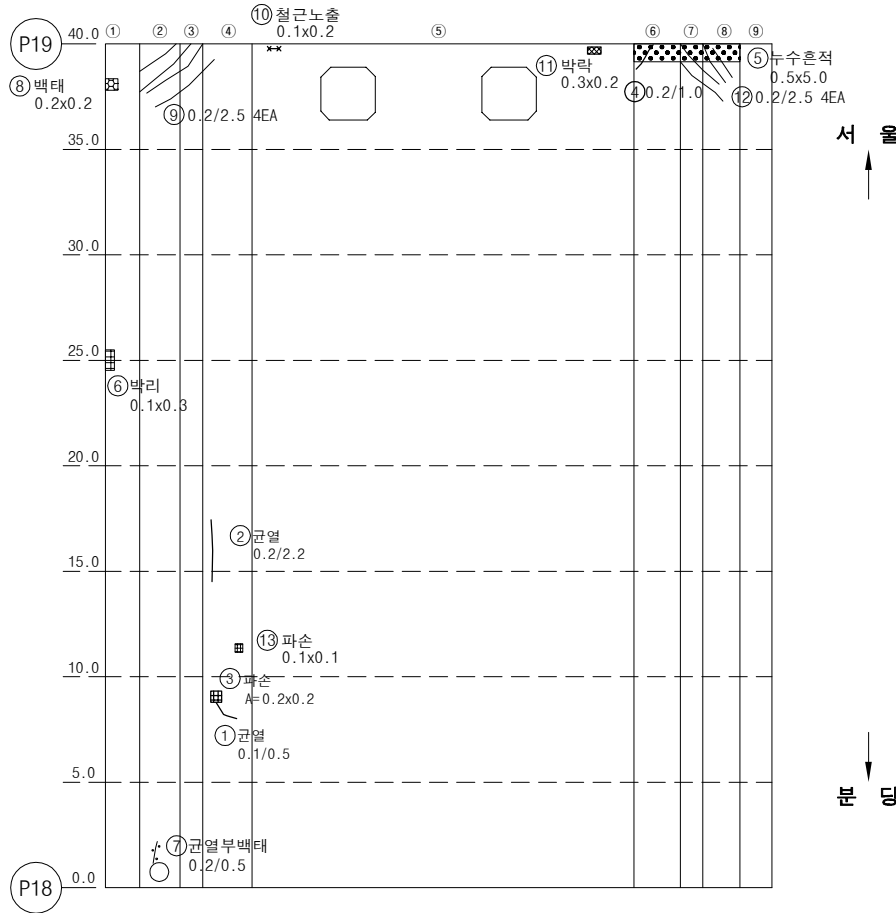


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.5	0.50	m	1	
2	균열(0.2mm)	0.2	2.2	2.20	m	1	
3	파손	0.2	0.2	0.04	m ²	1	
4	균열(0.2mm)	0.2	1	1.00	m	1	
5	표면오염(누수흔적)	0.5	5	2.50	m ²	1	
6	박리	0.3	0.1	0.03	m ²	1	
7	균열부백태	0.2	0.5	0.50	m	1	
8	백태	0.2	0.2	0.04	m ²	1	
9	균열(0.2mm)	0.2	2.5	10.00	m	4	
10	철근노출	0.1	0.2	0.02	m ²	1	
11	박락	0.3	0.2	0.06	m ²	1	
12	균열(0.2mm)	0.2	2.5	10.00	m	4	
13	파손	0.1	0.1	0.01	m ²	1	
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및	기타	도면번호	149	

ID : 복정고가교 본선-상행선 box외부(S20)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	박리	0.1	0.3	0.03	m ²	1	
2	누수, 백태	0.5	3	1.50	m ²	1	
3	균열(0.2mm)	0.2	2	2.00	m	1	
4	균열(0.2mm)	0.2	1	1.00	m	1	
5	균열(0.2mm)	0.2	0.7	0.70	m	1	
6	균열(0.2mm)	0.2	1.7	3.40	m	2	
7	백태	0.1	0.1	0.01	m ²	1	
8	누수, 백태	0.5	1	0.50	m ²	1	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

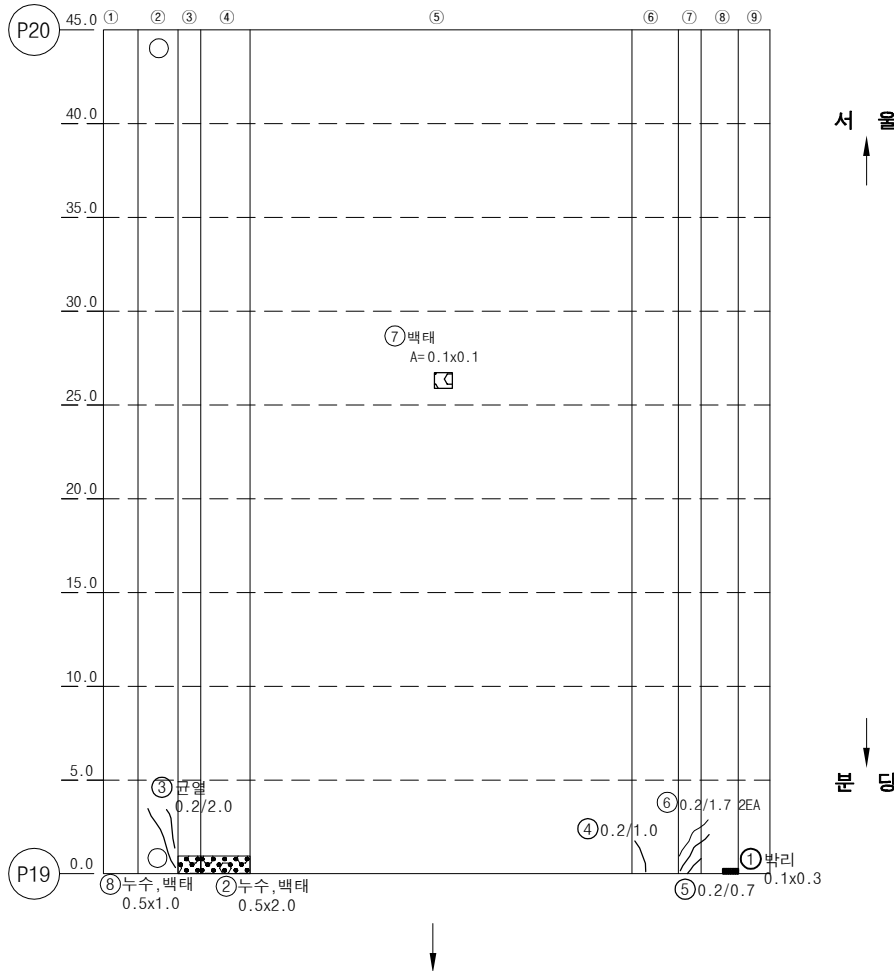

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	③ 균열	④ 광상균열	⑤ 백태	⑥ 편위, 공동	조사일시	2023년 11월	
	⑦ 재료분리	⑧ 철근노출	⑨ 철근부식	⑩ 좌굴, 변형	조사자	이희송 외 17인	
	⑪ 박리, 파손	⑫ 시공이음분리, 송판리	⑬ 어물결면적	⑭ 신축이음 본체	확인자	김 찬 구	
	⑮ 누수, 변색	⑯ 배수구	⑰ 포장의 요철	⑱ 기타	도면번호	150	


ID : 복정고가교 본선-상행선 box외부(S21)

손 상 물 량 표

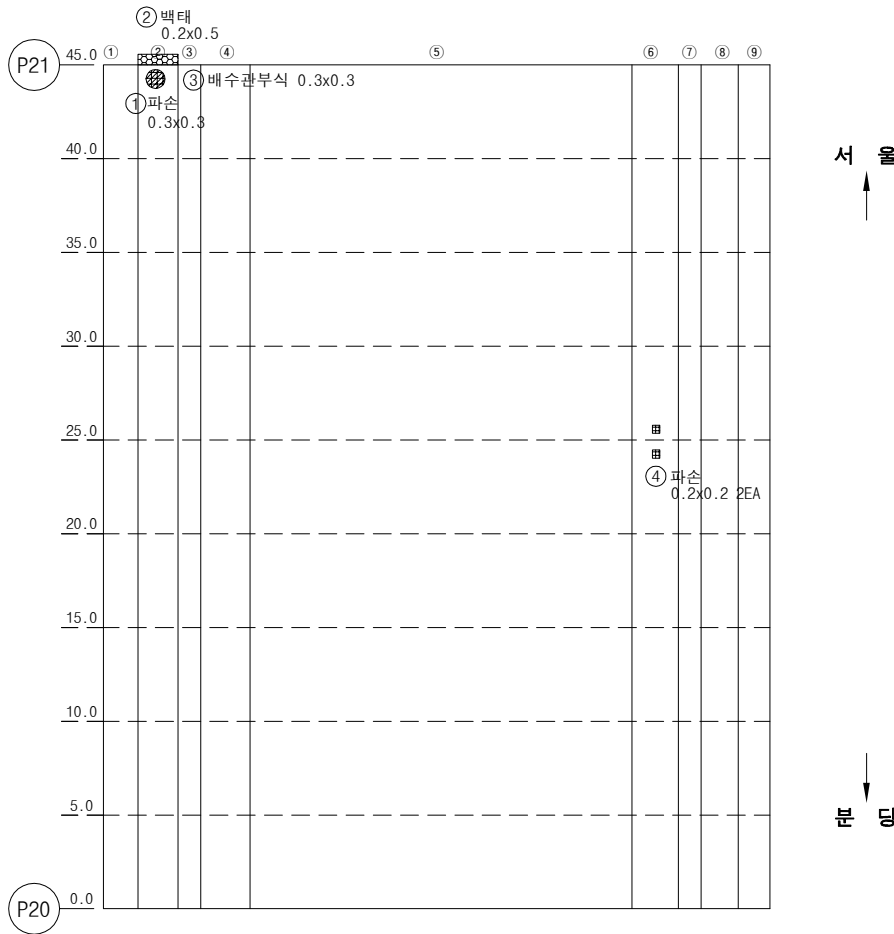


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.3	0.3	0.09	m ²	1	
2	백태	0.2	0.5	0.10	m ²	1	
3	배수관부식	0.3	0.3	1	EA	1	
4	파손	0.2	0.2	0.08	m ²	2	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN




SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	151	


ID : 복정고가교 본선-상행선 box외부(S22)

손 상 물 량 표

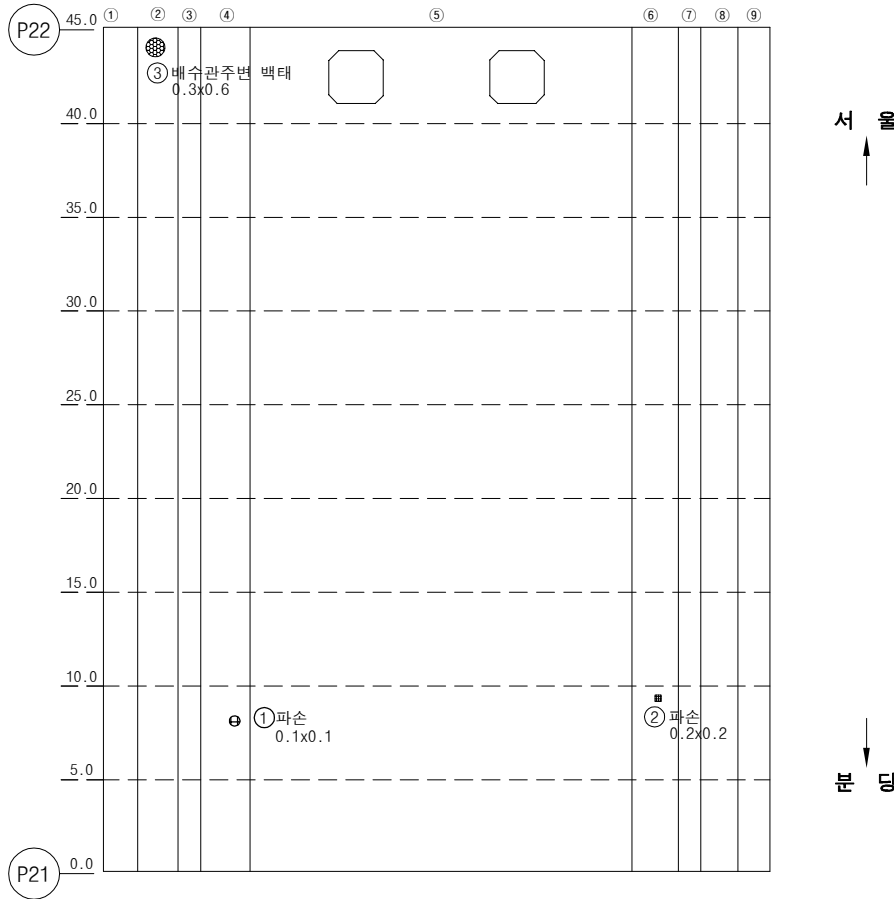


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.1	0.1	0.01	m ²	1	
2	파손	0.2	0.2	0.04	m ²	1	
3	배수관 주변 백태	0.3	0.6	0.18	m ²	1	
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	152	

ID : 복정고가교 본선-상행선 box외부(S23)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관 주변 백태	0.3	0.3	0.09	m ²	1	
2	파손	0.2	0.2	0.04	m ²	1	
3	파손	0.2	0.2	0.04	m ²	1	
4	파손	0.2	0.2	0.04	m ²	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

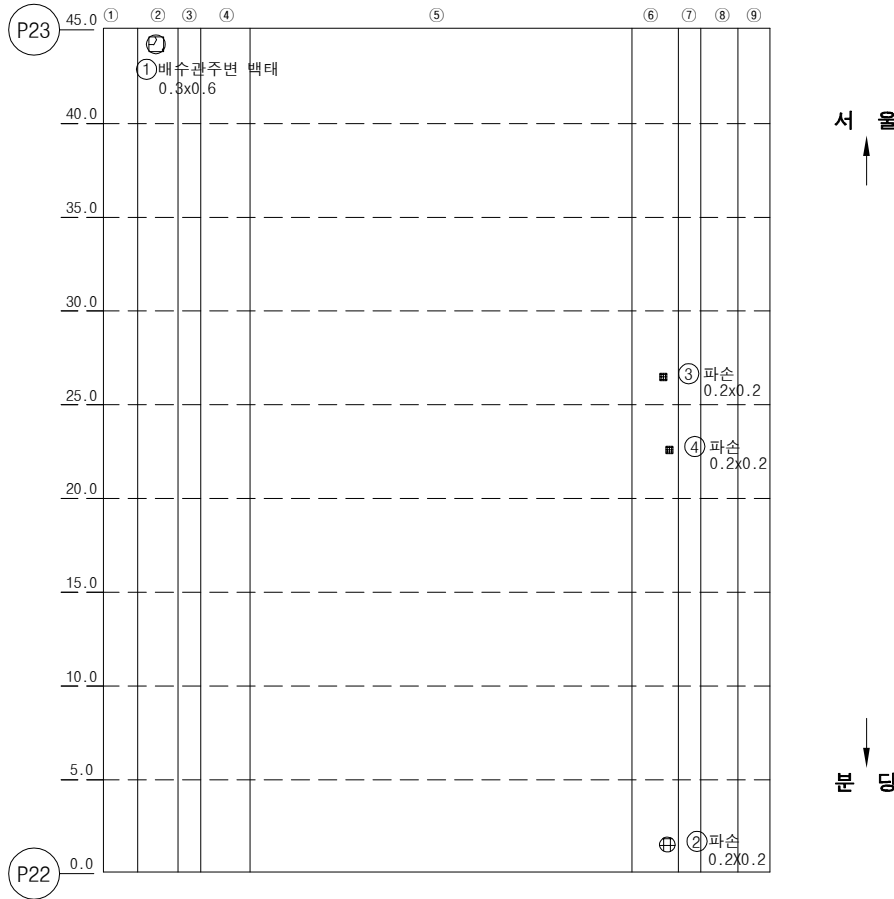

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	153	


ID : 복정고가교 본선-상행선 box외부(S24)

손상물량표

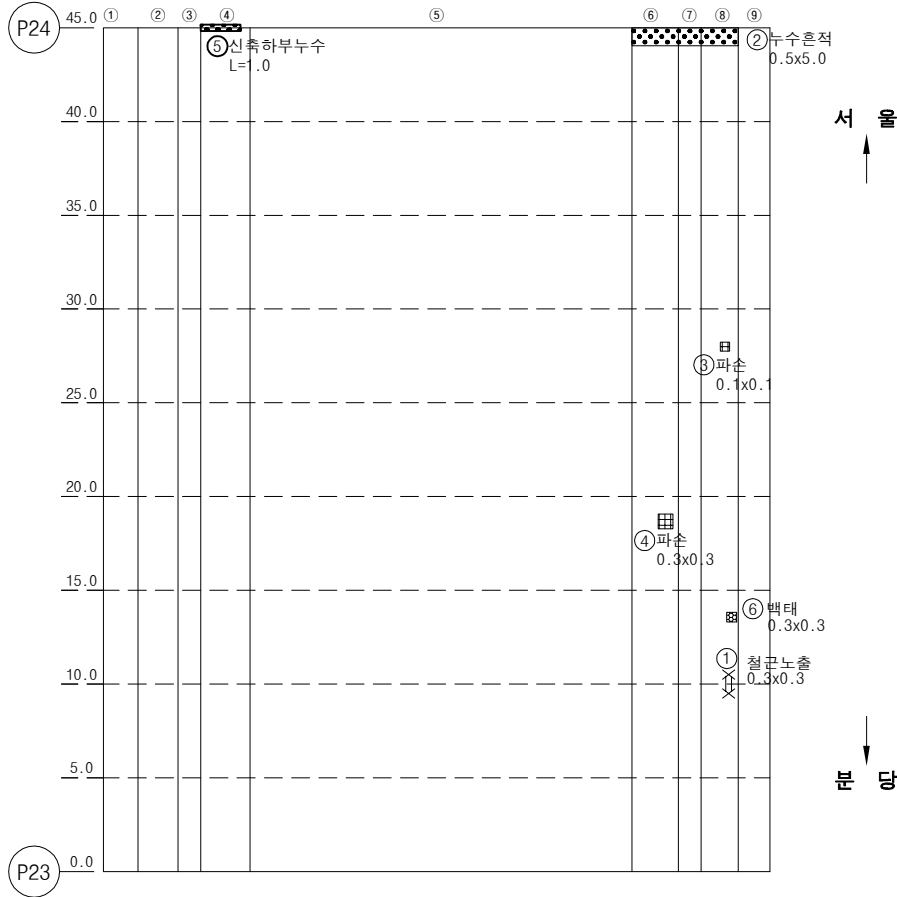


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	철근노출	0.3	0.3	0.09	m ²	1	
2	표면오염(누수흔적)	0.5	5	2.50	m ²	1	
3	파손	0.1	0.1	0.01	m ²	1	
4	파손	0.3	0.3	0.09	m ²	1	
5	신축하부누수		1	1.00	m	1	
6	백태	0.3	0.3	0.09	m ²	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축아물 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	154	

ID : 복정고가교 본선-상행선 box외부(S25)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	0.5	0.50	m	1	
2	균열(0.2mm)	0.2	1	1.00	m	1	
3	균열(0.2mm)	0.2	0.3	0.30	m	1	
4	균열(0.2mm)	0.2	1.2	2.40	m	2	
5	재료분리	1	1	1.00	m ²	1	
6	파손	0.1	0.1	0.01	m ²	1	
7	파손	0.1	0.1	0.04	m ²	4	
8	균열부백태	0.2	1	3.00	m	3	
9	배수관부식			1	EA	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

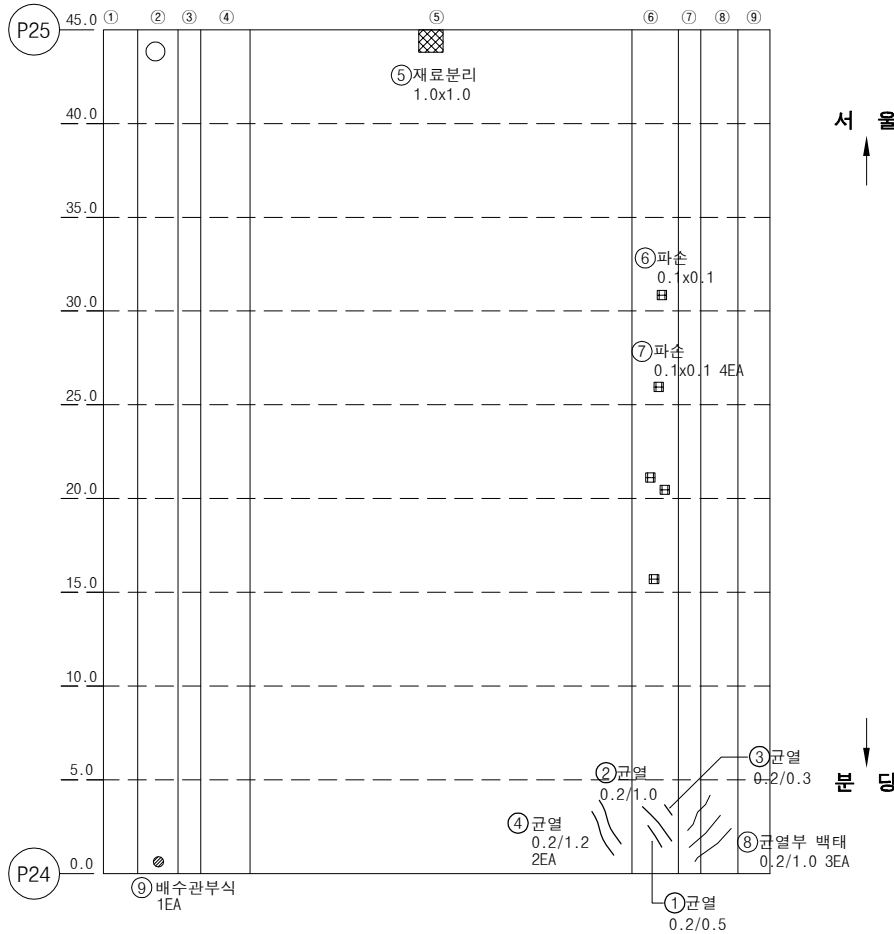

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이음열외력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	155	


ID : 복정고가교 본선-상행선 box외부(S26)

손 상 물 량 표

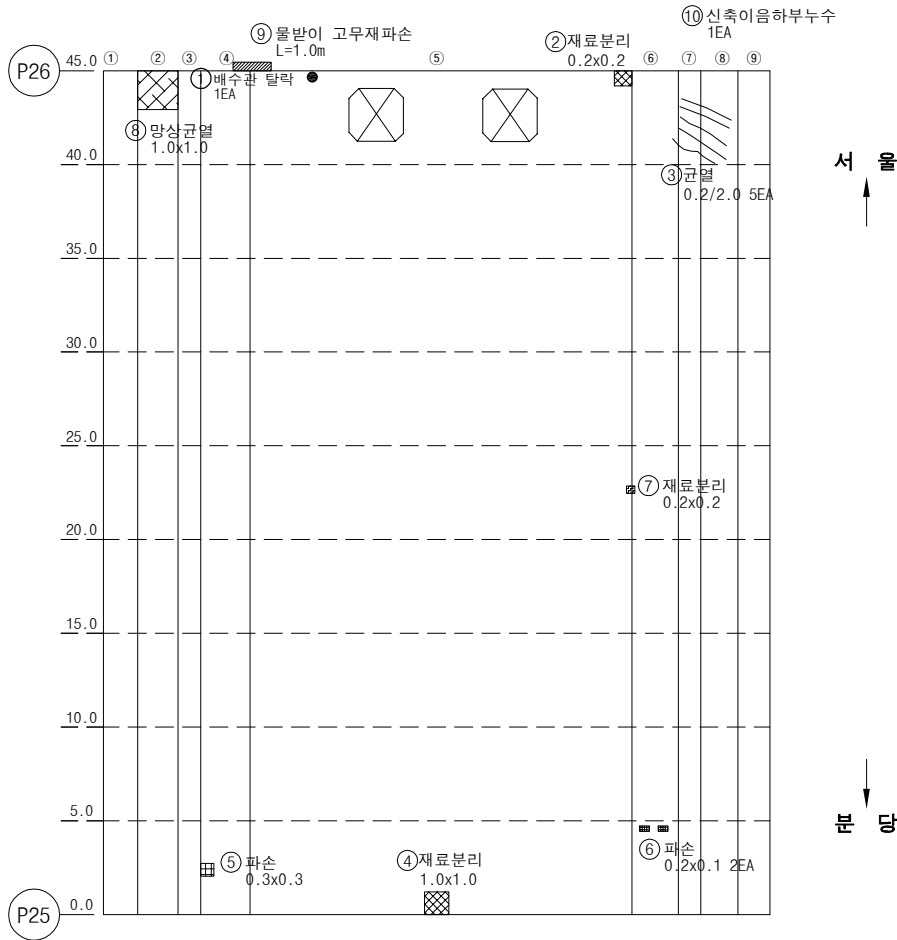


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관달락			1	EA	1	
2	재료분리	0.2	0.2	0.04	m ²	1	
3	균열(0.2mm)	0.2	2	10.00	m	5	
4	재료분리	1	1	1.00	m ²	1	
5	파손	0.3	0.3	0.09	m ²	1	
6	파손	0.2	0.1	0.04	m ²	2	
7	재료분리	0.2	0.2	0.04	m ²	1	
8	망상균열	1	1	1.00	m ²	1	
9	물받이고무재파손			1	14.00	m	14
10	신축하부누수			0.00	EA	1	
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 망상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 바리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물물질	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	156	


ID : 복정고가교 본선-상행선 box외부(S27)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.5	1	0.50	m ²	1	
2	물끊기흙누락		0.1	0.10	m	1	
3	물끊기흙누락		0.7	0.70	m	1	
4	균열(0.1mm)	0.1	2	2.00	m	1	
5	표면오염(누수흔적)	0.5	1	0.50	m ²	1	
6	백태	0.6	0.6	0.36	m ²	1	
7	재료분리	0.5	0.5	0.25	m ²	1	
8	배수관주변백태	0.5	0.5	0.25	m ²	1	
9	균열(0.1mm)	0.1	0.5	0.50	m	1	
10	균열(0.2mm)	0.2	2	2.00	m	1	
11	균열(0.1mm)	0.1	0.8	0.80	m	1	
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

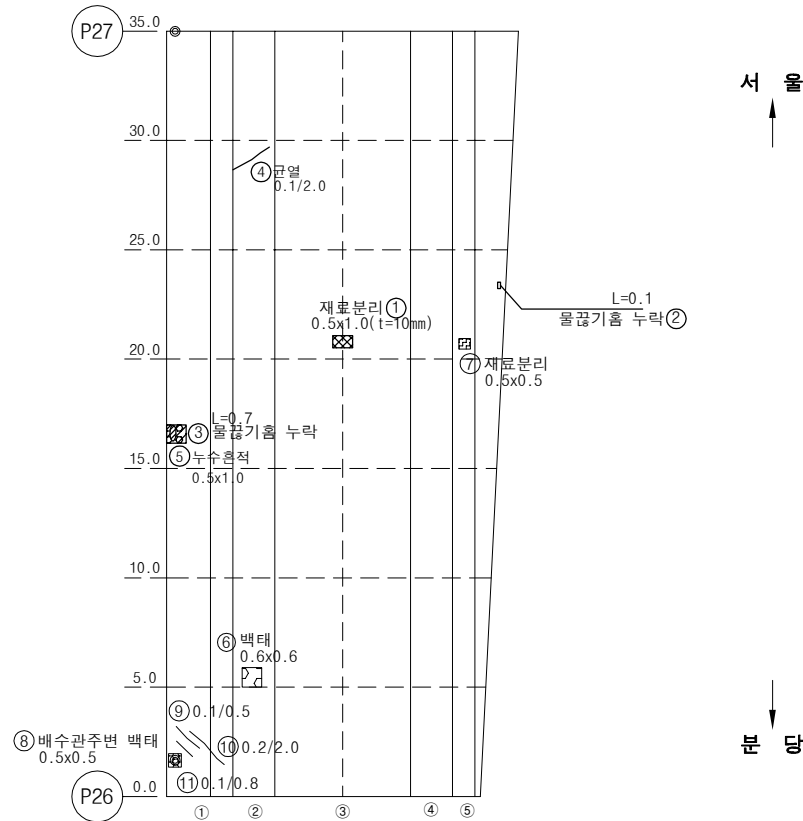

KEY PLAN

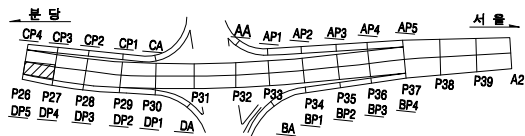

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이용분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	157	


ID : 복정고가교 본선-상행선 box외부(S28)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1	3.00	m	3	
2	균열(0.1mm)	0.1	1	1.00	m	1	
3	균열(0.1mm)	0.1	1.5	1.50	m	1	
4	배수관 주변 백태	0.2	0.2	0.04	m²	1	
5	배수관부식			1	EA	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

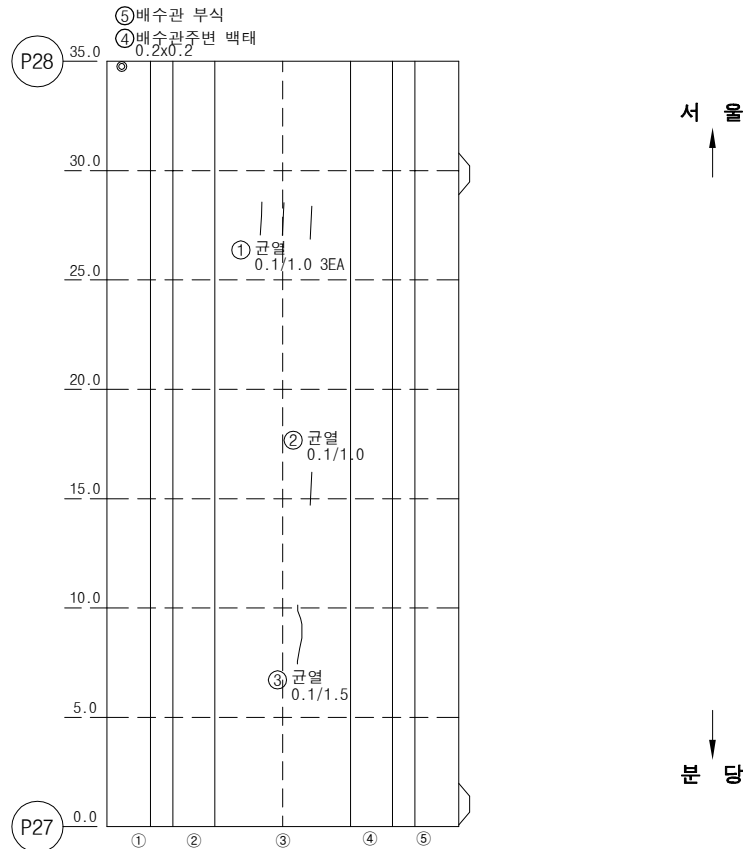

KEY PLAN

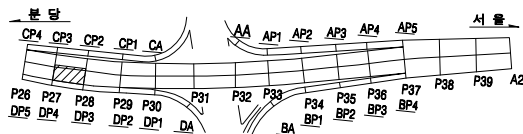

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 바리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	158	


ID : 복정고가교 본선-상행선 box외부(S29)

손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	2.2	2.20	m	1	
2	균열(0.1mm)	0.1	1	1.00	m	1	
3	균열(0.1mm)	0.1	3	3.00	m	1	
4	균열(0.1mm)	0.1	1.2	1.20	m	1	
5	균열(0.1mm)	0.1	1	2.00	m	2	
6	균열(0.1mm)	0.1	6	6.00	m	1	
7	균열(0.1mm)	0.1	1.6	1.60	m	1	
8	균열(0.1mm)	0.1	12	12.00	m	1	
9	균열(0.1mm)	0.1	0.5	1.00	m	2	
10	균열(0.1mm)	0.1	2	2.00	m	1	
11	균열(0.1mm)	0.1	0.8	0.80	m	1	
12	균열(0.1mm)	0.1	3	6.00	m	2	
13	균열(0.1mm)	0.1	1.8	1.80	m	1	
14	재료분리	0.2	0.2	0.04	m ²	1	
15	물끊기흙누락		0.2	0.20	m	1	
16	물끊기흙누락		0.3	0.30	m	1	
17	물끊기흙누락		0.2	0.20	m	1	
18	물끊기흙누락		0.4	0.40	m	1	
19	백태	1.5	0.3	0.45	m ²	1	
20	파손	0.1	0.1	0.01	m ²	1	
21	표면오염(누수흔적)	2	3.5	7.00	m ²	1	
22	배수관 주변 누수 및 백태	0.3	0.3	0.09	m ²	1	
23	표면오염(누수흔적)	0.3	2	0.60	m ²	1	
24	표면오염(누수흔적)	0.8	2	1.60	m ²	1	
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

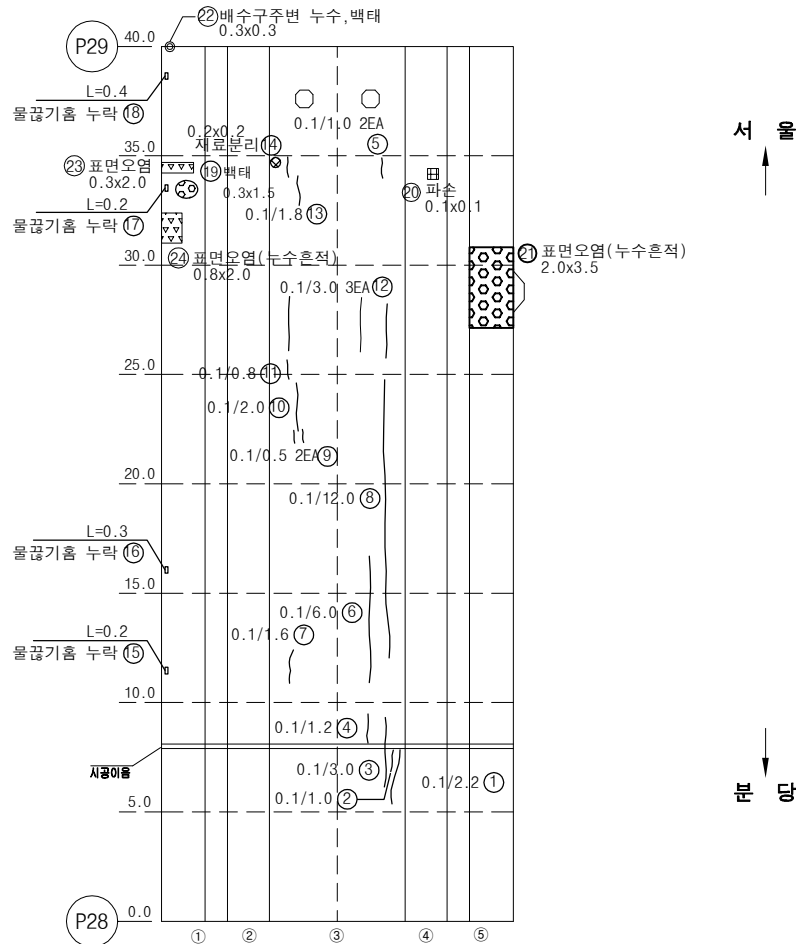

KEY PLAN

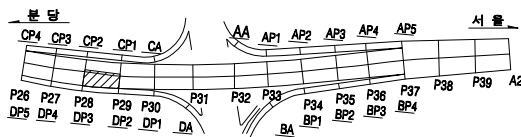


ID : 복정고가교 본선-상행선 box외부(S30)




손상물량표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1.2	1.20	m	1	
2	균열(0.1mm)	0.1	1	1.00	m	1	
3	균열(0.1mm)	0.1	4	4.00	m	1	
4	균열(0.1mm)	0.1	1.5	1.50	m	1	
5	균열(0.1mm)	0.1	1.2	1.20	m	1	
6	균열(0.1mm)	0.1	1	1.00	m	1	
7	균열(0.1mm)	0.1	0.3	0.30	m	1	
8	균열(0.1mm)	0.1	0.9	0.90	m	1	
9	균열(0.1mm)	0.1	1.1	1.10	m	1	
10	균열(0.1mm)	0.1	0.4	0.40	m	1	
11	균열(0.1mm)	0.1	1.5	1.50	m	1	
12	균열(0.1mm)	0.1	0.6	0.60	m	1	
13	균열(0.1mm)	0.1	1	1.00	m	1	
14	표면오염(누수흔적)	1.2	2.5	3.00	m²	1	
15	파손	0.1	0.1	0.01	m²	1	
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

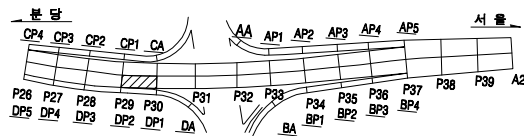


SECTION



용역명		2023년 하반기 복정고가고 정밀안전진단 용역					
제 번	 균열	 양상균열	 박대	 변형, 공동	조사일시	2023년 11월	
	 재료손리	 철근노출	 철근부식	 좌굴, 변형	조 사 자	이희송 외 17인	
	 바리, 파손	 시공이음손리, 종균리	 이음결합의결	 신속이음 본체	확 인 자	김 찬 구	
	 너수, 볼트	 배수구	 포장의 오일	 기타	도면번호	160	


ID : 복정고가교 본선-상행선 box외부(S31)

손 상 물 량 표

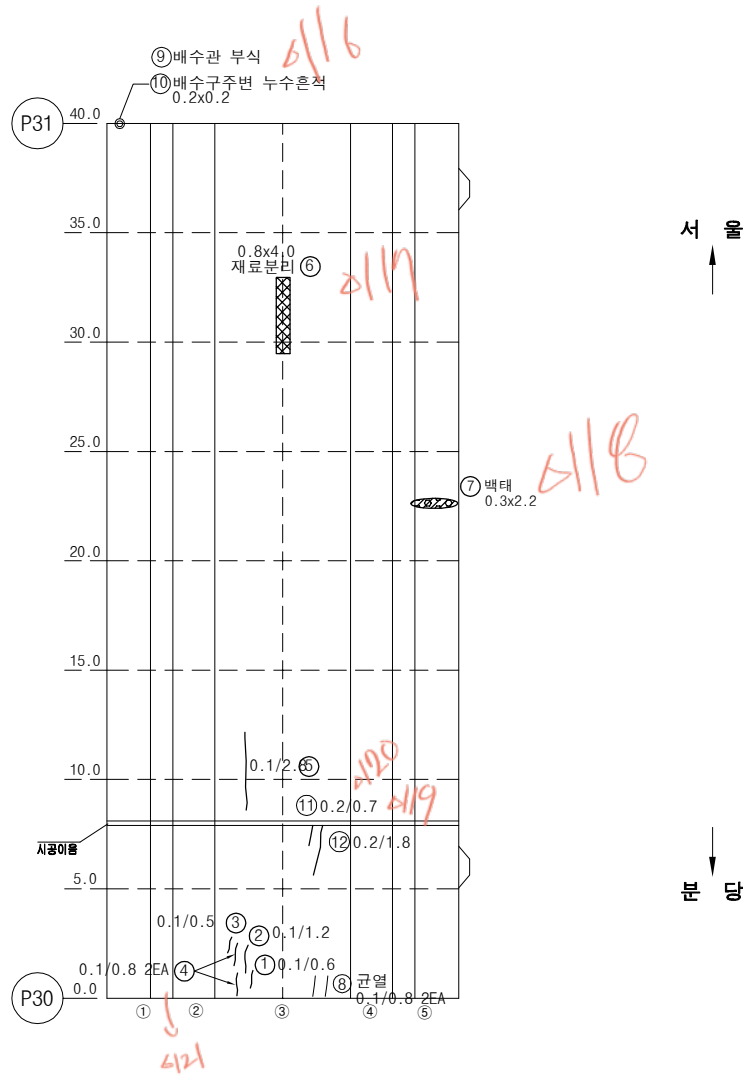


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.6	0.60	m	1	
2	균열(0.1mm)	0.1	1.2	1.20	m	1	
3	균열(0.1mm)	0.1	0.5	0.50	m	1	
4	균열(0.1mm)	0.1	0.8	1.60	m	2	
5	균열(0.1mm)	0.1	2.8	2.80	m	1	
6	재료분리	4	0.8	3.20	m ²	1	
7	백태	2.2	0.3	0.66	m ²	1	
8	균열(0.1mm)	0.1	0.8	1.60	m	2	
9	배수관부식			1	EA	1	
10	배수구주변누수흔적	0.2	0.2	0.04	m ²	1	
11	균열(0.2mm)	0.2	0.7	0.70	m	1	
12	균열(0.2mm)	0.2	1.8	1.80	m	1	
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

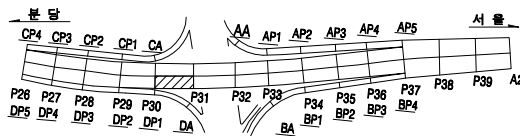


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역							
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월			
	재료분리	철근노출	철근부식	좌굴, 변형	조 사 자	이희송 외 17인			
	바라, 파손	시공이음분리, 송판리	이물열외력	신축이음 본체	확 인 자	김 찬 구			
	누수, 변색	배수구	포장파괴 및	기타	도면번호	161			


ID : 복정고가교 본선-상행선 box외부(S32)

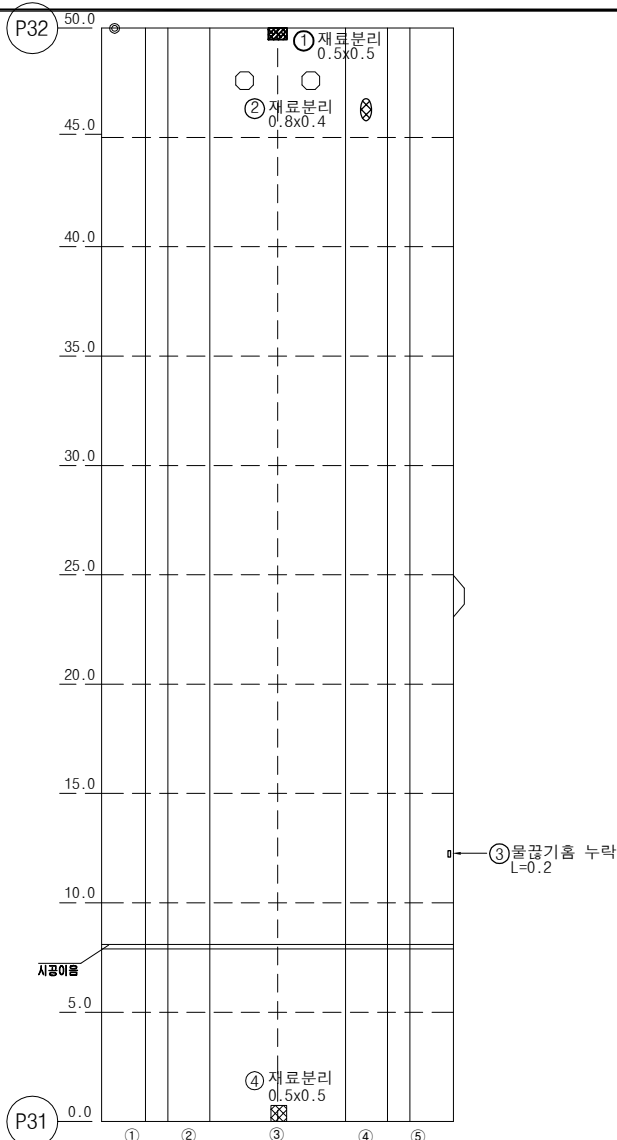


서 울

분 양

KEY PLAN

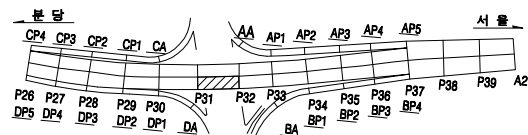

SECTION



손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.5	0.5	0.25	m ²	1	
2	재료분리	0.4	0.8	0.32	m ²	1	
3	물끊기 홈 누락		0.2	0.20	m	1	
4	재료분리	0.5	0.5	0.25	m ²	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	162	

ID : 복정고가교 본선-상행선 box외부(S33)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.1	0.1	0.01	m²	1	
2	균열(0.1mm)	0.1	0.4	0.80	m	2	
3	균열(0.1mm)	0.1	1	2.00	m	2	
4	물길기름누락		0.2	0.20	m	1	
5	망상균열	2	2.5	5.00	m²	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

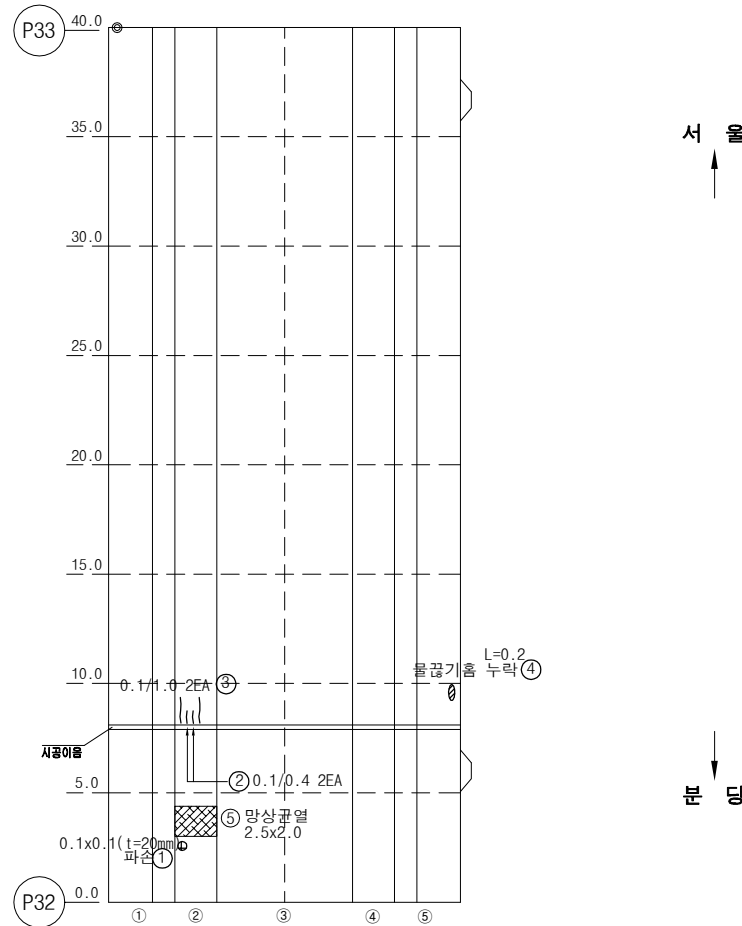

KEY PLAN


SECTION

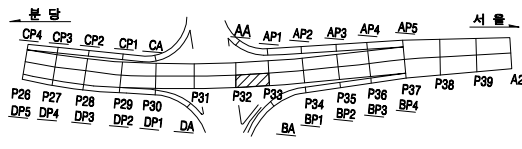

용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	망상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물열매력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	163	


ID : 복정고가교 본선-상행선 box외부(S34)

손 상 물 량 표

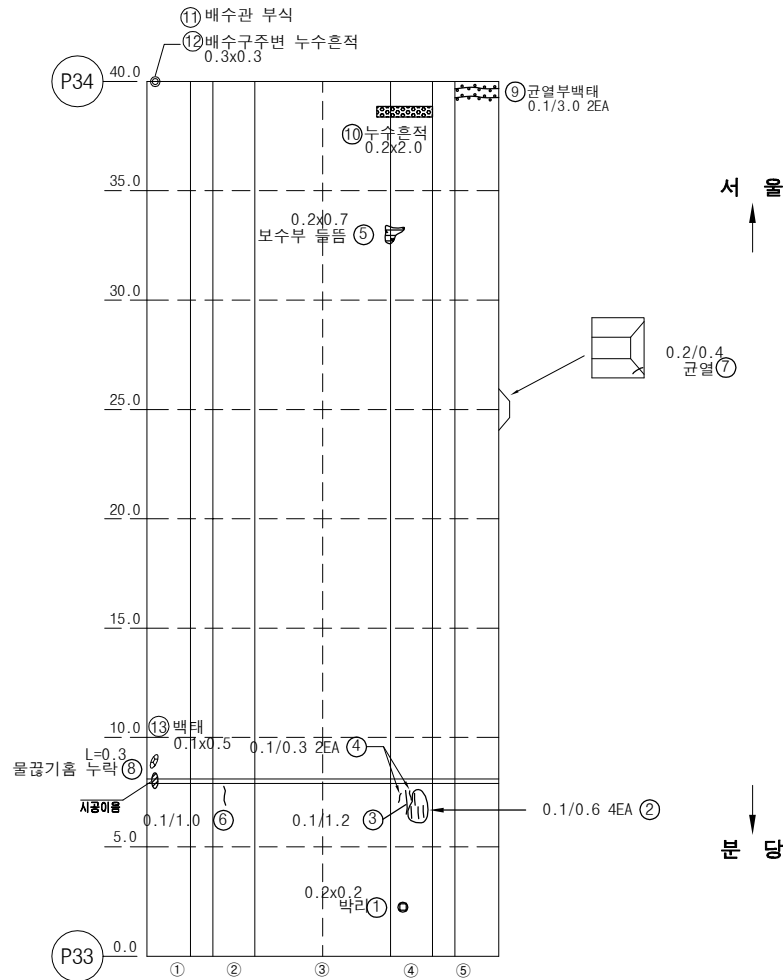


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	박리	0.2	0.2	0.04	m ²	1	
2	균열(0.1mm)	0.1	0.6	2.40	m	4	
3	균열(0.1mm)	0.1	1.2	1.20	m	1	
4	균열(0.1mm)	0.1	0.3	0.60	m	2	
5	보수부 들뜸	0.7	0.2	0.14	m ²	1	
6	균열(0.1mm)	0.1	1	1.00	m	1	
7	균열(0.2mm)	0.2	0.4	0.40	m	1	
8	물끊기흙누락		0.3	0.30	m	1	
9	균열부백태	0.1	3	6.00	m	2	
10	누수흔적	2	0.2	0.40	m ²	1	
11	배수관부식			1	EA	1	
12	배수관 주변 누수흔적	0.3	0.3	0.09	m ²	1	
13	백태	0.1	0.5	0.05	m ²	1	
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

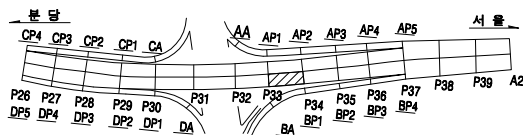

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송판리	이물열매력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	164	


ID : 복정고가교 본선-상행선 box외부(S36)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.2	0.2	0.04	m ²	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

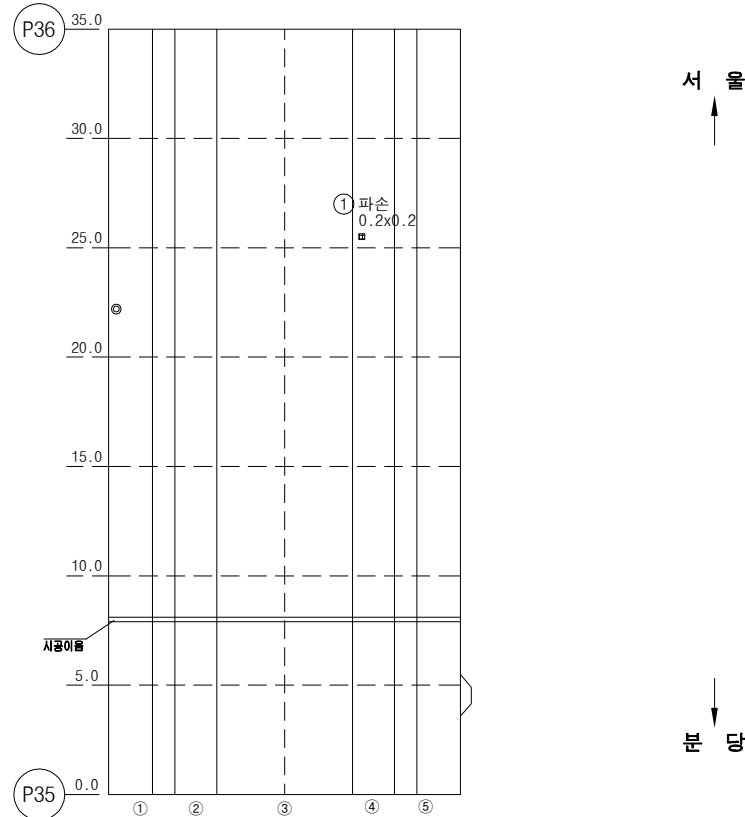

KEY PLAN

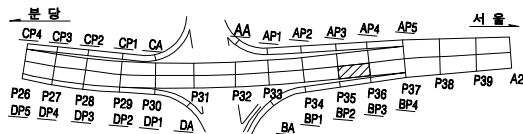

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	166	


ID : 복정고가교 본선-상행선 box외부(S37)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.2	0.20	m	1	
2	배수구 주변 누수흔적, 백태	0.2	0.3	0.06	m ²	1	
3	보수부 박락, 철근노출	0.2	0.5	0.10	m ²	1	
4	누수흔적	0.2	5	1.00	m ²	1	
5	보수부 박락, 철근노출	0.3	0.8	0.24	m ²	1	
6	철근노출	0.4	0.3	0.12	m ²	1	
7	파손	0.2	0.2	0.04	m ²	1	
8	균열(0.2mm)	0.2	2.2	4.40	m	2	
9	균열(0.2mm)	0.2	1.1	1.10	m	1	
10	균열(0.2mm)	0.2	1.5	1.50	m	1	
11	균열(0.2mm)	0.2	4.2	4.20	m	1	
12	균열(0.2mm)	0.2	2.5	2.50	m	1	
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

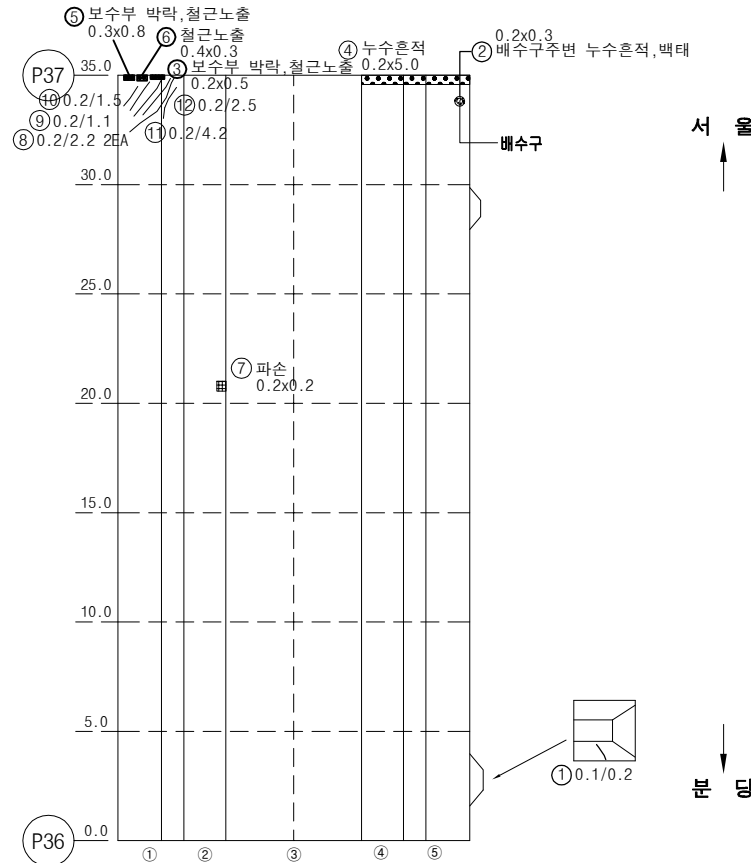

KEY PLAN

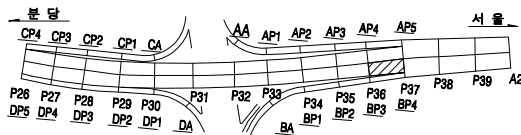

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이용분리, 송분리	이물침투력	신축아물 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	167	


ID : 복정고가교 본선-상행선 box외부(S38)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	백태	0.3	0.6	0.18	m ²	1	
2	배수구 주변 누수, 백태	0.2	0.2	0.04	m ²	1	
3	박락	0.2	0.2	0.04	m ²	1	
4	파손	0.2	0.2	0.04	m ²	1	
5	파손	0.6	0.3	0.18	m ²	1	
6	파손	1	0.6	0.60	m ²	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

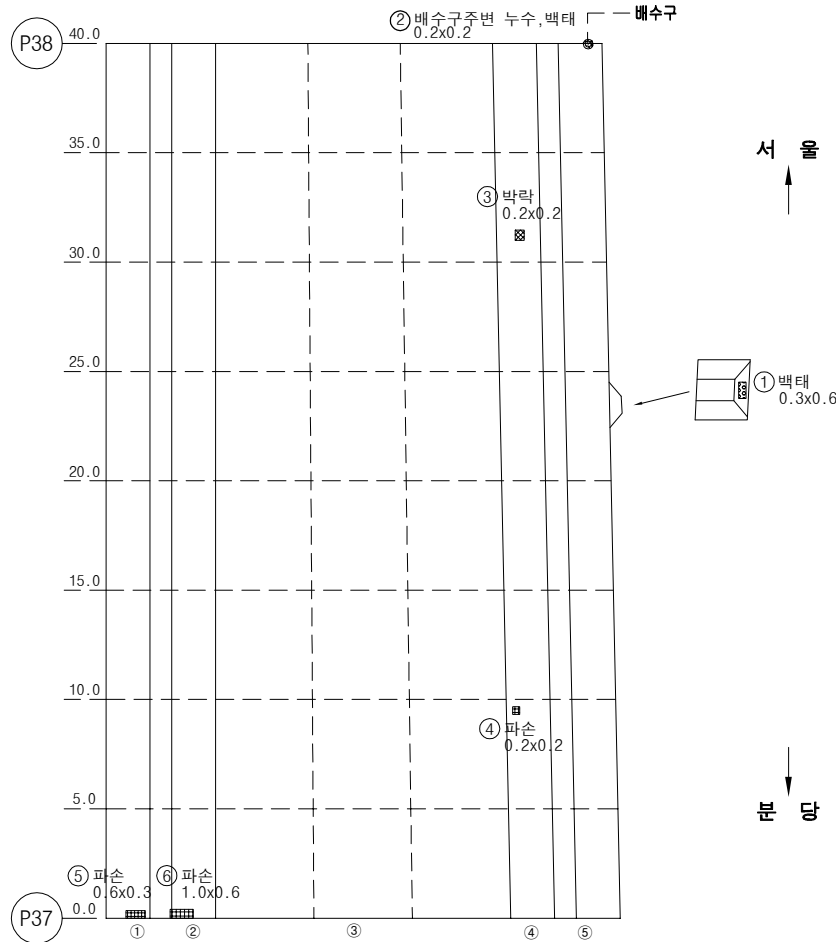

KEY PLAN

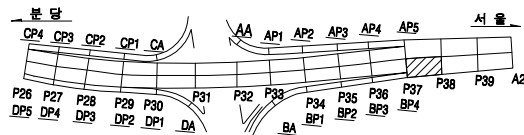

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송판리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	168	


ID : 복정고가교 본선-상행선 box외부(S39)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수구 주변 누수 흔적, 백태	0.2	0.2	0.04	m ²	1	
2	배수관 부식			1	EA	1	
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

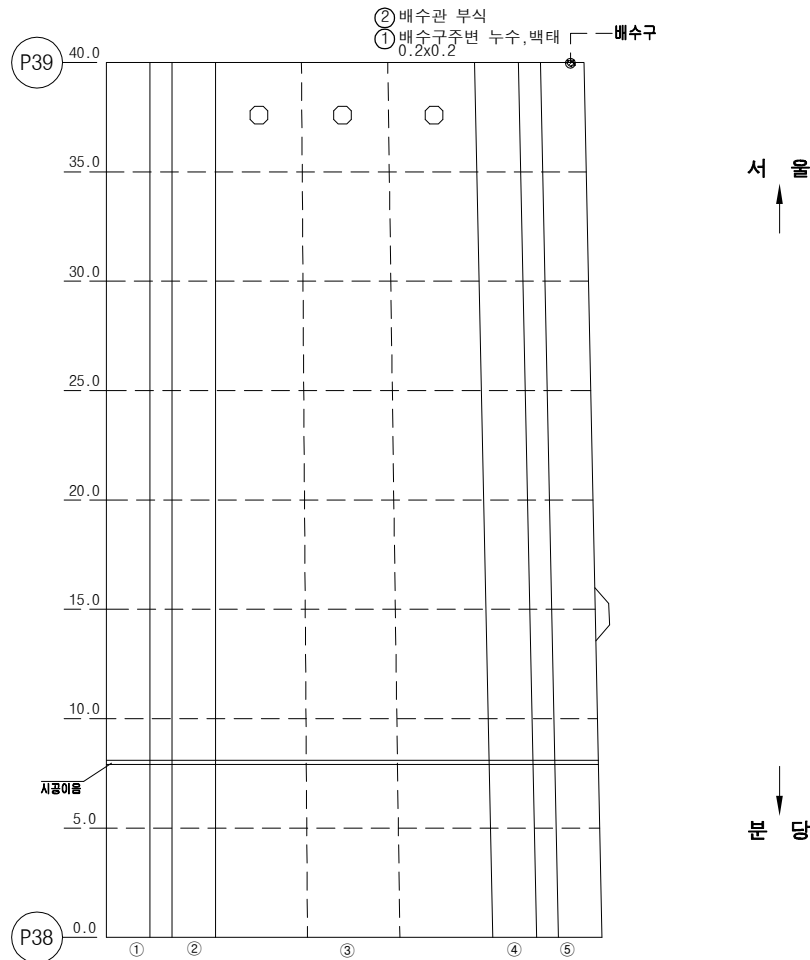

KEY PLAN

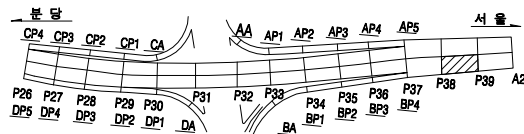


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	169	


ID : 복정고가교 본선-상행선 box외부(S40)

손 상 물 량 표

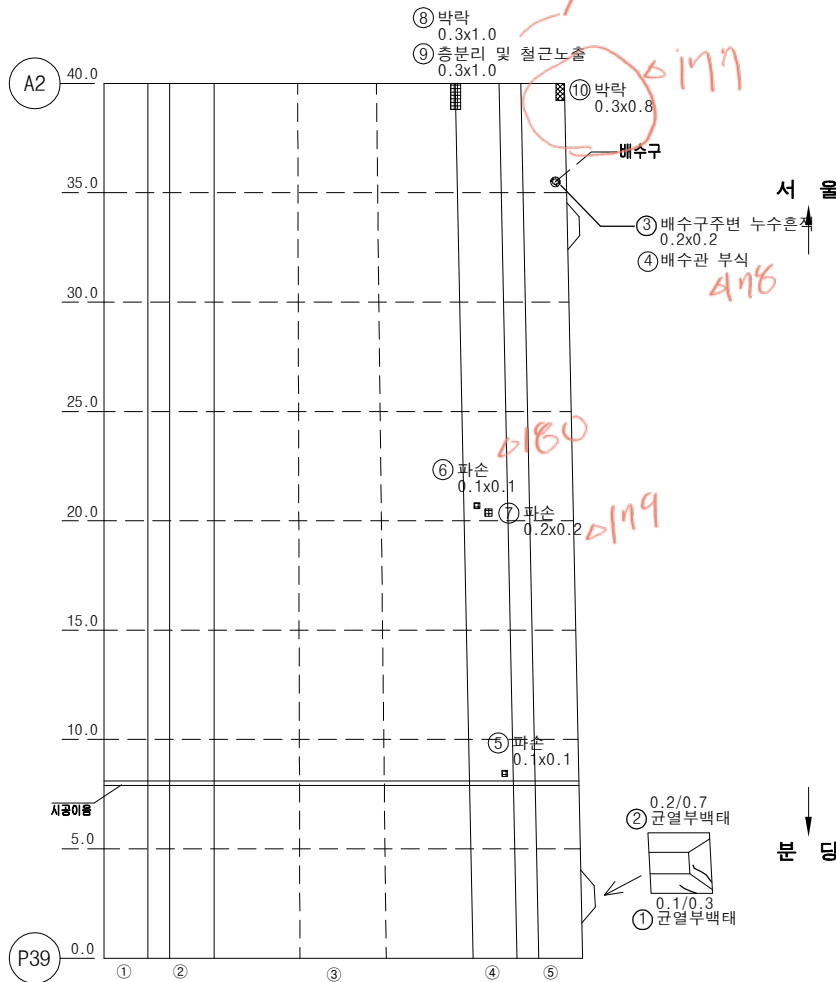


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.3	0.30	m	1	
2	균열(0.2mm)	0.2	0.7	0.70	m	1	
3	배수관 주변 누수흔적	0.2	0.2	0.04	m ²	1	
4	배수관 부식			1	EA	1	
5	파손	0.1	0.1	0.01	m ²	1	
6	파손	0.1	0.1	0.01	m ²	1	
7	파손	0.2	0.2	0.04	m ²	1	
8	박라	0.3	1	0.30	m ²	1	
9	층분리 및 철근노출	0.3	1	0.30	m ²	1	
10	박라	0.3	0.8	0.24	m ²	1	
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

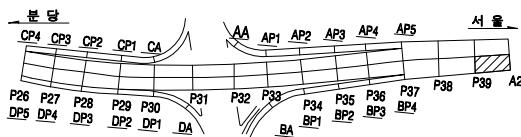

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역							
면 례	① 균열	② 광상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월			
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인			
	⑨ 박라, 파손	⑩ 시공이음분리, 층분리	⑪ 이음열외력	⑫ 신축이음 본체	확인자	김 찬 구			
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	170			

ID : 복정고가교 본선-하행선 box외부(S1)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관주변 누수흔적	0.5	0.6	0.30	m ²	1	
2	신축재탈락		1	1.00	m	1	
3	재료분리	1	0.3	0.30	m ²	1	
4	파손	0.5	0.1	0.05	m ²	1	
5	균열부백태	0.2	2.5	12.50	m	5	
6	누수흔적	5	1	5.00	m ²	1	
7	백태	0.1	1	0.10	m ²	1	
8	신축하부누수		14	14.00	m	1	
9	박락	0.4	0.4	0.16	m ²	1	
10	망상균열	0.5	1	0.50	m ²	1	
11	균열(0.2mm)	0.2	2	8.00	m	4	
12	박락	0.1	0.3	0.03	m ²	1	
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

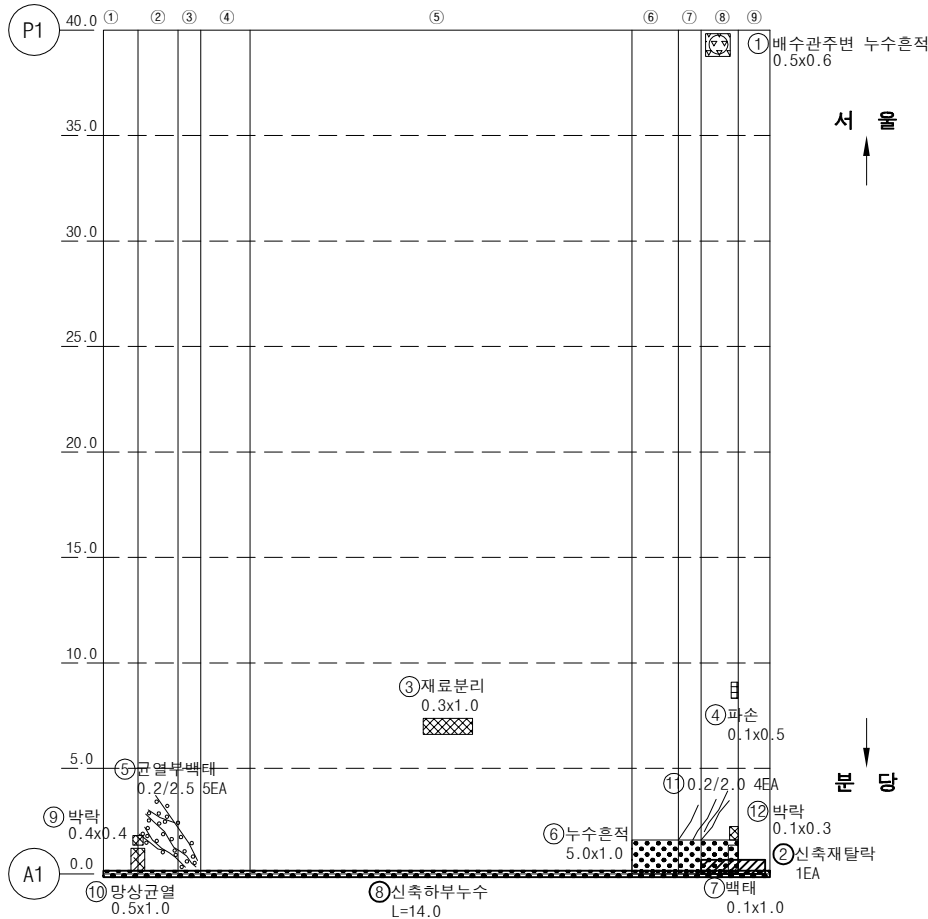

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례					조사일시	2023년 11월	
					조 사 자	이희송 외 17인	
					확 인 자	김 찬 구	
					도면번호	171	

ID : 복정고가교 본선-하행선 box외부(S2)



손 상 물 량 표

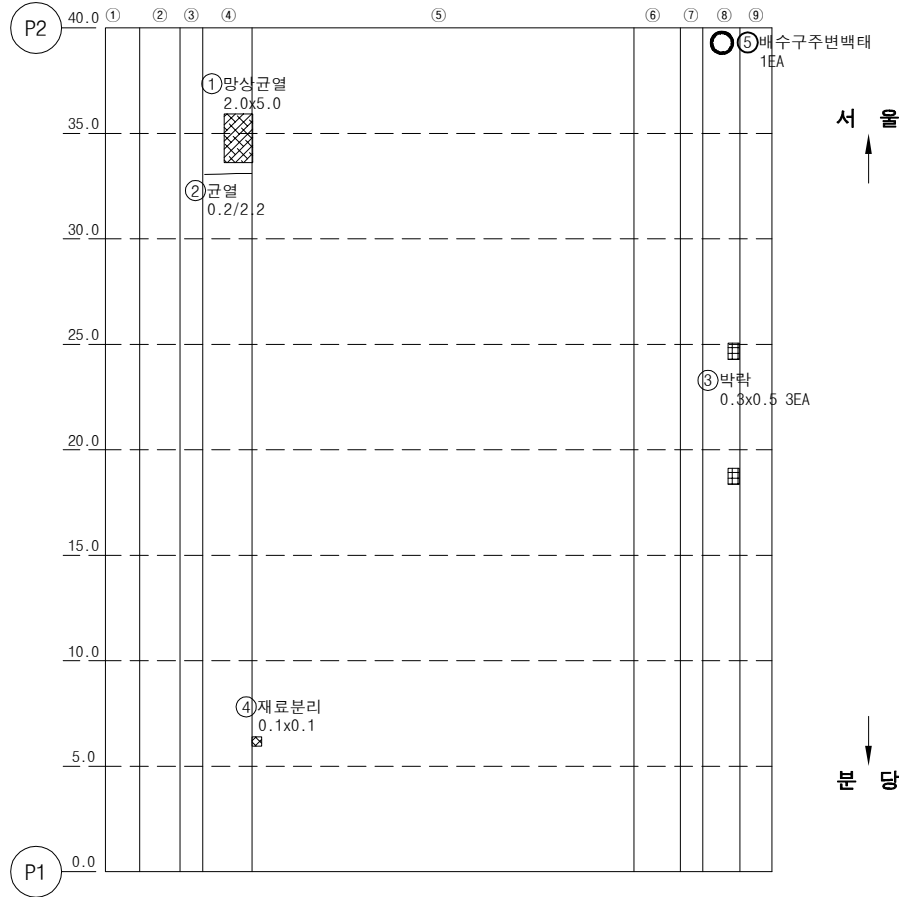

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	망상균열	2	5	10.00	m ²	1	
2	균열(0.2mm)	0.2	2.2	2.20	m	1	
3	박락	0.5	0.3	0.45	m ²	3	
4	재료분리	0.1	0.1	0.01	m ²	1	
5	배수구 주변 백태	0.1	0.2	0.02	m ²	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 망상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송판리	⑪ 이음열외력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	172	

ID : 복정고가교 본선-하행선 box외부(S3)

손 상 물 량 표

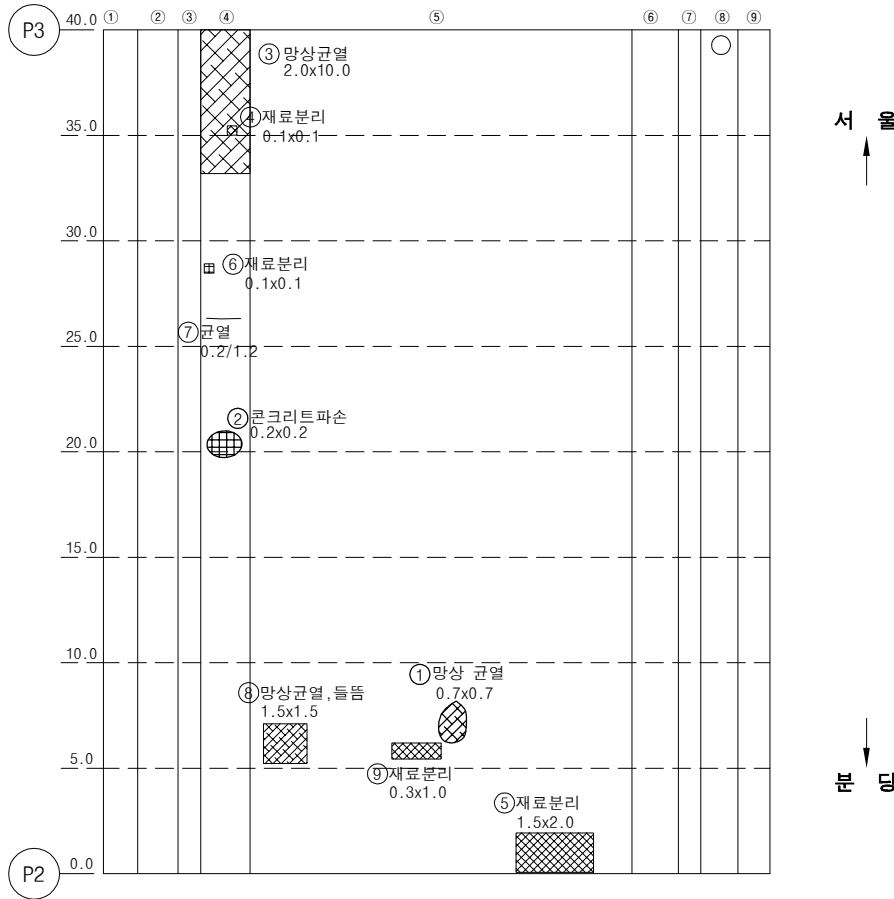



서울

부산

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	망상균열	0.7	0.7	0.49	m ²	1	
2	파손	0.2	0.2	0.04	m ²	1	
3	망상균열	2	10	20.00	m ²	1	
4	재료분리	0.1	0.1	0.01	m ²	1	
5	재료분리	2	1.5	3.00	m ²	1	
6	파손	0.1	0.1	0.01	m ²	1	
7	균열(0.2mm)	0.2	1.2	1.20	m	1	
8	망상균열, 들뜸	1.5	1.5	2.25	m ²	1	
9	재료분리	1	0.3	0.30	m ²	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	망상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	173	

ID : 복정고가교 본선-하행선 box외부(S4)



손 상 물 량 표

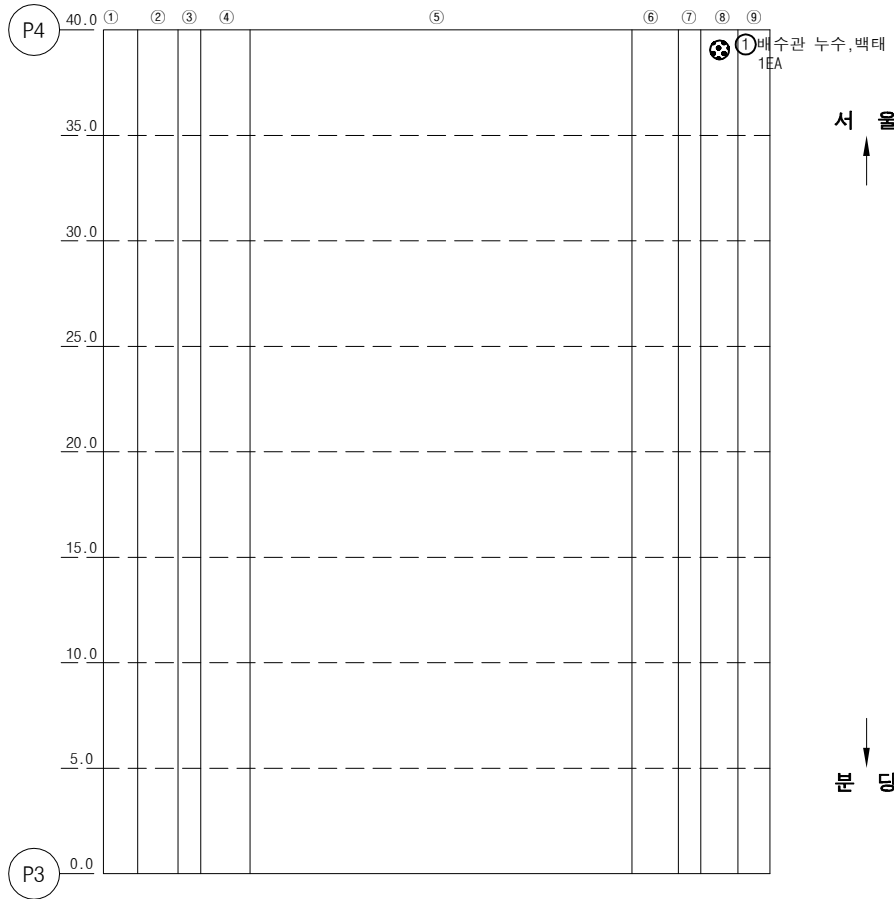

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관 누수, 백태			1	EA	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및 결	기타	도면번호	174	


ID : 복정고가교 본선-하행선 box외부(S5)

손상물량표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관누수, 백태			1	EA	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

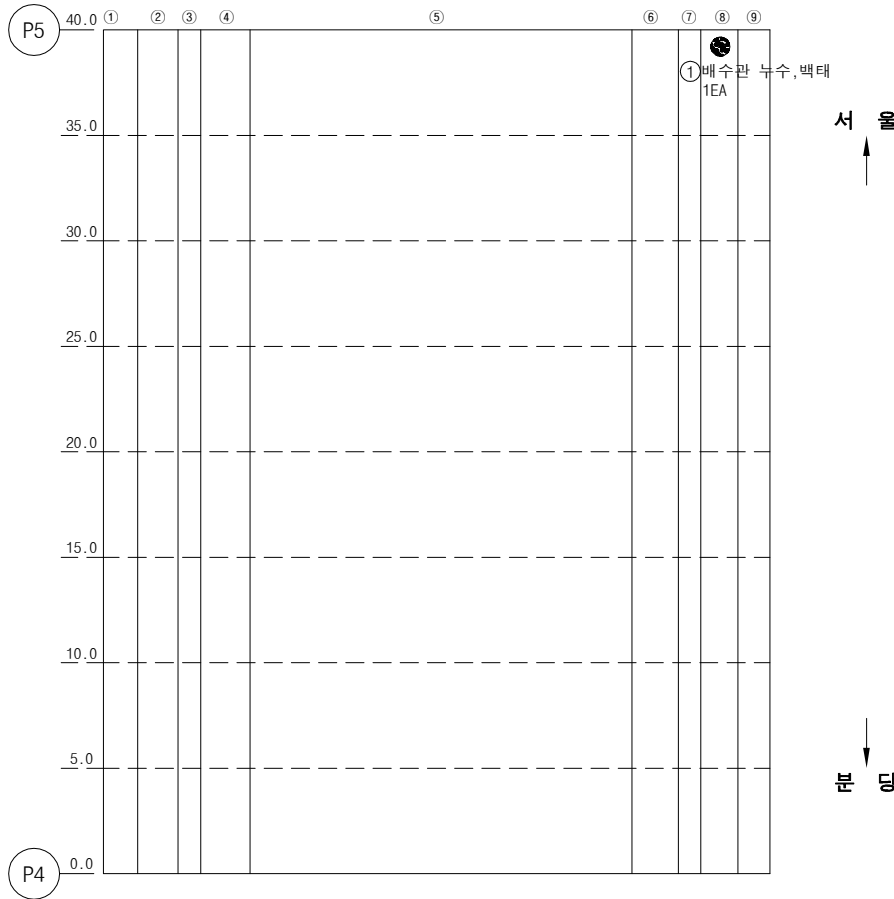

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
범 례	균열	광상균열	백태	편향, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이음열림력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장의 요철	기타	도면번호	175	

ID : 복정고가교 본선-하행선 box외부(S6)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1.2	1.20	m	1	
2	균열(0.1mm)	0.1	1	1.00	m	1	
3	균열(0.1mm)	0.1	0.3	0.30	m	1	
4	균열(0.1mm)	0.1	0.7	0.70	m	1	
5	균열(0.1mm)	0.1	0.5	0.50	m	1	
6	균열(0.1mm)	0.1	0.5	1.00	m	2	
7	재료분리	0.5	0.5	0.25	m ²	1	
8	박리	0.1	0.1	0.01	m ²	1	
9	배수관 주변 백태	0.6	0.5	0.30	m ²	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

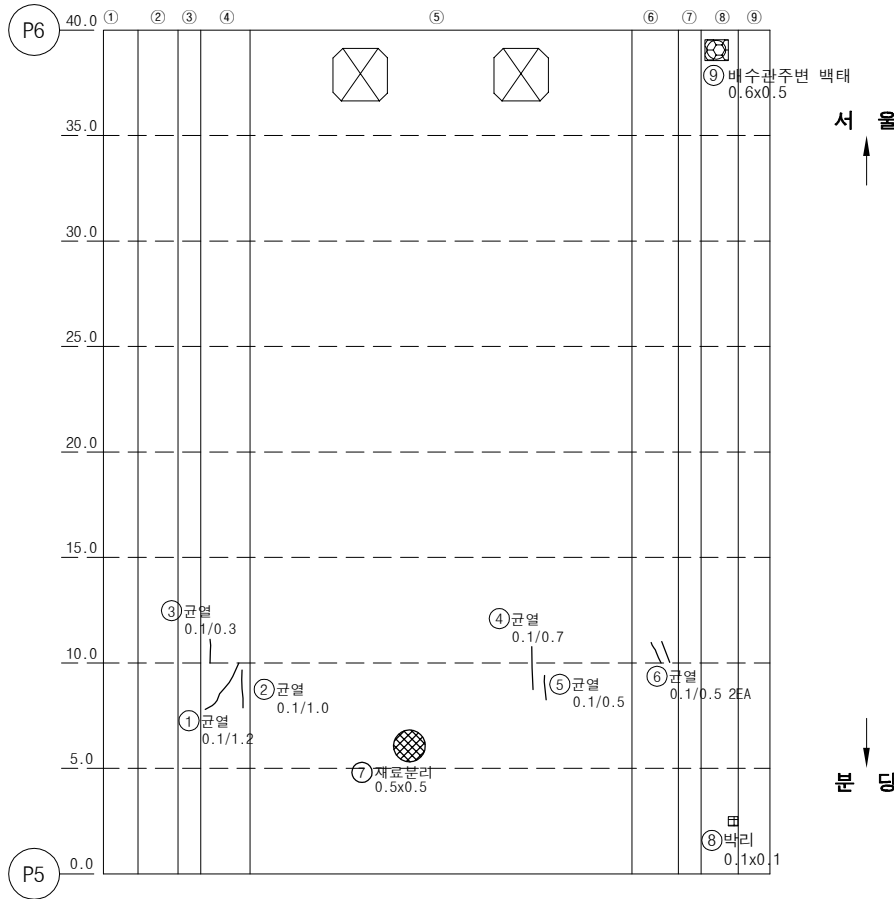

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및 결	기타	도면번호	176	


ID : 복정고가교 본선-하행선 box외부(S7)

손상물량표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	상대양호						
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

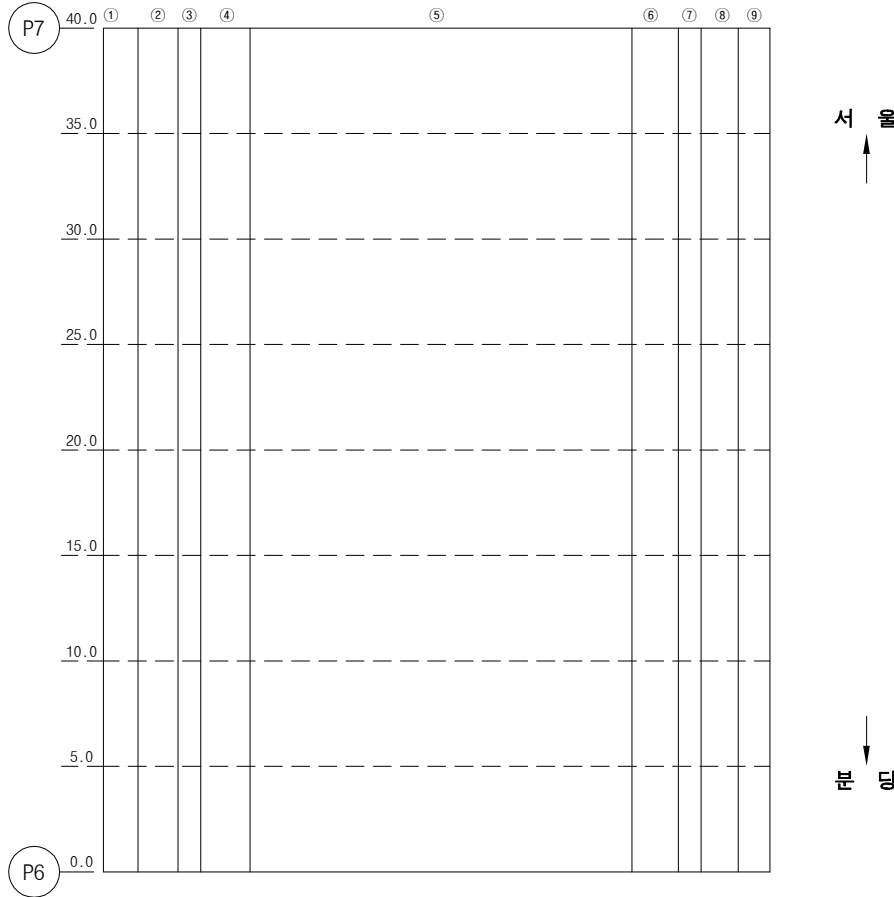

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례					조사일시	2023년 11월	
					조사자	이희송 외 17인	
					확인자	김찬구	
					도면번호	177	

ID : 복정고가교 본선-하행선 box외부(S8)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	백태	0.3	1	0.30	m ²	1	
2	파손	0.3	0.3	0.09	m ²	1	
3	재료분리	0.1	0.2	0.02	m ²	1	
4	재료분리	0.5	1	0.50	m ²	1	
5	재료분리	0.1	0.1	0.01	m ²	1	
6	재료분리	0.5	0.2	0.10	m ²	1	
7	균열(0.2mm)	0.2	2.2	2.20	m	1	
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

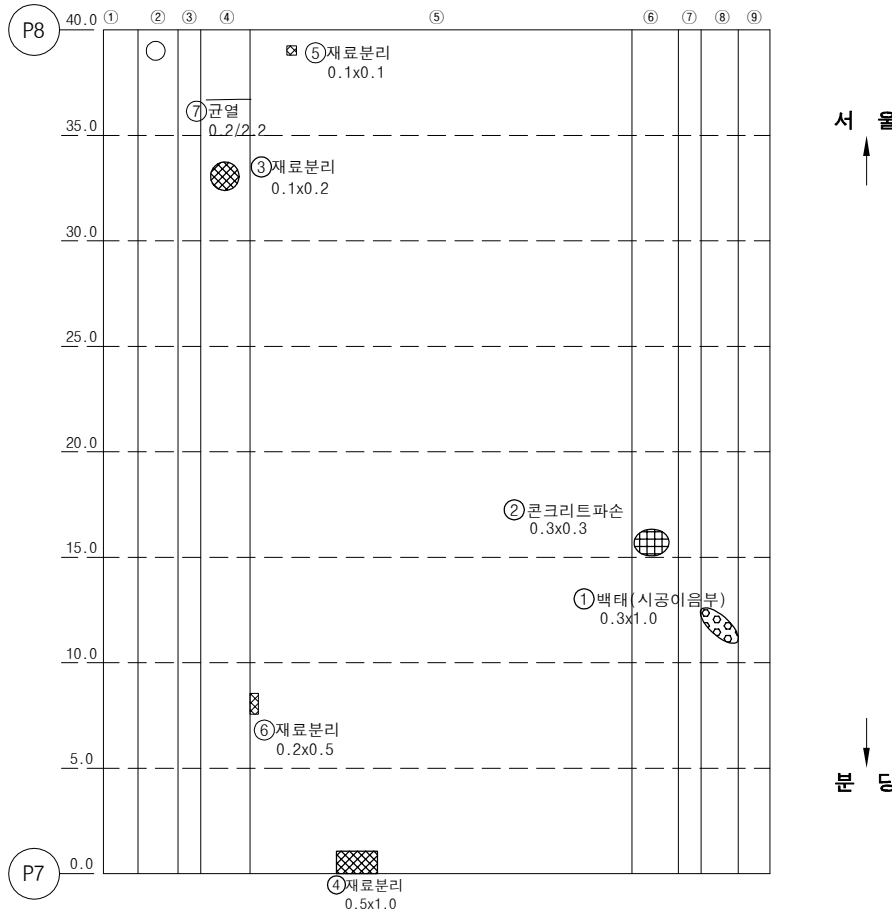

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	178	

ID : 복정고가교 본선-하행선 box외부(S9)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.5	1.3	0.65	m²	1	
2	파손	0.1	0.1	0.02	m²	2	
3	파손	0.1	0.1	0.01	m²	1	
4	균열(0.2mm)	0.2	2.2	4.40	m	2	
5	배수관누수, 백태, 부식			1	EA	1	
6	파손	0.1	0.1	0.02	m²	2	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

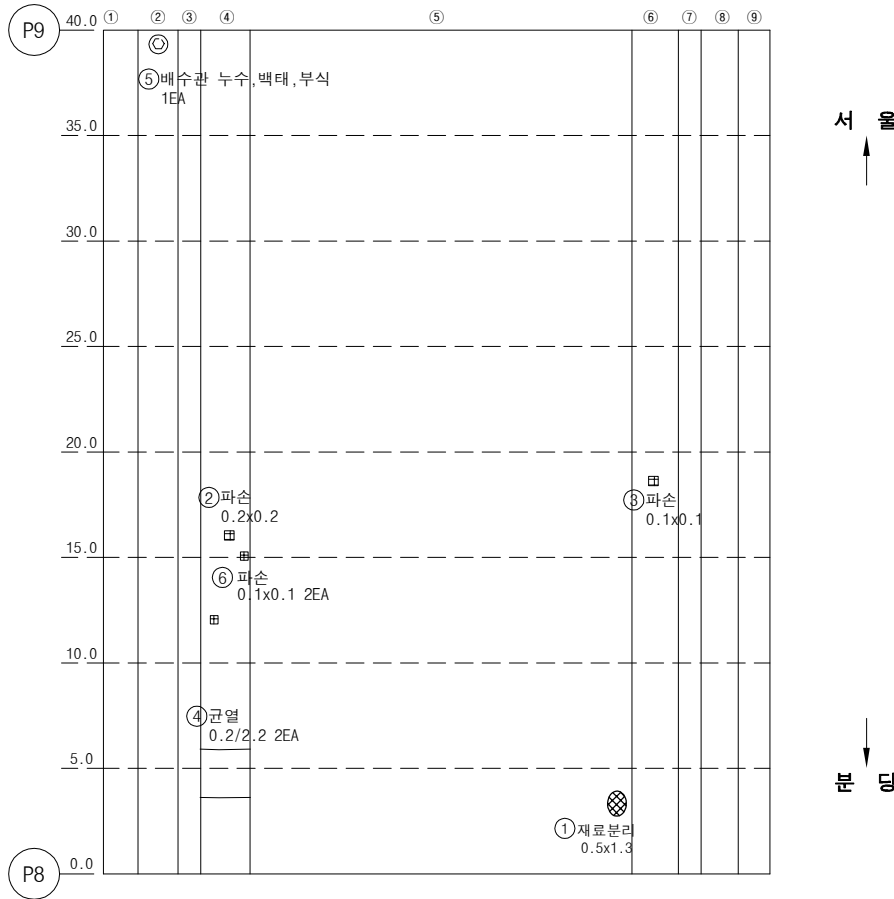

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	179	


ID : 복정고가교 본선-하행선 box외부(S10)

손 상 물 량 표

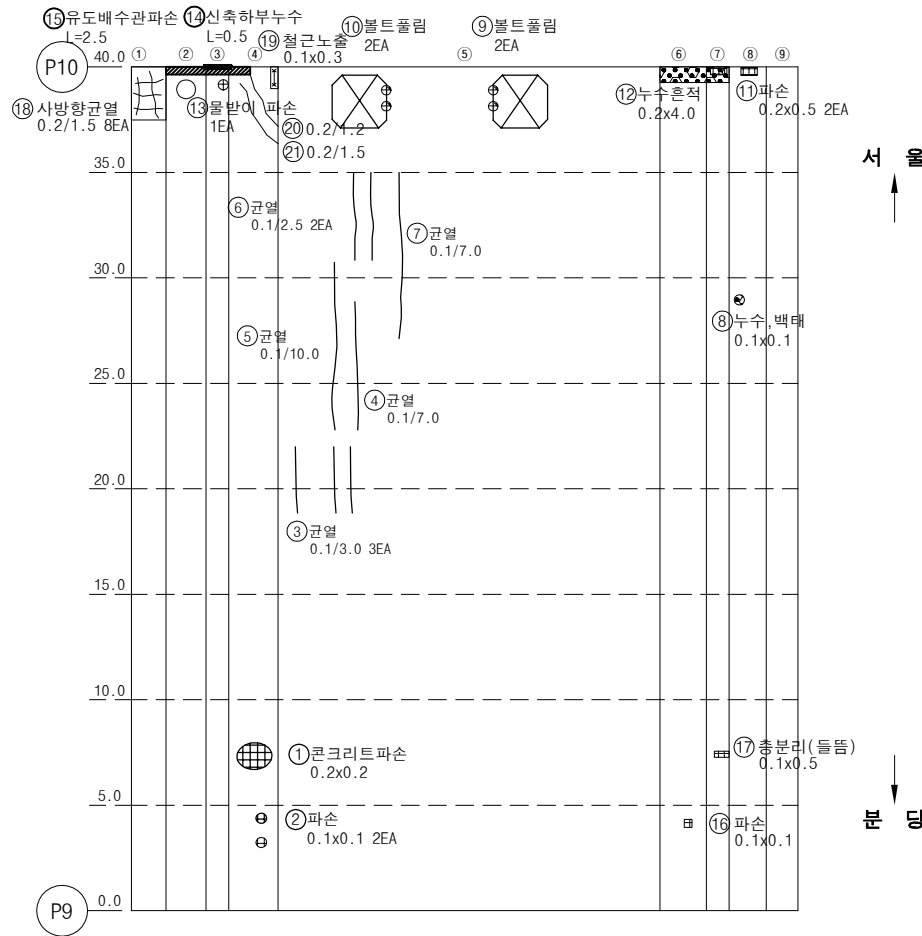


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.2	0.2	0.04	m ²	1	
2	파손	0.1	0.1	0.02	m ²	2	
3	균열(0.1mm)	0.1	3	9.00	m	3	
4	균열(0.1mm)	0.1	7	7.00	m	1	
5	균열(0.1mm)	0.1	10	10.00	m	1	
6	균열(0.1mm)	0.1	2.5	5.00	m	2	
7	균열(0.1mm)	0.1	7	7.00	m	1	
8	누수, 백태	0.1	0.1	0.01	m ²	1	
9	볼트풀림			2	EA	2	
10	볼트풀림			2	EA	2	
11	파손	0.5	0.2	0.20	m ²	2	
12	누수, 백태	4	0.2	0.80	m ²	1	
13	물받이 파손			1	EA	1	
14	신축하부누수		0.5	0.50	m	1	
15	유도배수로탈락		2.5	2.50	m	1	
16	파손	0.1	0.1	0.01	m ²	1	
17	충분리(들뜸)	0.1	0.5	0.05	m ²	1	
18	사방향균열(0.2mm)	0.2	1.5	12.00	m	8	
19	철근노출	0.1	0.3	0.03	m ²	1	
20	균열(0.2mm)	0.2	1.2	1.20	m	1	
21	균열(0.2mm)	0.2	1.5	1.50	m	1	
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	사면이동분리, 송분리	이물침투력	신축아물 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	180	


ID : 복정고가교 본선-하행선 box외부(S11)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1.5	1.50	m	1	
2	백태	0.2	0.2	0.04	m²	1	
3	박락	0.1	0.1	0.02	m²	2	
4	균열(0.2mm)	0.2	1.5	1.50	m	1	
5	균열(0.2mm)	0.2	1.5	1.50	m	1	
6	균열(0.1mm)	0.1	2.5	2.50	m	1	
7	균열(0.2mm)	0.2	4	8.00	m	2	
8	균열(0.2mm)	0.2	1.2	1.20	m	1	
9	파손	0.3	0.2	0.06	m²	1	
10	누수, 백태	4	0.2	0.80	m²	1	
11	충분리	0.1	1.5	0.15	m²	1	
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

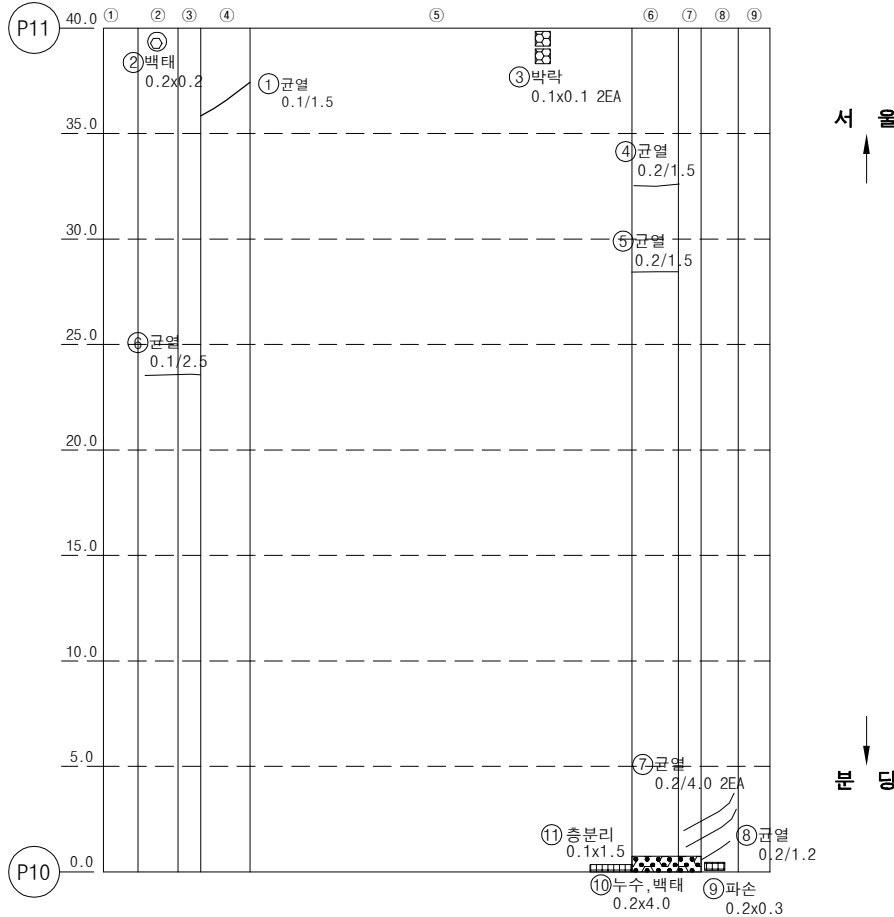

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 충분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	181	

ID : 복정고가교 본선-하행선 box외부(S12)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	2	2.00	m	1	
2	박락	1.5	0.2	0.30	m²	1	
3	파손	0.2	0.2	0.04	m²	1	
4	재료분리	0.2	1	0.20	m²	1	
5	백태	0.2	2.5	0.50	m²	1	
6	박락및철근노출	0.1	0.3	0.03	m²	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

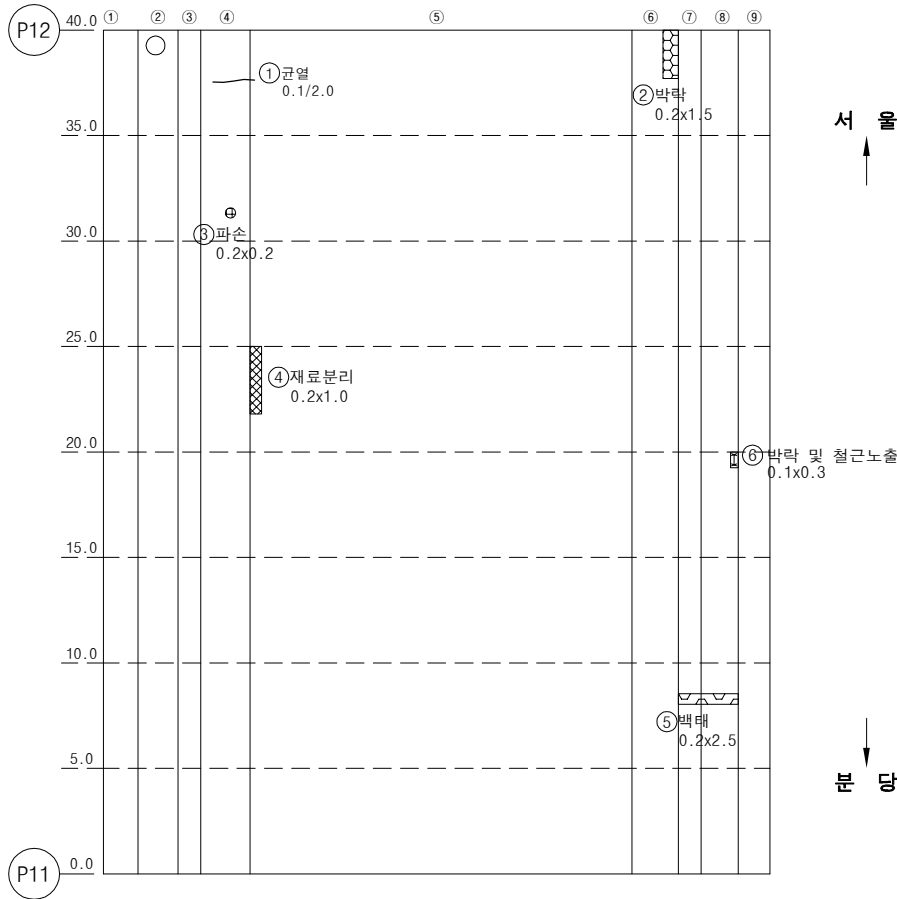

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 박락	③ 백태	④ 편위, 공동	⑤ 조사일시	2023년 11월	
	⑥ 재료분리	⑦ 철근노출	⑧ 철근부식	⑨ 좌굴, 변형	⑩ 조사자	이희송 외 17인	
	⑪ 박리, 파손	⑫ 시공이음분리, 송분리	⑬ 이물침투력	⑭ 신축이음 본체	⑮ 확인자	김 찬 구	
	⑯ 누수, 변색	⑰ 배수구	⑱ 포장의 요철	⑲ 기타	⑳ 도면번호	182	

ID : 복정고가교 본선-하행선 box외부(S13)

손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	5	5.00	m	1	
2	파손	0.2	0.2	0.04	m²	1	
3	파손	0.1	0.1	0.01	m²	1	
4	균열(0.2mm)	0.2	3.5	3.50	m	1	
5	배수구 주변 누수흔적	0.8	0.8	0.64	m²	1	
6	균열(0.2mm)	0.2	0.5	1.00	m	2	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							


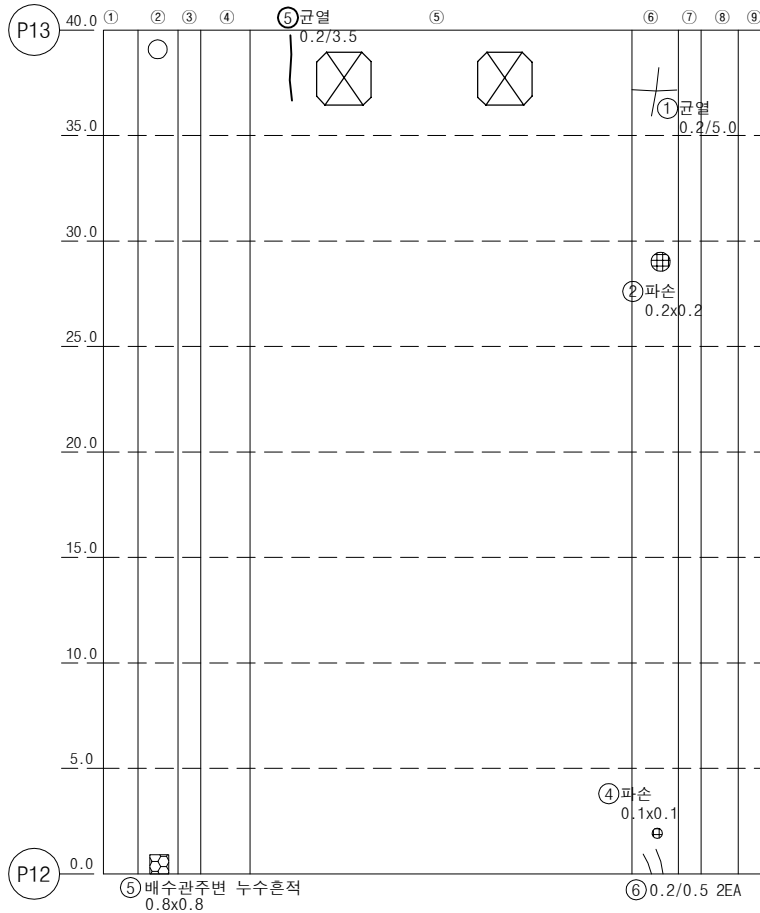


서 울

분 양

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 파손	③ 균열	④ 파손	⑤ 배수관 주변 누수흔적	⑥ 균열	조사업시
	⑦ 균열	⑧ 파손	⑨ 균열	⑩ 파손	⑪ 배수관 주변 누수흔적	⑫ 균열	2023년 11월
	⑬ 균열	⑭ 파손	⑮ 균열	⑯ 파손	⑰ 배수관 주변 누수흔적	⑱ 균열	조 사 자
	⑲ 균열	⑳ 파손	㉑ 균열	㉒ 파손	㉓ 배수관 주변 누수흔적	㉔ 균열	이희송 외 17인
면 례	㉕ 균열	㉖ 파손	㉗ 균열	㉘ 파손	㉙ 배수관 주변 누수흔적	㉚ 균열	확 인 자
	㉛ 균열	㉜ 파손	㉝ 균열	㉞ 파손	㉟ 배수관 주변 누수흔적	㊱ 균열	김 찬 구
	㊲ 균열	㊳ 파손	㊴ 균열	㊵ 파손	㊶ 배수관 주변 누수흔적	㊷ 균열	도면번호
	㊸ 균열	㊹ 파손	㊺ 균열	㊻ 파손	㊼ 배수관 주변 누수흔적	㊽ 균열	183


ID : 복정고가교 본선-하행선 box외부(S14)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	0.3	0.60	m	2	
2	균열(0.2mm)	0.2	1	1.00	m	1	
3	균열(0.2mm)	0.2	3	3.00	m	1	
4	파손	0.3	0.3	0.09	m ²	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

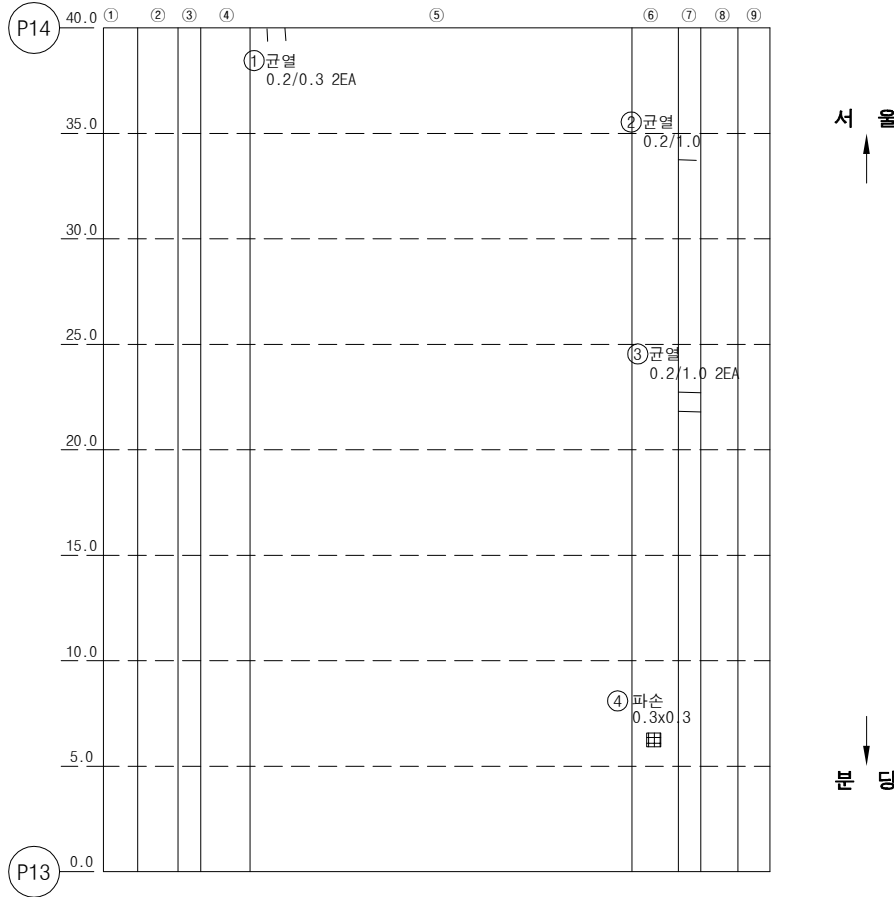

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 문제	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	184	

ID : 복정고가교 본선-하행선 box외부(S15)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.1	0.114	0.01	m'	1	
2	균열(0.2mm)	0.2	20	20.00	m	1	
3	균열(0.2mm)	0.2	2.5	2.50	m	1	
4	파손	0.1	0.1	0.01	m'	1	
5	배수관주변백태	0.3	0.6	0.18	m'	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

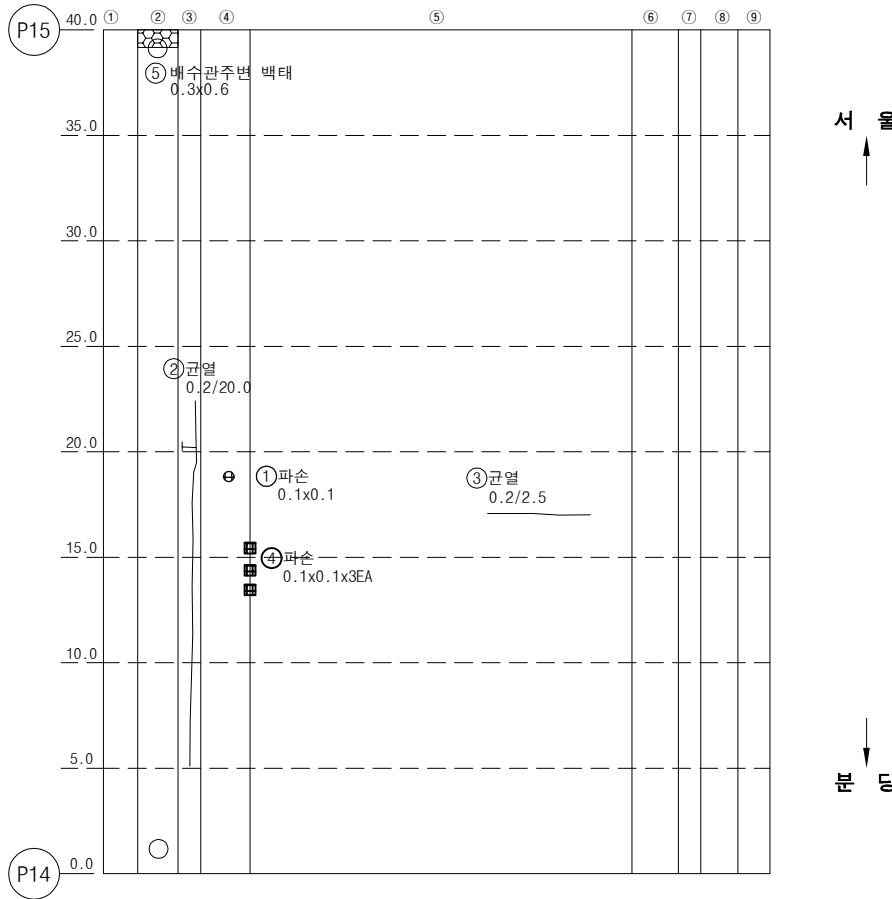

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 바리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	185	


ID : 복정고가교 본선-하행선 box외부(S16)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	3	3.00	m	1	
2	균열(0.1mm)	0.1	7	7.00	m	1	
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

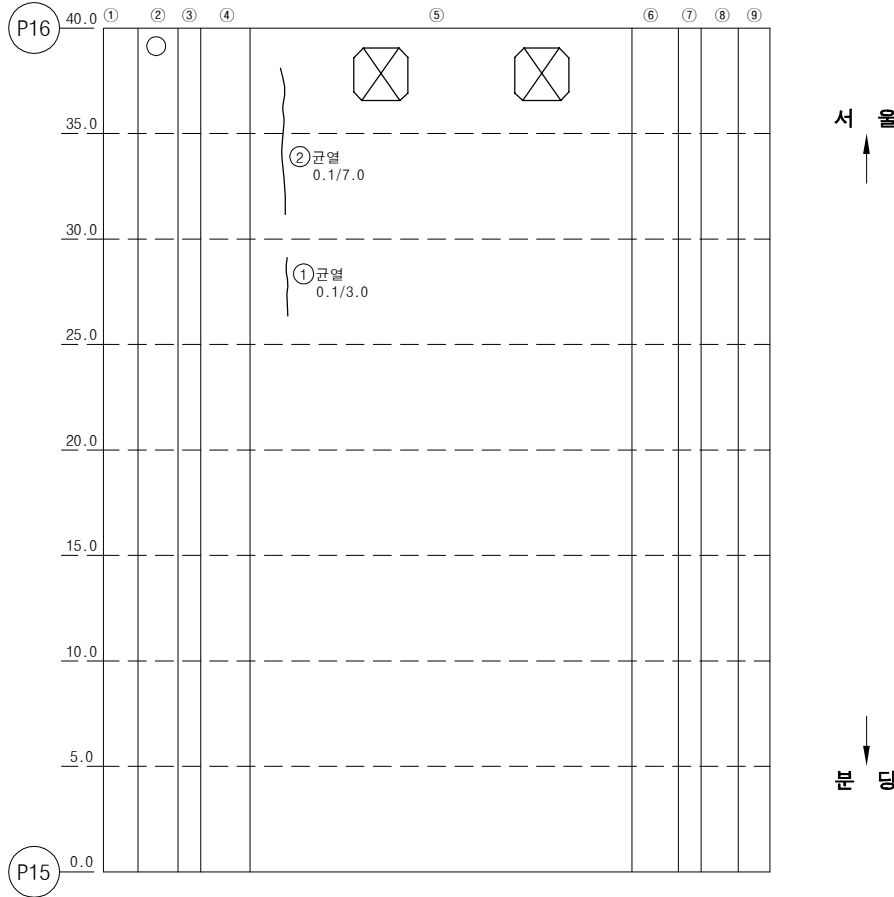

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	186	

ID : 복정고가교 본선-하행선 box외부(S17)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	그늘음	5	10.017	50.09	m²	1	
2	균열(0.1mm)	0.1	1.5	12.00	m	8	
3	누수흔적, 백태	1.5	25	37.50	m²	1	
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

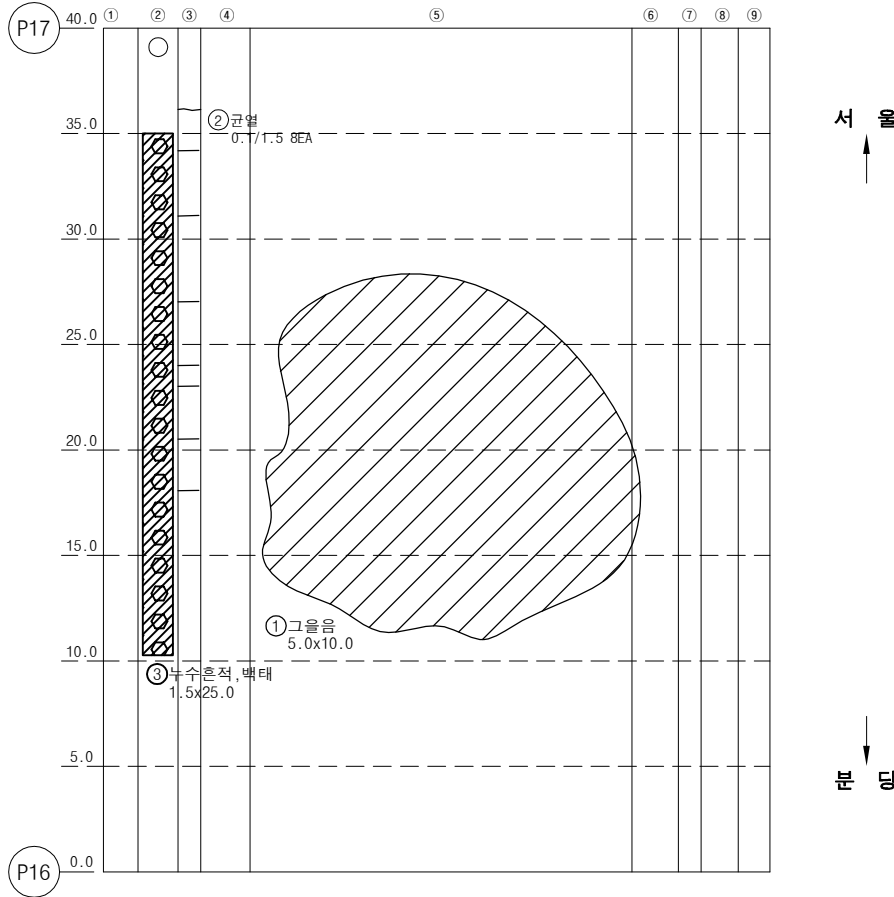

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신속여유 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	187	

ID : 복정고가교 본선-하행선 box외부(S18)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	누수흔적, 백태	3	2.019	6.06	m'	1	
2	균열(0.2mm)	0.2	5	5.00	m	1	
3	재료분리	1	0.5	0.50	m'	1	
4	균열(0.2mm)	0.2	1.5	1.50	m	1	
5	배수관누수, 백태, 부식			1	EA	1	
6	균열(0.2mm)	0.2	3	3.00	m	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

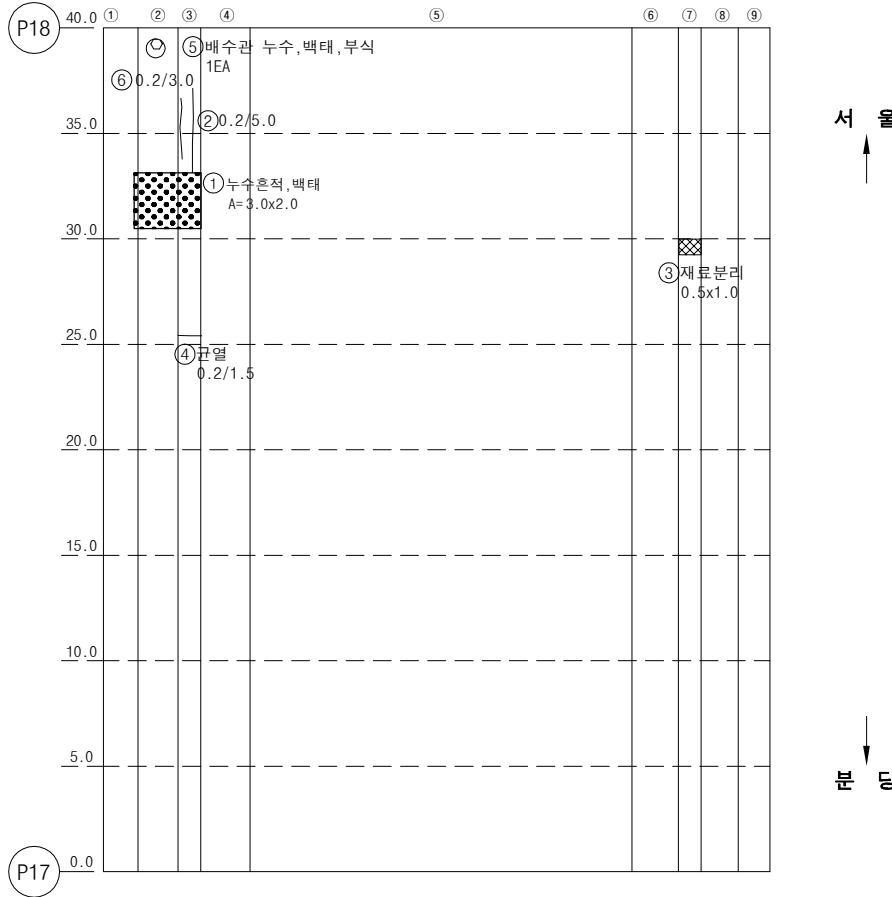

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	188	


ID : 복정고가교 본선-하행선 box외부(S19)

손상물량표

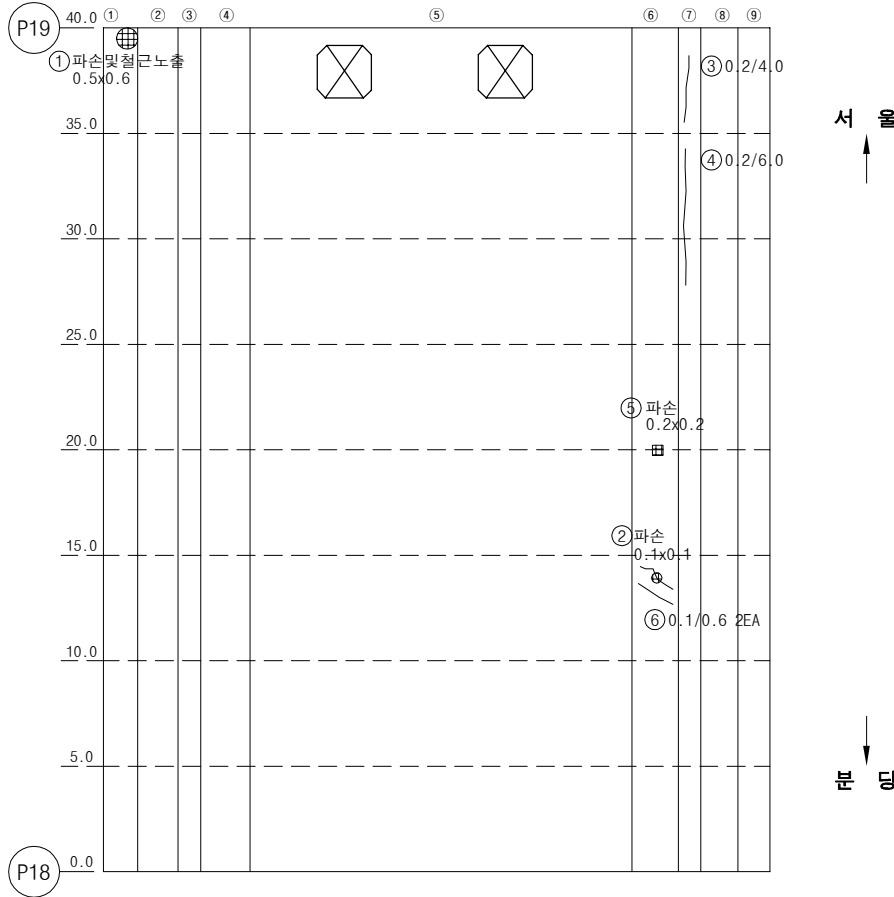


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손 및 철근노출	0.5	0.6	0.30	m ²	1	
2	파손	0.1	0.12	0.01	m ²	1	
3	균열 (0.2mm)	0.2	4	4.00	m	1	
4	균열 (0.2mm)	0.2	6	6.00	m	1	
5	파손	0.2	0.2	0.04	m ²	1	
6	균열 (0.1mm)	0.1	0.6	1.20	m	2	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	189	

ID : 복정고가교 본선-하행선 box외부(S20)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열부백태	0.2	1	1.00	m	1	
2	파손	0.3	0.3	0.09	m²	1	
3	파손	0.2	0.2	0.04	m²	1	
4	파손	0.1	0.1	0.01	m²	1	
5	파손	0.3	0.3	0.09	m²	1	
6	누수흔적, 백태	5	2	10.00	m²	1	
7	배수관주변백태, 누수, 부식	0.4	0.4	0.16	m²	1	
8	재료분리	0.3	2	0.60	m²	1	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

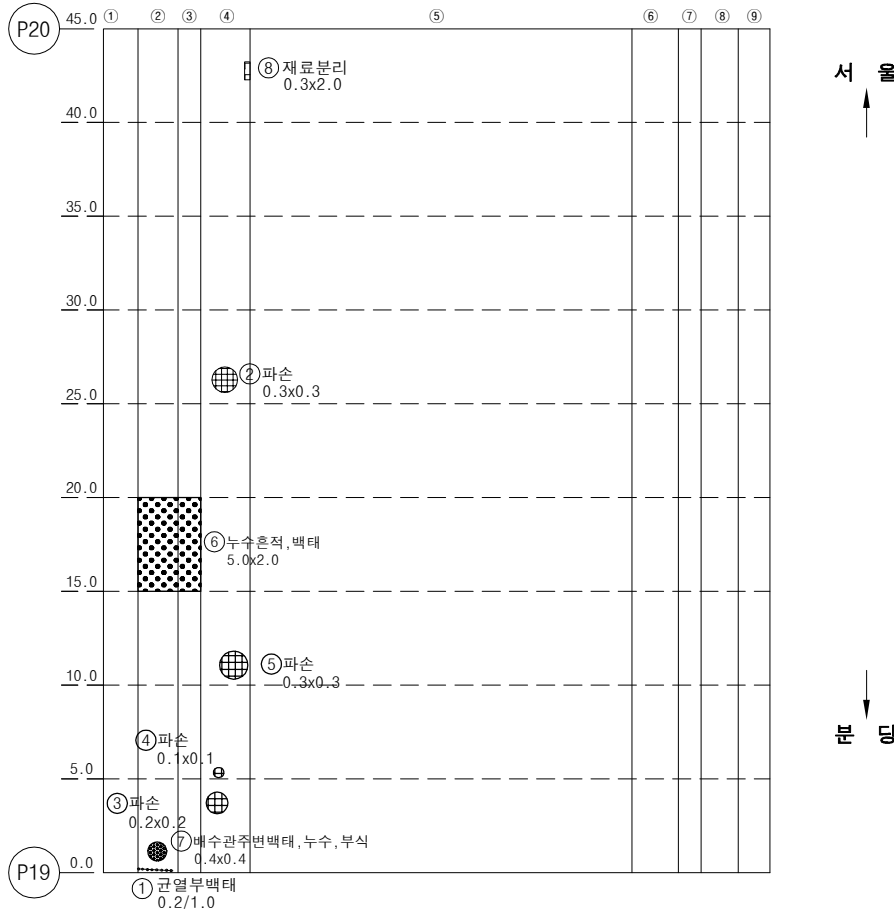

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	190	

ID : 복정고가교 본선-하행선 box외부(S21)



손 상 물 량 표

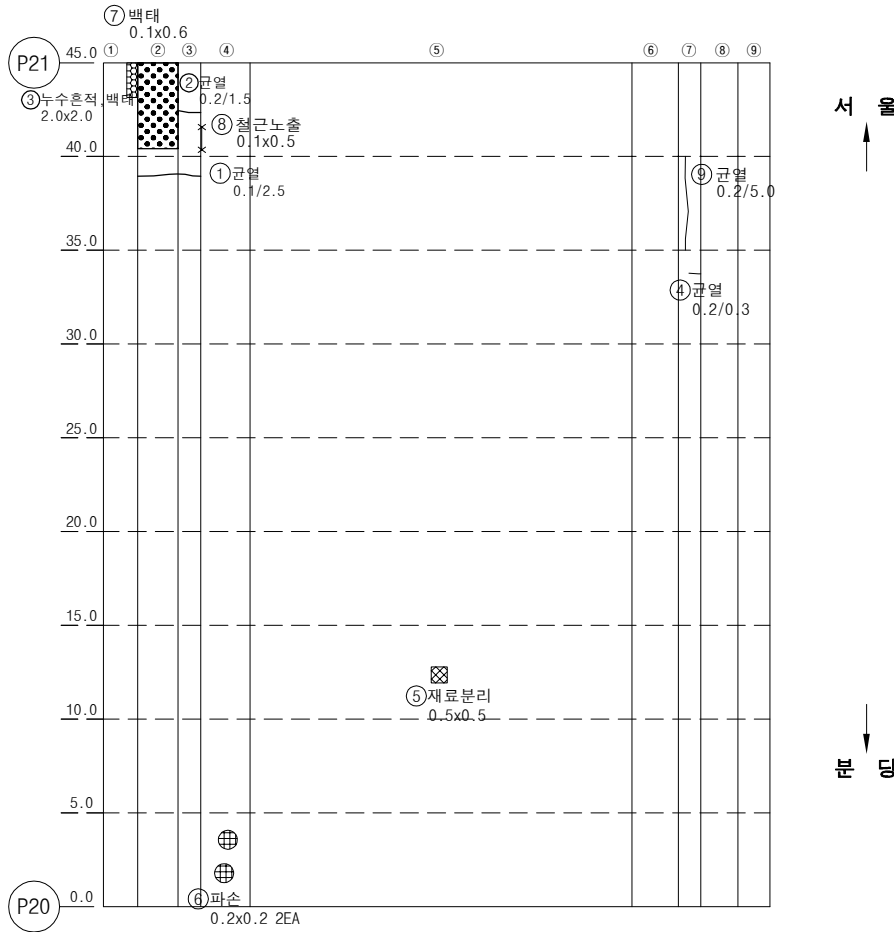

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	2.5	2.50	m	1	
2	균열(0.2mm)	0.2	1.5	1.50	m	1	
3	누수흔적, 백태	2	2.029	4.06	m ²	1	
4	균열(0.2mm)	0.2	0.3	0.30	m	1	
5	재료분리	0.5	0.5	0.25	m ²	1	
6	파손	0.2	0.2	0.08	m ²	2	
7	백태	0.1	0.6	0.06	m ²	1	
8	철근노출	0.1	0.5	0.05	m ²	1	
9	균열(0.2mm)	0.2	5	5.00	m	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 바리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물유입	⑫ 신축이음 문제	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	191	

ID : 복정고가교 본선-하행선 box외부(S22)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	0.8	0.80	m	1	
2	균열(0.1mm)	0.1	0.3	0.30	m	1	
3	균열(0.2mm)	0.2	2	4.00	m	2	
4	균열(0.2mm)	0.2	1	2.00	m	2	
5	철근노출	0.1	0.5	0.05	m ²	1	
6	신축하부누수		14	14.00	m	1	
7	유도배수로파손		2	2.00	m	1	
8	층분리	0.3	0.5	0.15	m ²	1	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

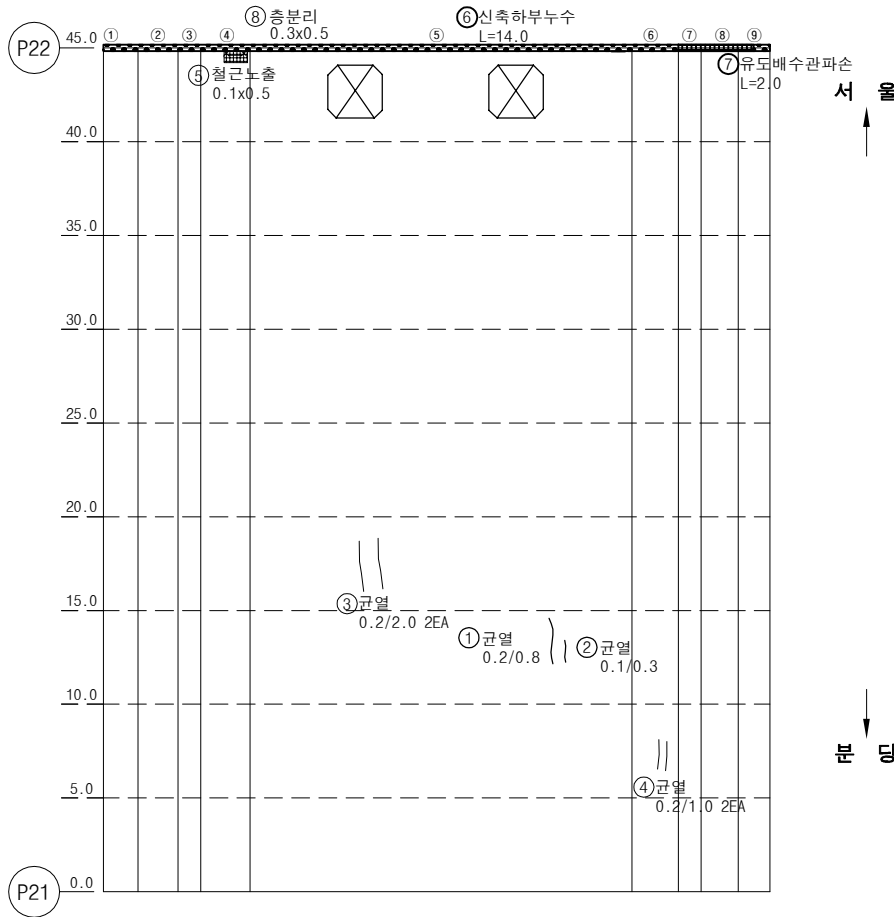

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 층분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	192	

ID : 복정고가교 본선-하행선 box외부(S23)



손상물량표

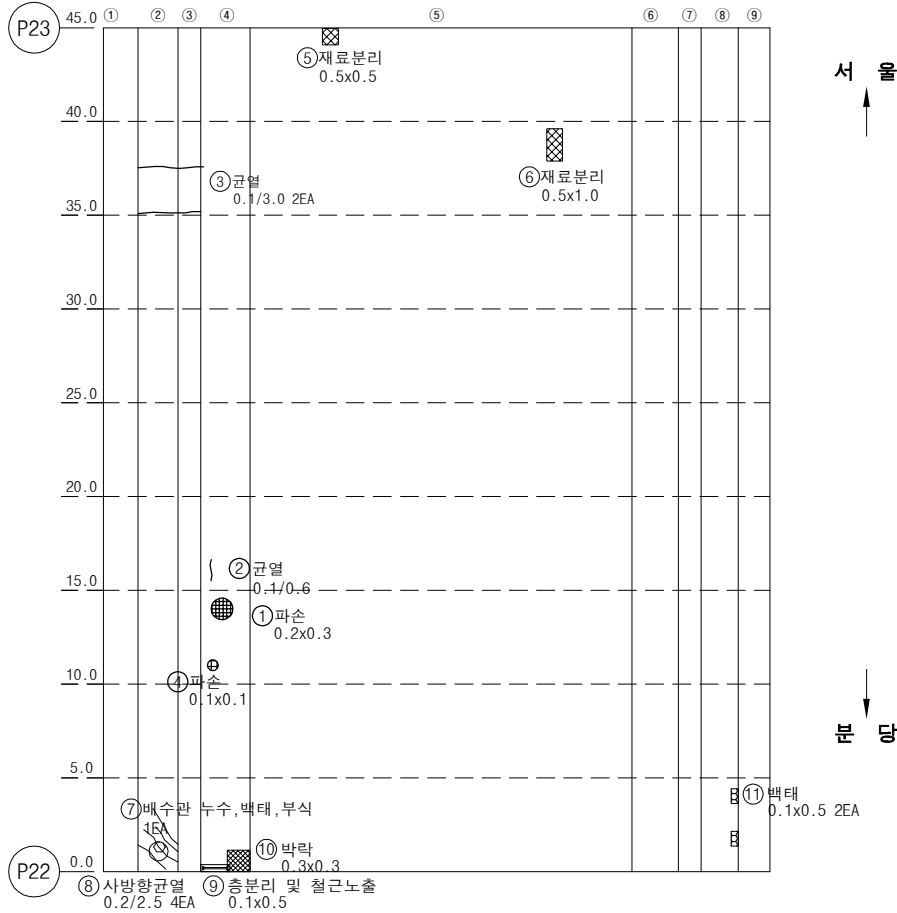

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	파손	0.2	0.3	0.06	m ²	1	
2	균열(0.1mm)	0.1	0.6	0.60	m	1	
3	균열(0.1mm)	0.1	3	6.00	m	2	
4	파손	0.1	0.1	0.01	m ²	1	
5	재료분리	0.5	0.5	0.25	m ²	1	
6	재료분리	1	0.5	0.50	m ²	1	
7	배수관누수, 백태, 부식			1	EA	1	
8	사방향균열(0.2mm)	0.2	2.5	10.00	m	4	
9	층분리 및 철근노출	0.1	0.5	0.05	m ²	1	
10	박락	0.3	0.3	0.09	m ²	1	
11	백태	0.1	0.5	0.10	m ²	2	
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박락, 파손	시공이음분리, 층분리	이물열매력	신축이음 본체	확인자	김찬구	
	누수, 변색	배수구	포장파괴 요철	기타	도면번호	193	

ID : 복정고가교 본선-하행선 box외부(S24)



손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	1.2	1.20	m	1	
2	균열(0.2mm)	0.2	0.8	0.80	m	1	
3	균열(0.2mm)	0.2	1.2	2.40	m	2	
4	균열(0.2mm)	0.2	0.8	2.40	m	3	
5	균열(0.2mm)	0.2	1	1.00	m	1	
6	균열(0.2mm)	0.2	0.8	0.80	m	1	
7	균열(0.2mm)	0.2	0.5	0.50	m	1	
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

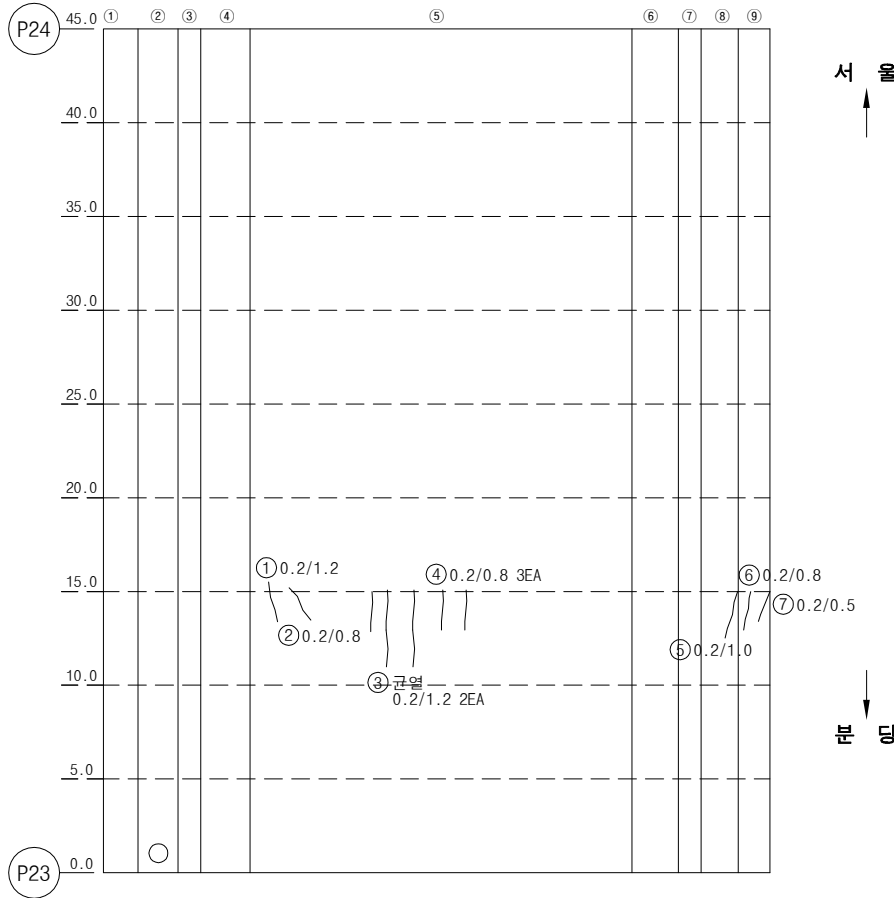

KEY PLAN

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례					조사일시	2023년 11월	
					조사자	이희송 외 17인	
					확인자	김 찬 구	
					도면번호	194	

ID : 복정고가교 본선-하행선 box외부(S25)



손상물량표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	배수관부식, 파손			1	EA	1	
2							
3							
4							
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

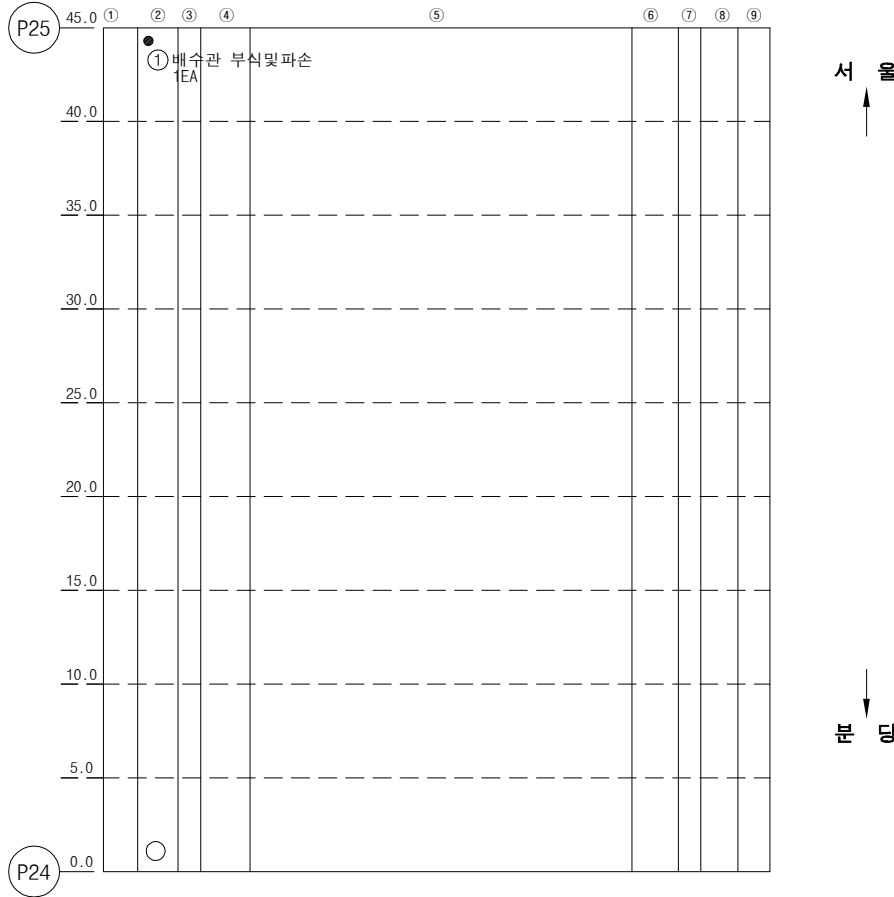

KEY PLAN


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	균열	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이음열외력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장의 요철	기타	도면번호	195	


ID : 복정고가교 본선-하행선 box외부(S26)

손 상 물 량 표

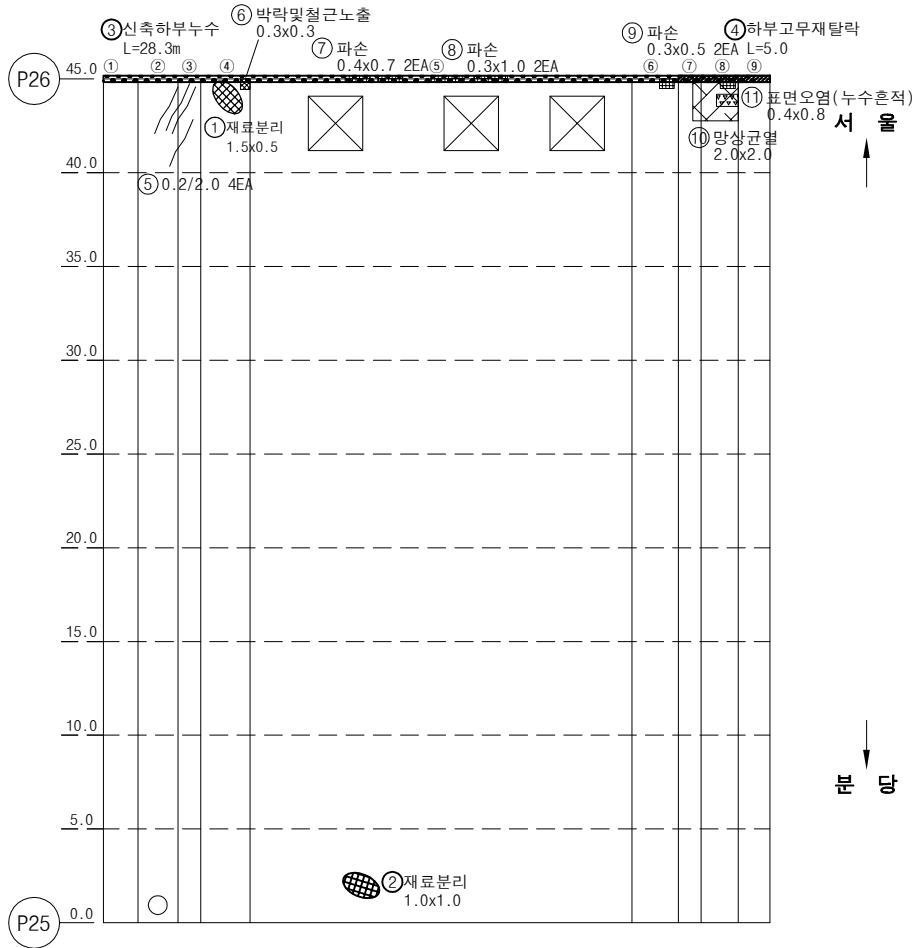


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	1.5	0.5	0.75	m ²	1	
2	재료분리	1	1	1.00	m ²	1	
3	신축하부누수		28.3	28.30	m	1	
4	하부고무재탈락		5	5.00	m	1	
5	균열(0.2mm)	0.2	2	8.00	m	4	
6	박락및철근노출	0.3	0.3	0.09	m ²	1	
7	파손	0.4	0.7	0.56	m ²	2	
8	파손	0.3	1	0.60	m ²	2	
9	파손	0.3	0.5	0.30	m ²	2	
10	망상균열	2	2	4.00	m ²	1	
11	누수흔적	0.4	0.8	0.32	m ²	1	
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN



SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	망상균열	박락	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	196	

ID : 복정고가교 본선-하행선 box외부(S27)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.4	0.80	m	2	
2	균열(0.1mm)	0.1	0.5	0.50	m	1	
3	균열(0.1mm)	0.1	0.7	0.70	m	1	
4	균열(0.1mm)	0.1	1	2.00	m	2	
5	균열(0.1mm)	0.1	1.5	1.50	m	1	
6	균열(0.1mm)	0.1	2.7	2.70	m	1	
7	균열(0.1mm)	0.1	1.1	1.10	m	1	
8	균열(0.1mm)	0.1	3	3.00	m	1	
9	균열(0.1mm)	0.1	0.6	0.60	m	1	
10	균열(0.1mm)	0.1	1	1.00	m	1	
11	균열(0.1mm)	0.1	3	3.00	m	1	
12	균열(0.1mm)	0.1	1	1.00	m	1	
13	배수관 주변 백태	0.3	0.3	0.09	m ²	1	
14	파손	0.4	0.4	0.16	m ²	1	
15	균열(0.2mm)	0.2	16	16.00	m	1	
16	파손	0.3	0.5	0.15	m ²	1	
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

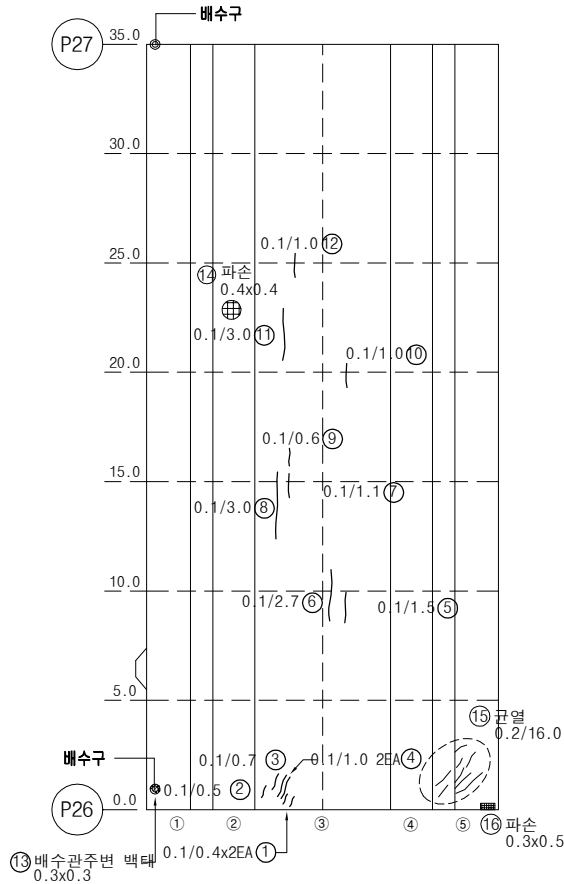


서
울

분
담

KEY PLAN

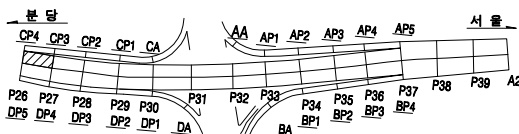


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이용분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및	기타	도면번호	197	


ID : 복정고가교 본선-하행선 box외부(S28)

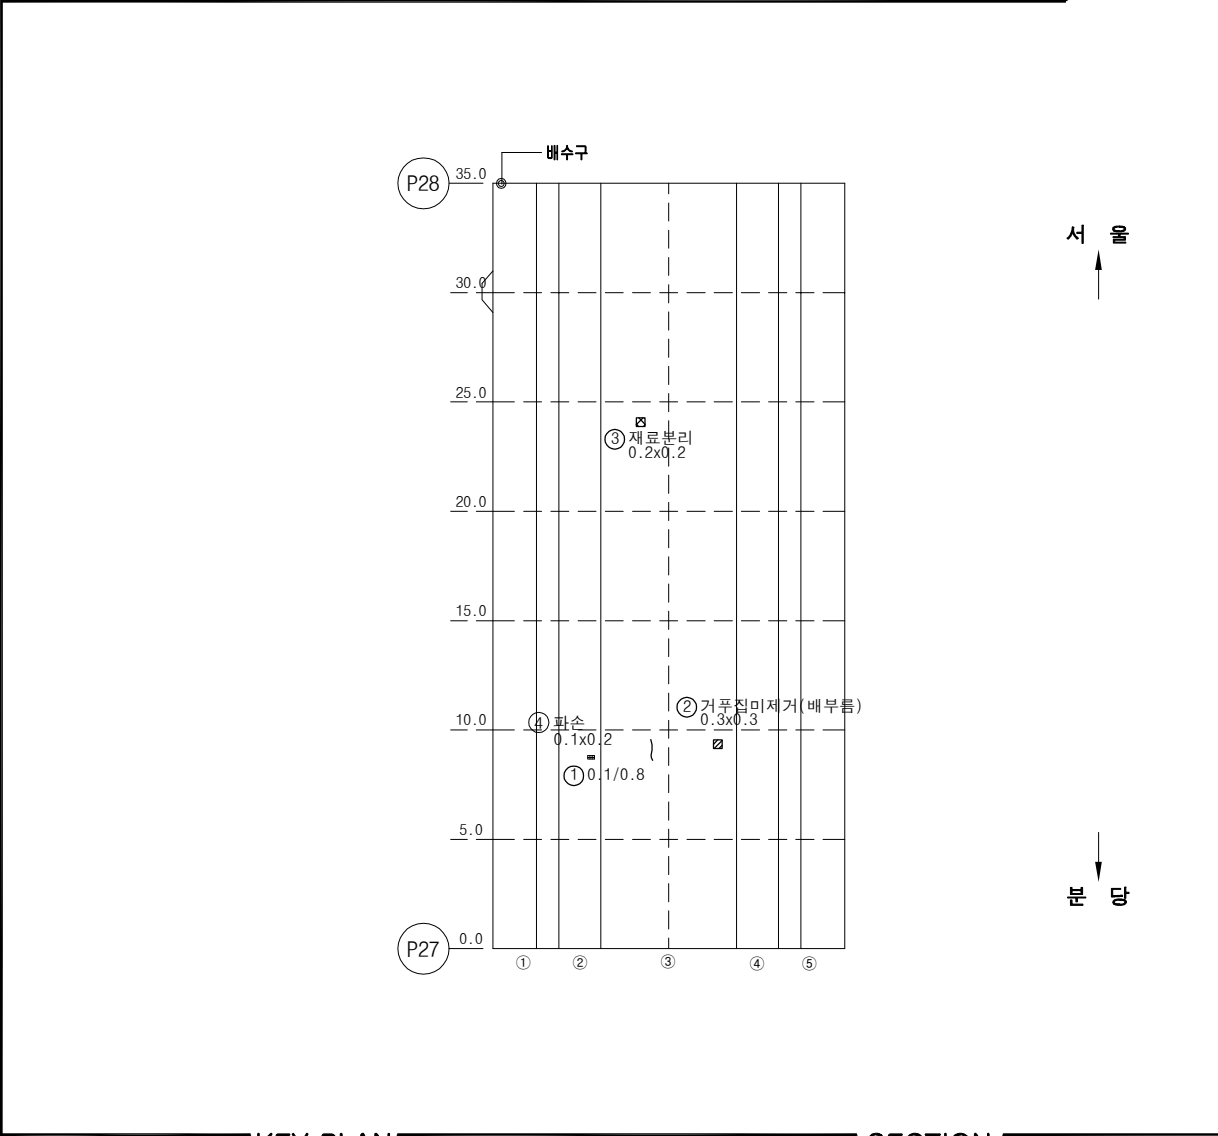


손 상 물 량 표

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.8	0.80	m	1	
2	거푸집미제거	0.3	0.3	0.09	m²	1	
3	재료분리	0.2	0.2	0.04	m³	1	
4	파손	0.1	0.2	0.02	m³	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

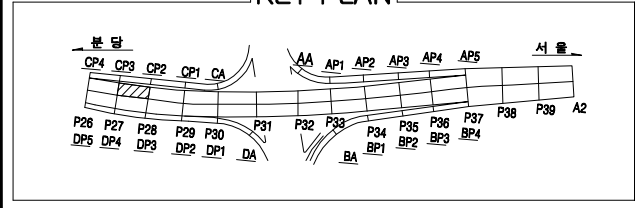


SECTION

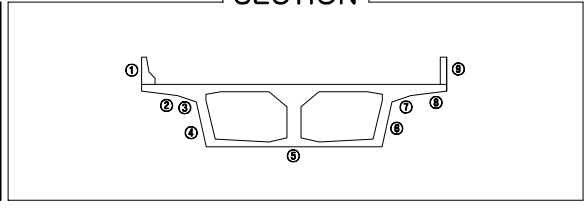

용 의 명		2023년 하반기 복정고가고 정밀안전진단 용역					
면	 국 도	 영 상국 도	 백 대	 전 정, 공 동	조 사 일 시	2023년 11월	
	 제 료본 리	 철 근노 출	 철 근부 시	 좌 굴, 변 형	조 사 자	이희송 외 17인	
례	 바 리, 파 손	 사 용이용본 리, 송 본 리	 이 용굴 하 역	 선 속여 승 본 제	확 인 자	김 찬 구	
	 누 수, 변 색	 배 수 구	 포 장의 요 결	 기 타	도 면번호	198	

ID : 복정고가교 본선-하행선 box외부(S29)

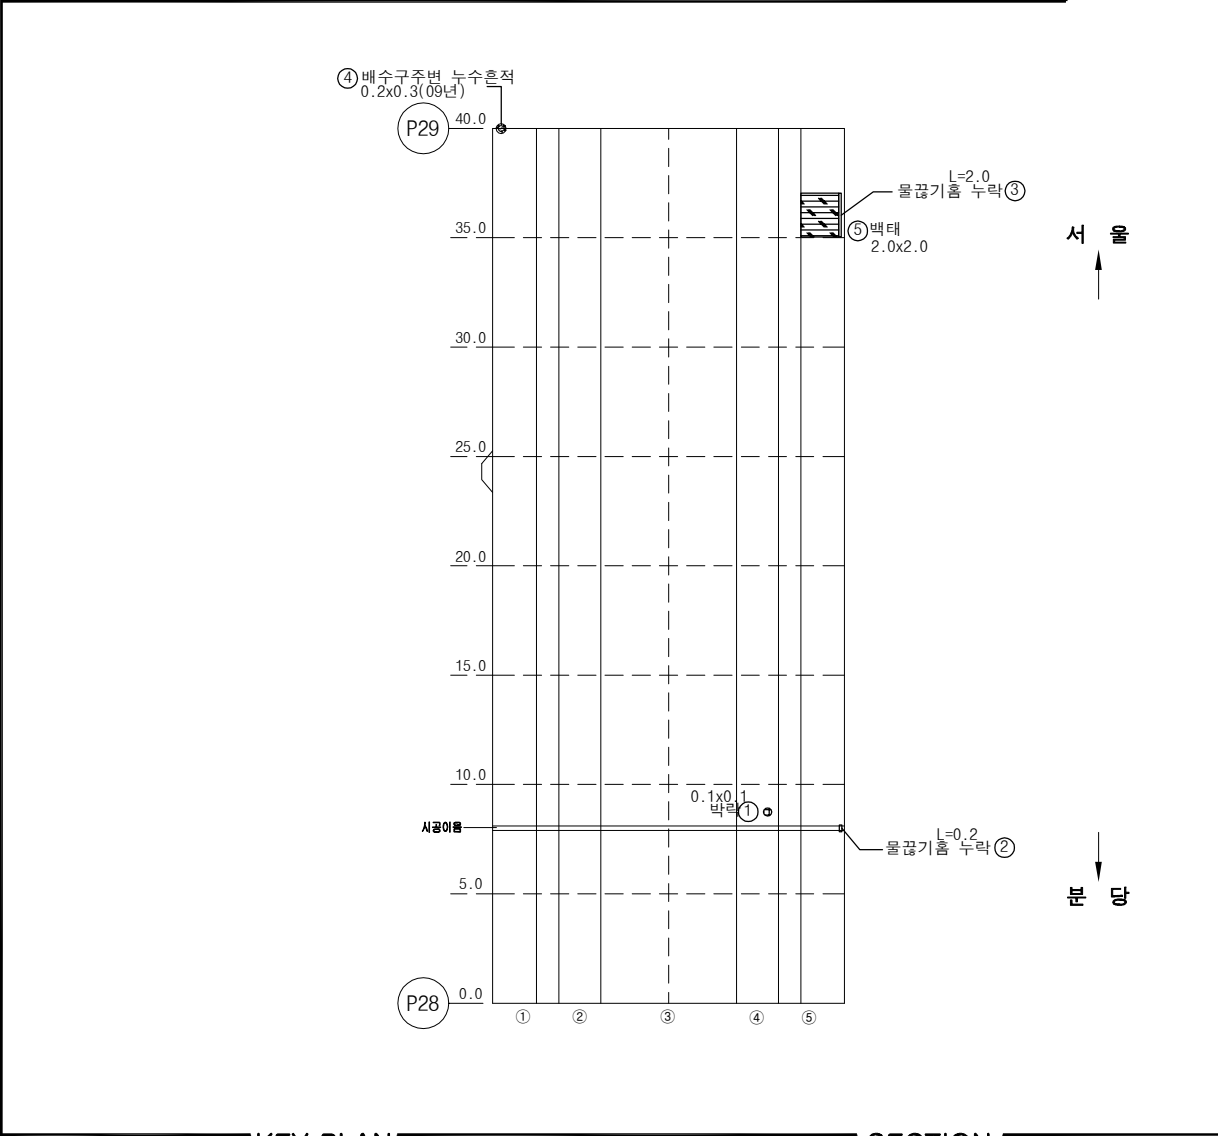

ID : 복정고가교 본선-하행선 box외부(S29)	손 상 물 량 표
------------------------------	-----------

번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	박락	0.1	0.1	0.01	m²	1	
2	물끓기흙누락		0.2	1.00	EA	1	
3	물끓기흙누락		2	1.00	EA	1	
4	배수구 주변 누수 흔적	0.3	0.2	0.06	m²	1	
5	백태	2	2	4.00	m²	1	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

The key plan shows a road layout with stationing from 0+00 to 1+900. The road has a centerline and lane markings. Key features include:

- Stationing:** 0+00, 0+100, 0+200, 0+300, 0+400, 0+500, 0+600, 0+700, 0+800, 0+900, 1+000, 1+100, 1+200, 1+300, 1+400, 1+500, 1+600, 1+700, 1+800, 1+900.
- Intersections:**
 - At station 0+300, the road intersects with a road labeled "분당" (Bundang) running north-south. The intersection is marked with a cross and the label "CA".
 - At station 0+600, the road intersects with a road labeled "AA" running north-south. The intersection is marked with a cross and the label "AA".
 - At station 1+100, the road intersects with a road labeled "BA" running north-south. The intersection is marked with a cross and the label "BA".
- Other Labels:**
 - "서울" (Seoul) is written at the right end of the road.
 - Various lane markings and labels are present, including "P26", "P27", "P28", "P29", "P30", "P31", "P32", "P33", "P34", "P35", "P36", "P37", "P38", "P39", "A2", "DP5", "DP4", "DP3", "DP2", "DP1", "DA", "AP1", "AP2", "AP3", "AP4", "AP5", "BP1", "BP2", "BP3", "BP4".

SECTION


A cross-sectional diagram of a bridge deck. The diagram shows a wide top flange with a central vertical web and two side webs. The top flange is labeled with 1 on the left and 9 on the right. The central web is labeled with 2 on the left and 7 on the right. The side webs are labeled with 3 on the left and 8 on the right. The bottom of the central web is labeled with 4 on the left and 6 on the right. The bottom of the side webs is labeled with 5 on the left and 6 on the right.

용역명		2023년 하반기 복정고가고 정밀안전진단 용역					
표 례	 균열	 망상균열	 박락	 편청, 공동	조사일시	2023년 11월	
	 재료분리	 풀근노출	 풀근부식	 부패, 변형	조 사 자	이희송 외 17인	
	 박리, 파손	 시공이음분리, 중분리	 이음균열/균열	 선속이음 본체	확 인 자	김 찬 구	
	 누수, 변형	 배수구	 포장의 요철	 기타	도면번호	199	


ID : 복정고가교 본선-하행선 box외부(S30)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.5	0.149	0.07	m ²	1	
2	물끊기흙누락		0.1	1.00	EA	1	
3	균열(0.1mm)	0.1	0.3	0.30	m	1	
4	박락	0.1	0.2	0.02	m ²	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

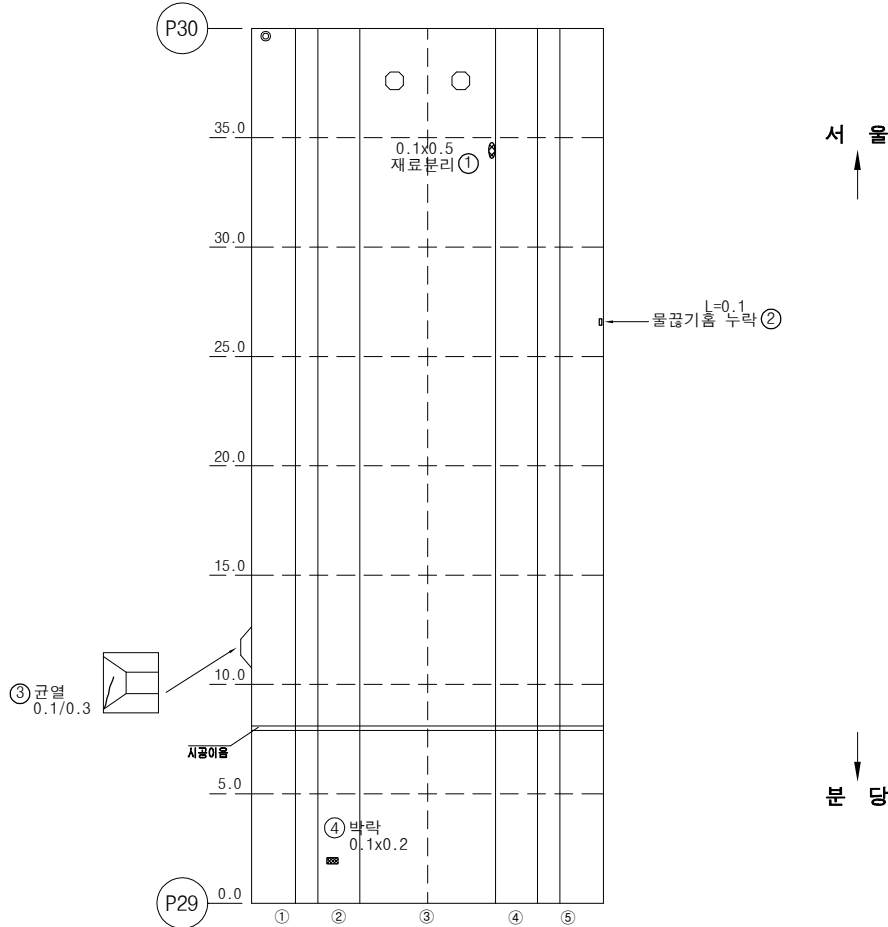

KEY PLAN

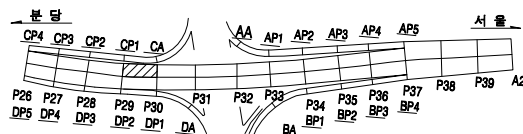


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	박리, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	200	


ID : 복정고가교 본선-하행선 box외부(S31)

손상물량표

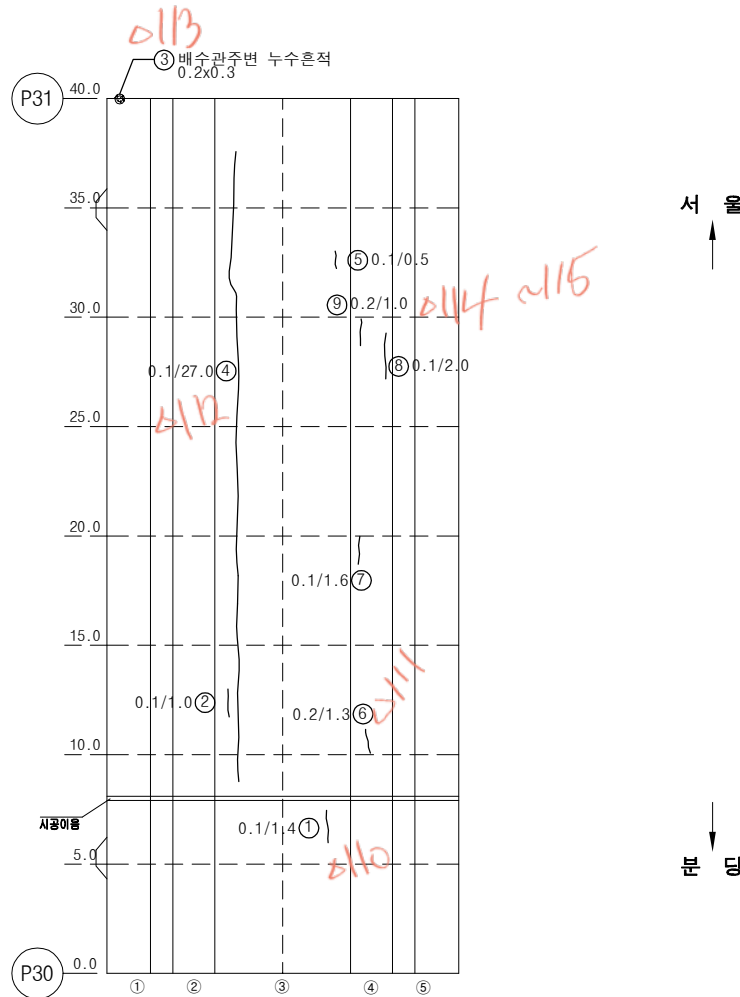


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1.4	1.40	m	1	
2	균열(0.1mm)	0.1	1	1.00	m	1	
3	배수관 주변 누수흔적	0.3	0.25	0.08	m ²	1	
4	균열(0.1mm)	0.1	27	27.00	m	1	
5	균열(0.1mm)	0.1	0.5	0.50	m	1	
6	균열(0.2mm)	0.2	1.3	1.30	m	1	
7	균열(0.1mm)	0.1	1.6	1.60	m	1	
8	균열(0.1mm)	0.1	2	2.00	m	1	
9	균열(0.2mm)	0.2	1	1.00	m	1	
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

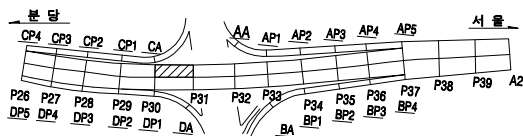


SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송판리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장의 요철	기타	도면번호	201	


ID : 복정고가교 본선-하행선 box외부(S32)

손 상 물 량 표

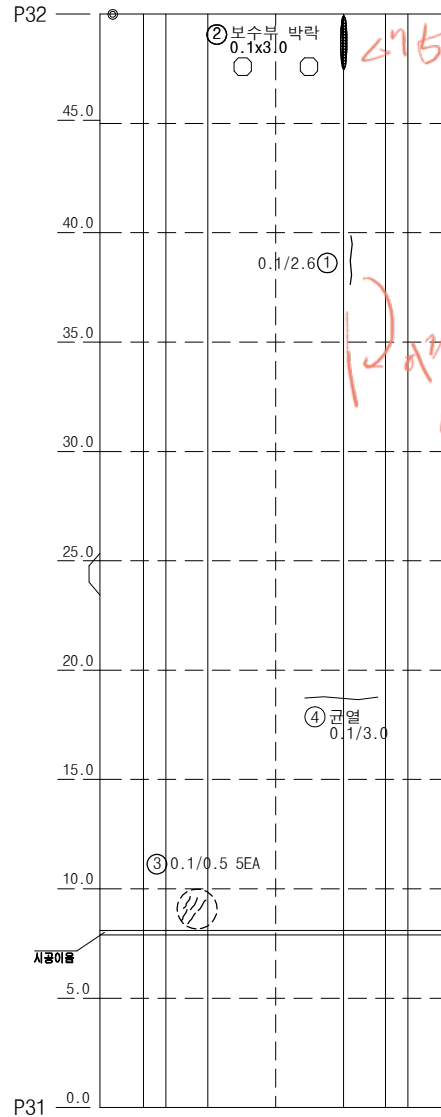


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	2.6	2.60	m	1	
2	보수부박락	3	0.1	0.30	m ²	1	
3	균열(0.1mm)	0.1	0.5	2.50	m	5	
4	균열(0.1mm)	0.1	3	3.00	m	1	
5							
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

KEY PLAN

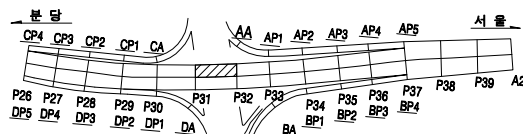

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
범 례	① 균열	② 광상균열	③ 벽면	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 박리, 파손	⑩ 시공이음분리, 송분리	⑪ 이물침투력	⑫ 신축이음 문제	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	202	


ID : 복정고가교 본선-하행선 box외부(S33)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	0.6	0.60	m	1	
2	균열(0.1mm)	0.1	0.7	0.70	m	1	
3	균열(0.1mm)	0.1	2.5	2.50	m	1	
4	균열(0.1mm)	0.1	2.8	2.80	m	1	
5	균열(0.1mm)	0.1	0.9	0.90	m	1	
6	균열(0.1mm)	0.1	1	1.00	m	1	
7	균열(0.1mm)	0.1	0.6	0.60	m	1	
8	균열(0.1mm)	0.1	1.4	1.40	m	1	
9	균열(0.1mm)	0.1	1.6	1.60	m	1	
10	균열(0.1mm)	0.1	2.8	2.80	m	1	
11	균열(0.1mm)	0.1	2	2.00	m	1	
12	균열(0.1mm)	0.1	1	2.00	m	2	
13	균열(0.1mm)	0.1	0.8	0.80	m	1	
14	보수부망상균열	0.6	0.1	0.06	m²	1	
15	보수부망상균열	0.7	0.4	0.28	m²	1	
16	보수부재균열(0.1mm)	0.1	0.6	0.60	m	1	
17	보수부재균열(0.1mm)	0.1	1.4	1.40	m	1	
18	보수부재균열(0.1mm)	0.1	0.9	3.60	m	4	
19	보수부재균열(0.1mm)	0.1	2	2.00	m	1	
20	균열(0.1mm)	0.1	1.5	1.50	m	1	
21	균열부백태	0.2	0.3	0.30	m	1	
22	균열(0.1mm)	0.1	0.3	0.30	m	1	
23	균열(0.1mm)	0.1	1.4	1.40	m	1	
24	균열(0.2mm)	0.2	3.9	3.90	m	1	
25	균열(0.2mm)	0.2	1.8	3.60	m	2	
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

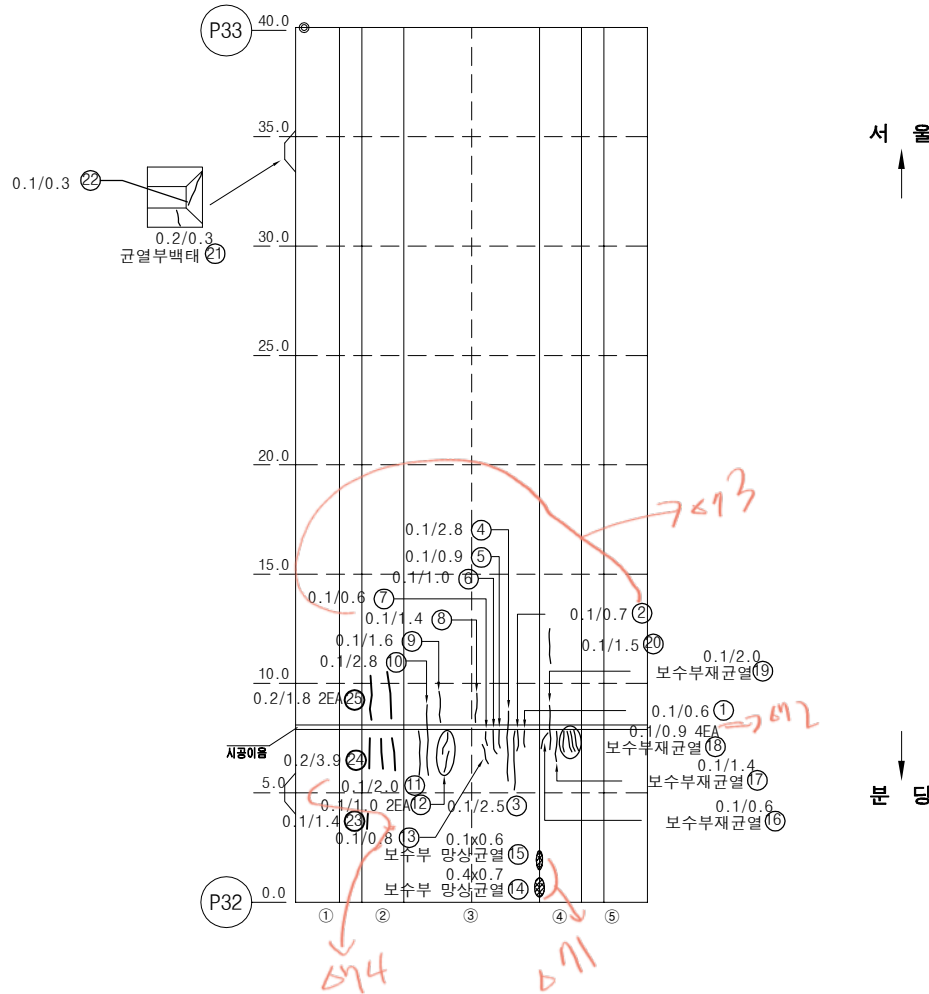

KEY PLAN

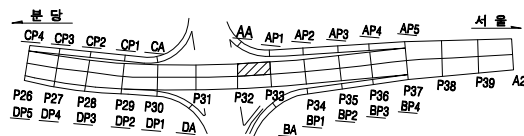

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	망상균열	백태	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송판리	이물침투력	신축이음 본래	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및	기타	도면번호	203	

ID : 복정고가교 본선-하행선 box외부(S34)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	재료분리	0.8	0.1	0.08	m ²	1	
2	재료분리	0.6	0.1	0.12	m ²	2	
3	재료분리	1.2	0.7	0.84	m ²	1	
4	파손	0.2	0.2	0.04	m ²	1	
5	균열(0.1mm)	0.1	1	4.00	m	4	
6	배수관부식			1	EA	1	
7	배수관 주변 누수흔적	0.2	0.3	0.06	m ²	1	
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

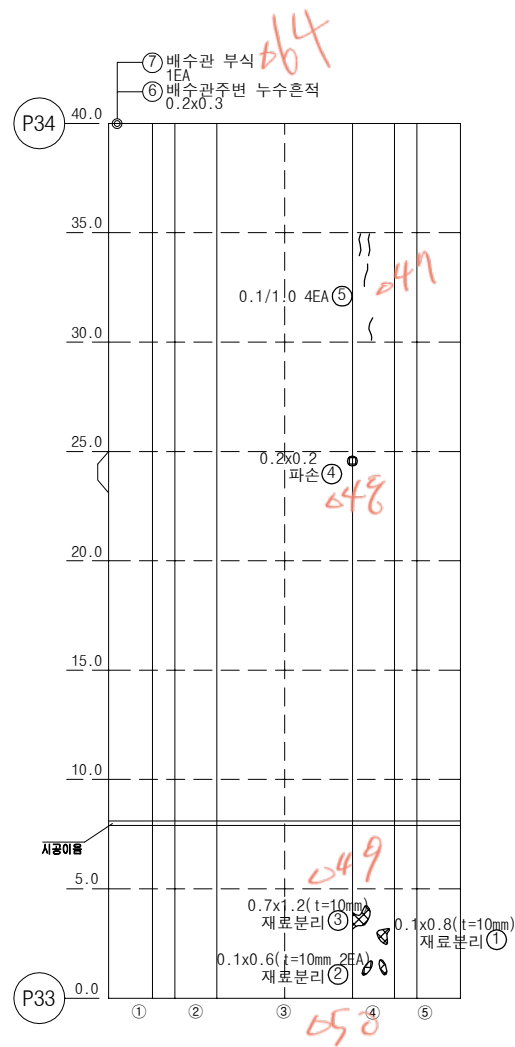


서 울

분 달

KEY PLAN

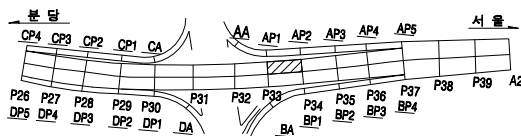

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역							
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월			
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인			
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구			
	누수, 변색	배수구	포장외 요철	기타	도면번호	204			


ID : 복정고가교 본선-하행선 box외부(S35)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	백태	0.1	0.2	0.02	m ²	1	
2	배수관부식			1	EA	1	
3	배수구주변누수, 백태	0.3	0.3	0.09	m ²	1	
4	균열(0.1mm)	0.1	1.5	1.50	m	1	
5	배수관누수(이음부)			1	EA	1	
6	보수부재균열	0.2	2	2.00	m	1	
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

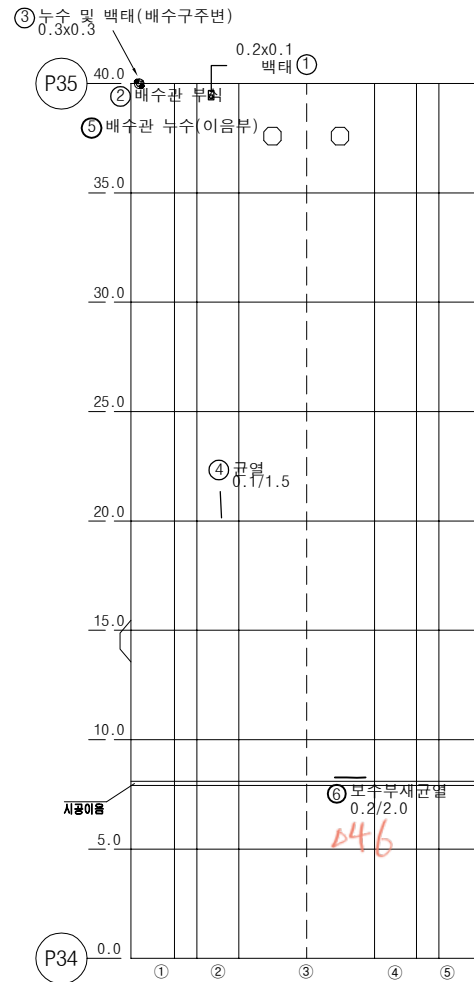

KEY PLAN

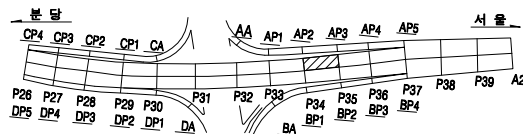

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	백태	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송분리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장외 요철	기타	도면번호	205	


ID : 복정고가교 본선-하행선 box외부(S37)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.1mm)	0.1	1.4	1.40	m	1	
2	물끊기흙누락		0.3	1.00	EA	1	
3	배수관부식			1	EA	1	
4	파손	0.2	1	0.60	m ²	3	
5	균열(0.2mm)	0.2	1.8	1.80	m	1	
6	균열(0.2mm)	0.2	1	1.00	m	1	
7	균열(0.2mm)	0.2	1	1.00	m	1	
8	균열(0.2mm)	0.2	2	2.00	m	1	
9	표면오염(누수흔적)	0.2	1.5	0.30	m ²	1	
10	표면오염(누수흔적)	0.5	1.5	0.75	m ²	1	
11	표면오염(누수흔적)	1.5	1.5	2.25	m ²	1	
12	파손	0.2	1.5	0.60	m ²	2	
13	누수	0.2	0.2	0.04	m ²	1	
14	표면오염(누수흔적)	1.5	2	3.00	m ²	1	
15	재료분리	0.2	0.3	0.06	m ²	1	
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

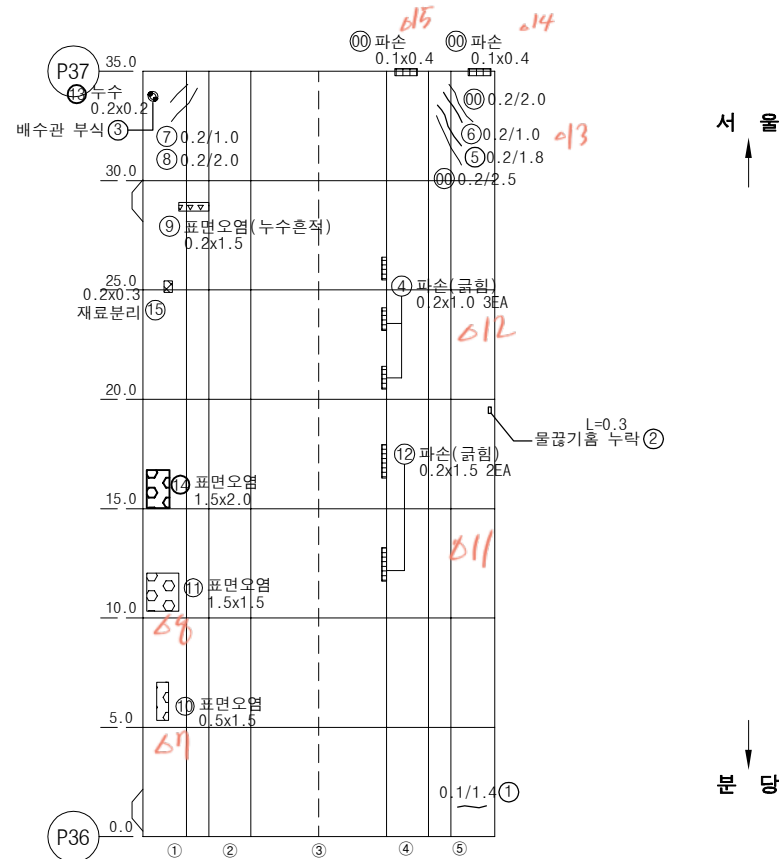

KEY PLAN

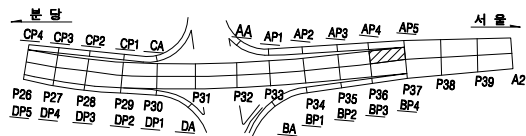

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	변형, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바리, 파손	시공이음분리, 송분리	이물침투력	신속여름 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴 및 결	기타	도면번호	207	


ID : 복정고가교 본선-하행선 box외부(S38)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열(0.2mm)	0.2	0.4	0.40	m	1	
2	균열(0.1mm)	0.1	0.6	0.60	m	1	
3	배수관부식			1	EA	1	
4	균열(0.2mm)	0.2	3	12.00	m	4	
5	균열(0.2mm)	0.2	1	1.00	m	1	
6	균열(0.3mm)	0.3	3	3.00	m	1	
7	철근노출	0.3	0.2	0.06	m ²	1	
8	배수구부식			1	EA	1	
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

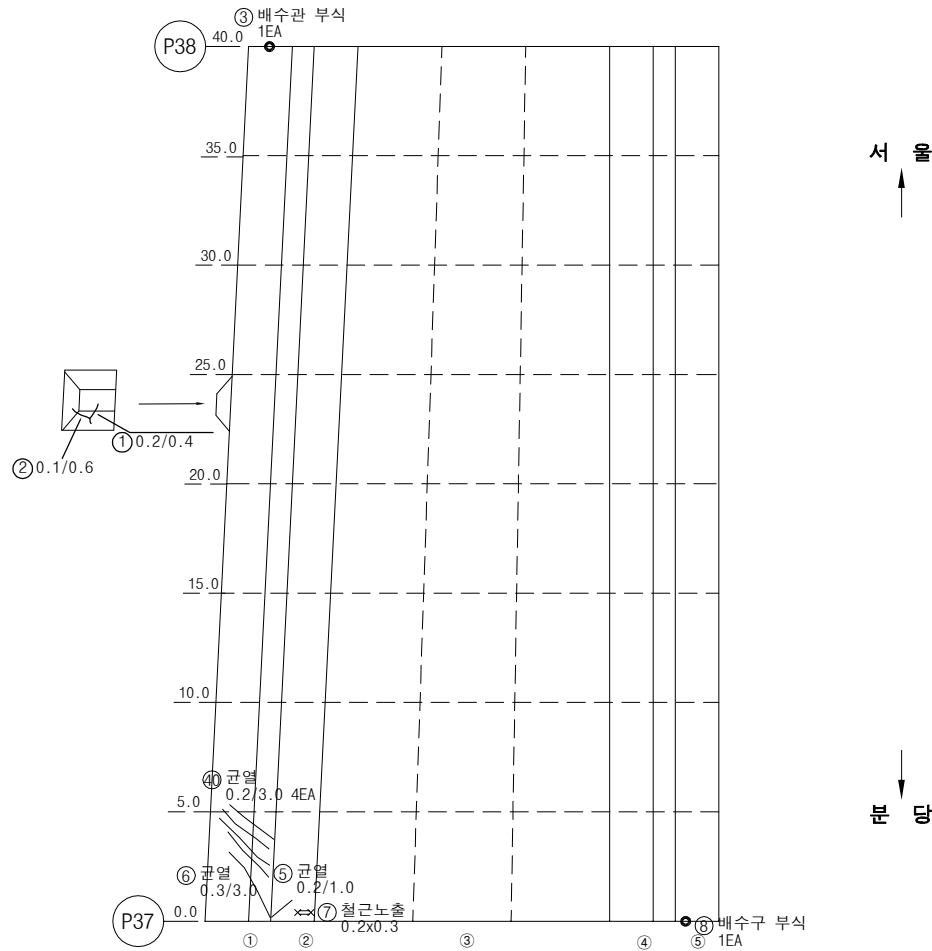

KEY PLAN

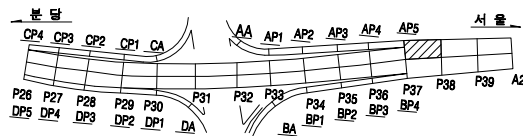

SECTION




용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	균열	광상균열	벽면	편위, 공동	조사일시	2023년 11월	
	재료분리	철근노출	철근부식	좌굴, 변형	조사자	이희송 외 17인	
	바라, 파손	시공이음분리, 송판리	이물침투력	신축이음 본체	확인자	김 찬 구	
	누수, 변색	배수구	포장파괴	기타	도면번호	208	


ID : 복정고가교 본선-하행선 box외부(S39)

손 상 물 량 표


번호	손상내용	손상물량					비고
		폭	길이	수량	단위	개소	
1	균열부백태	0.2	0.2	0.20	m	1	
2	균열부백태	0.2	0.8	0.80	m	1	
3	배수관주변 누수	0.3	0.2	0.06	m'	1	
4	배수관부식			1	EA	1	
5	균열부백태	0.1	3	12.00	m	4	
6							
7							
8							
9							
10							
11							
12							
13							
14							
15							
16							
17							
18							
19							
20							
21							
22							
23							
24							
25							
26							
27							
28							
29							
30							
31							
32							
33							
34							
35							
36							
37							
38							
39							
40							

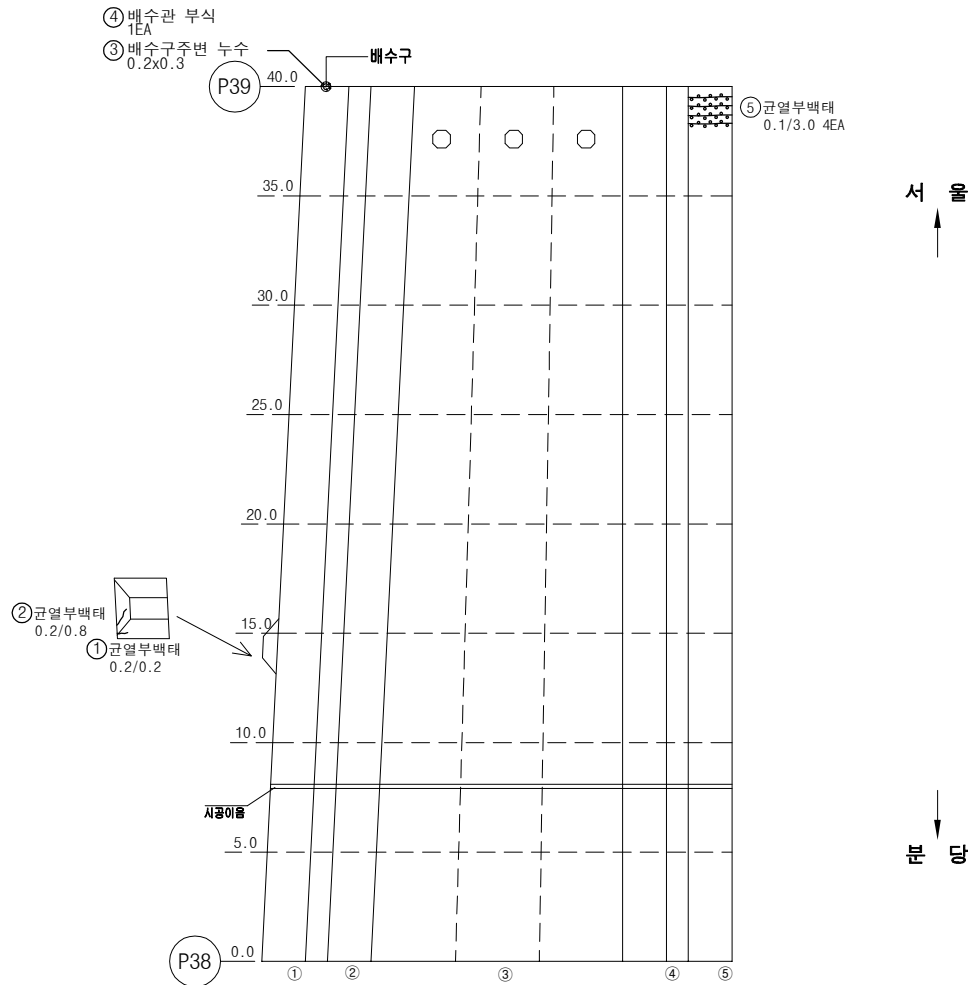

KEY PLAN

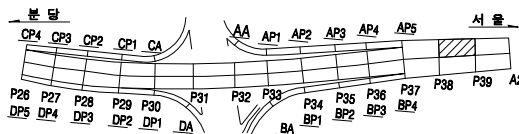

SECTION



용역명		2023년 하반기 복정고가교 정밀안전진단 용역					
면 례	① 균열	② 광상균열	③ 백태	④ 편위, 공동	조사일시	2023년 11월	
	⑤ 재료분리	⑥ 철근노출	⑦ 철근부식	⑧ 좌굴, 변형	조사자	이희송 외 17인	
	⑨ 바리, 파손	⑩ 시공이음분리, 송분리	⑪ 이음열외력	⑫ 신축이음 본체	확인자	김 찬 구	
	⑬ 누수, 변색	⑭ 배수구	⑮ 포장의 요철	⑯ 기타	도면번호	209	

