
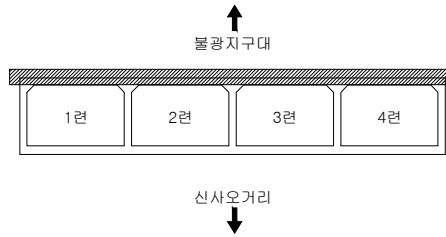


KEY PLAN

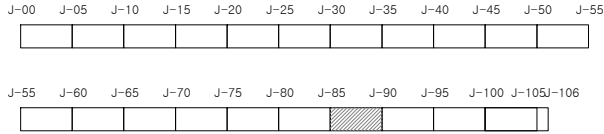


불 광 천 포 장 부 J85(2K 245) ~ J90(2K 368)

손 상 물 량 표

범 례			① ~ 2013 신규		가① - 기존손상				㉠ 보수완료			
번 호	손 상 위 치		적출년도	결함규모							비 고	
				내 용	폭	길이	깊이	물 량	단위	개소		
1	85-86	S	2013	망상균열	4.7	10.0			47.0	m	1	신규
2	85-86	S	2013	균열		17.0			17.0	m	1	신규
3	85-86	S	2013	균열		3.0			3.00	m	1	신규
4	85-86	S	2013	균열	1.0	24.0			24.0	m	1	신규
5	85-86	S	2013	균열	1.0	24.0			24.0	m	1	신규
6	85	S	2013	후타재파손	0.8	7.3			5.84	m	1	신규
7	86-87	S	2013	균열		3.0			3.00	m	1	신규
8	86-87	S	2013	균열	1.0	24.0			24.0	m	1	신규
9	86	S	2013	후타재파손	0.8	7.4			5.92	m	1	신규
10	87	S	2013	후타재파손	0.8	2.5			2.00	m	1	신규
11	87	S	2013	후타재파손	0.8	3.5			2.80	m	1	신규
12	87-88	S	2013	균열	1.0	24.0			24.0	m	1	신규
13	87	S	2013	후타재파손	0.8	6.0			4.80	m	1	신규
14	87-88	S	2013	망상균열	2.0	2.6			5.20	m	1	신규
15	88-89	S	2013	균열	1.0	26.0			26.0	m	1	신규
16	88-89	S	2013	망상균열	4.0	14.0			56.0	m	1	신규
17	89-90	S	2013	망상균열	3.0	24.0			72.0	m	1	신규
18	88	S	2013	보수완료	0.5	20.0			10.0	m	1	기존보수
19	89	S	2013	보수완료	0.5	20.0			10.0	m	1	기존보수
20	90	S	2013	보수완료	0.5	20.0			10.0	m	1	기존보수
21												
22												
23												
24												
25												
26												
27												
28												
29												
30												
31												
32												
33												

-1순위 : Type-7~9 (예일여고~역말사거리)
 -2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
 -3순위 : Type-1~7 (시점~예일여고) 및 포장균열

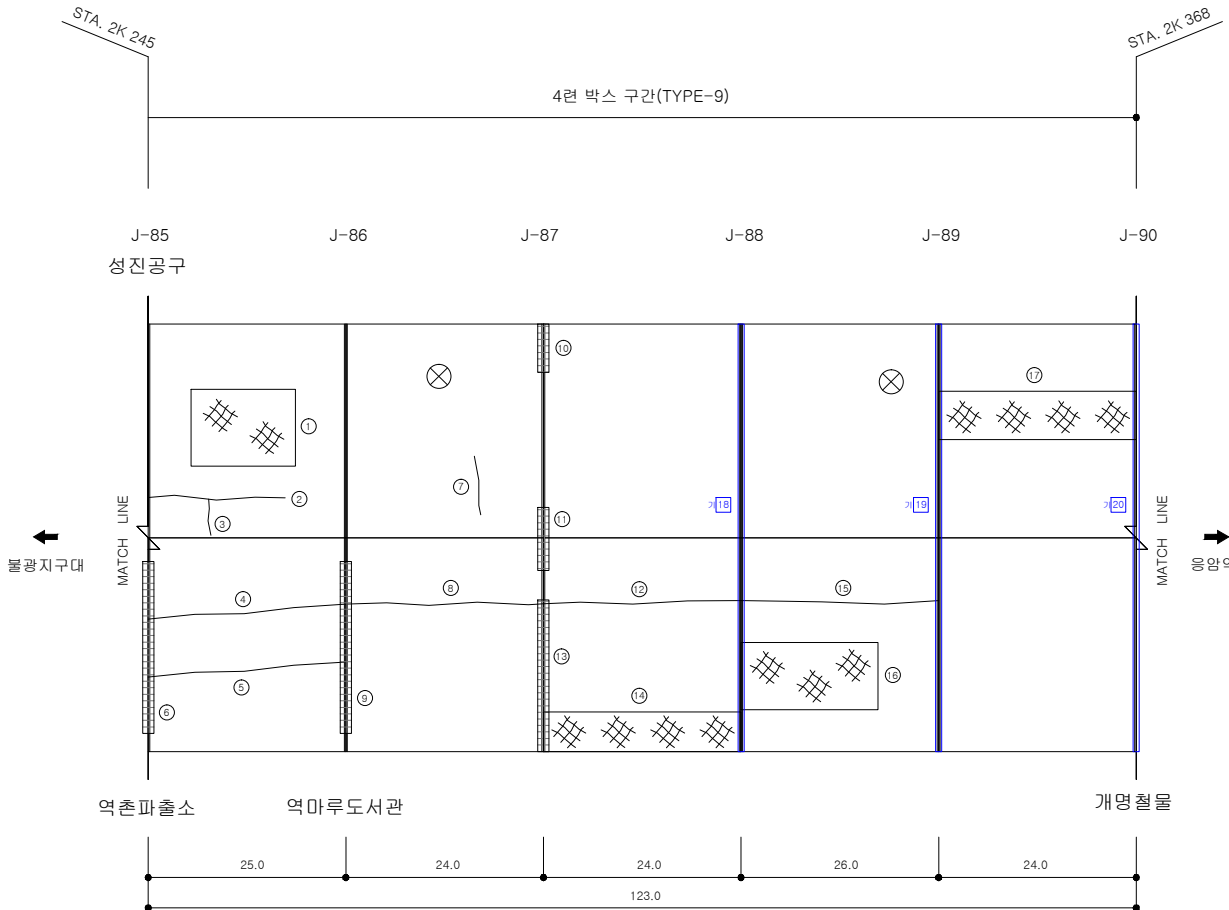

범 례



단 위



지름

두께

면적

발주처



서울특별시 서부도로사업소

용역사



(주)한국시설안전연구원

PROJECT

불광천1복개 정밀안전진단 및 녹번천복개 정밀점검 용역

TITLE

불 광 천 포 장 부
J85(2K 245) ~ J90(2K 368)

SCALE

NOTE

0-21