

■ 전경사진

No. 1



위 치	교면 S1
내 용	교 명 판

No. 2



위 치	교면 S1
내 용	교 명 판

No. 3



위 치	교량 측면
내 용	전경

No. 4



위 치	교량 상부
내 용	A1 → A2 전경

□ 교면

No. 5



위 치	신축이음 A1
내 용	유간토사퇴적 (L=1.5m)

No. 6



위 치	교면 S1
내 용	배수구막힘

No. 7



위 치	교면 S1
내 용	아스콘패임 (1.0m × 1.5m)

No. 8



위 치	교면 S2
내 용	아스콘마모 (3.0m × 20.0m)

No. 9



위 치	교면 S2
내 용	아스콘균열 (L=4.0m)

No. 10



위 치	중분대 S2
내 용	철근노출 (L=0.3m, 24EA)

No. 11



위 치	교면 S2
내 용	배수구막힘

No. 12



위 치	방호벽 S3
내 용	보수부재균열 (cw:0.1mm, L=1.2m)

No. 13



위 치	교면 S3
내 용	아스콘마모 (3.0m × 20.0m)

No. 14




위 치	교면 S3
내 용	아스콘패임 (1.5m × 1.5m)

No. 15



위 치	교면 S3
내 용	토사퇴적 (1.0m × 0.6m)

No. 16

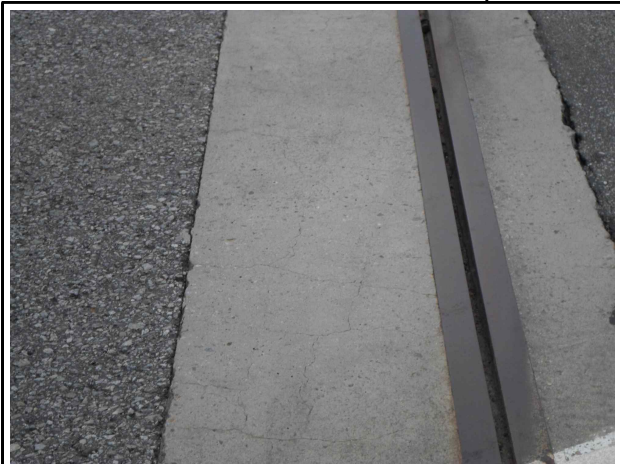

위 치	신축이음 A2
내 용	후타재 망상균열 (0.1m × 7.0m)

바닥판 및 거더

No. 17



위 치	바닥판 S1
내 용	상태양호

No. 18




위 치	바닥판 S2
내 용	데크플레이트 부식 (0.3m × 1.0m)

No. 19




위 치	바닥판 S3
내 용	균열보수부

No. 20

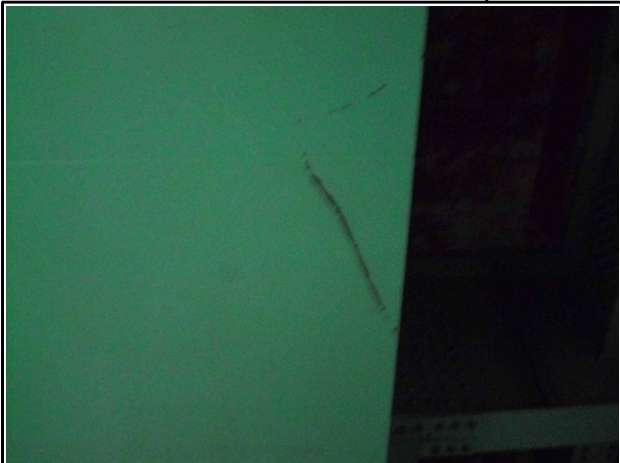

위 치	S1/G1
내 용	굽힘 (0.1m × 0.5m)

No. 21

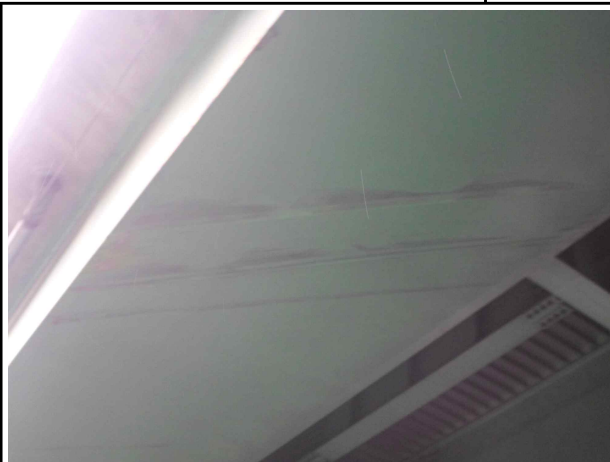

위 치	S2/G2
내 용	굽힘 (1.0m × 3.0m)

No. 22



위 치	S3/G2
내 용	도장탈락 (0.2m × 0.3m)

No. 23




위 치	거더내부 S1/G1
내 용	이물질퇴적 (2.5m × 2.0m)

No. 24



위 치	거더내부 S1/G1
내 용	우수유입흔적 (40.0m × 0.2m)

No. 25

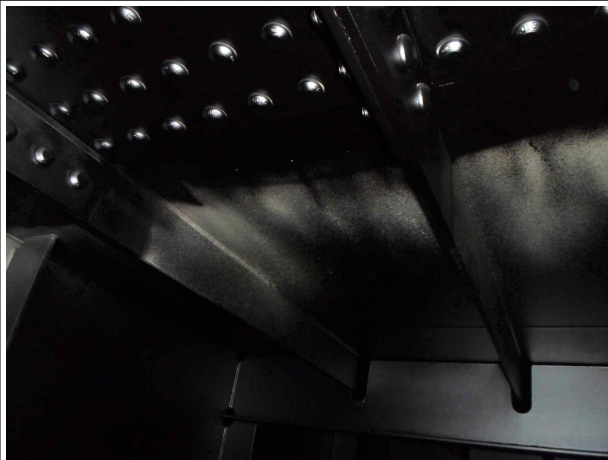

위 치	S2/G4
내 용	도장불량 (0.5m × 2.5m)

No. 26



위 치	S3/G2
내 용	이물질퇴적 (0.5m × 0.5m)

교대

No. 27



위 치	A1/Sh4
내 용	받침콘크리트균열 (cw:0.1mm, L=0.2m)

No. 28



위 치	A1 전면
내 용	균열 (cw:0.2mm, L=0.8m)

No. 29



위 치	A1 전면
내 용	누수흔적 (1.0m × 1.5m)

No. 30



위 치	A2/SH2
내 용	Plate 부식

No. 31



위 치	A2 전면
내 용	균열 (cw:0.2mm, 1.0m) 2EA

No. 32



위 치	A2 전면
내 용	누수흔적 (1.0m × 1.5m)

교각

No. 33



위 치	P1 전면
내 용	전 경

No. 34




위 치	P2 전면
내 용	전 경

No. 35



위 치	P2/SH2
내 용	반침콘크리트균열 (cw:0.1mm, L=1.0m)

No. 36

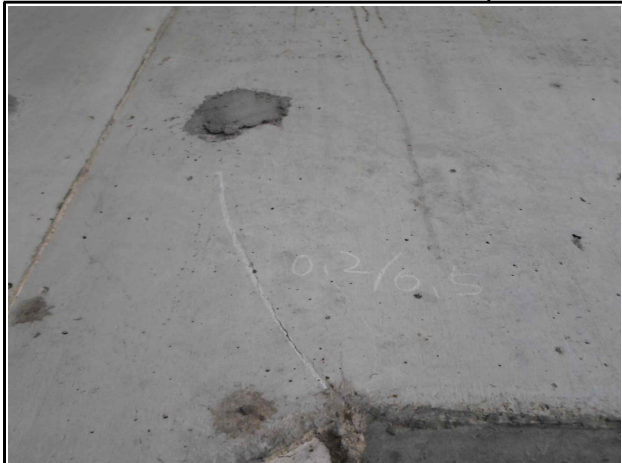

위 치	P2 배면
내 용	균열 (cw:0.2mm, L=0.5m)

비파괴시험

No. 37



위 치	P2 기둥
내 용	반발경도시험

No. 38



위 치	P2 기둥
내 용	피복두께측정

No. 39



위 치	P2 기둥
내 용	탄산화시험

No. 40



위 치	바닥판 S3
내 용	반발경도시험

No. 41



위 치	바닥판 S3
내 용	피복두께 측정

No. 42



위 치	바닥판 S3
내 용	탄산화시험