

전경사진

No. 1



위 치	교면 S1
내 용	교 명 판

No. 2



위 치	교면 S9
내 용	교 명 판

No. 3




위 치	교량 측면
내 용	전경

No. 4



위 치	교량 상부
내 용	A1 → A2 전경

No. 5

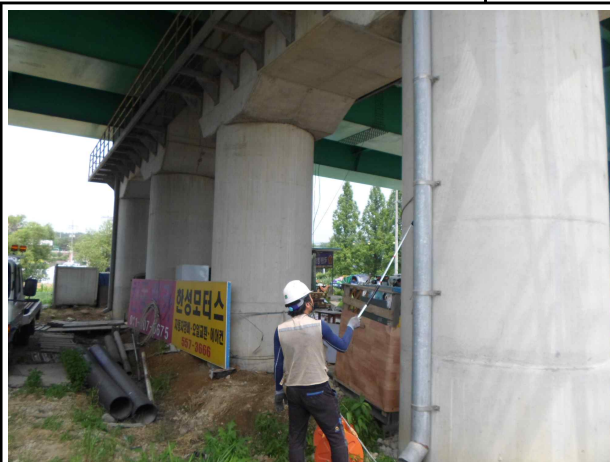

위 치	교량 하부
내 용	외관조사전경

No. 6



위 치	교량 하부
내 용	고소작업차를 이용한 조사전경

□ 교면

No. 7




위 치	신축이음 A1
내 용	후타재 균열 (cw:0.1mm, L=0.4m)

No. 8




위 치	신축이음 A1
내 용	유간 이물질퇴적 (L=3.0m)

No. 9

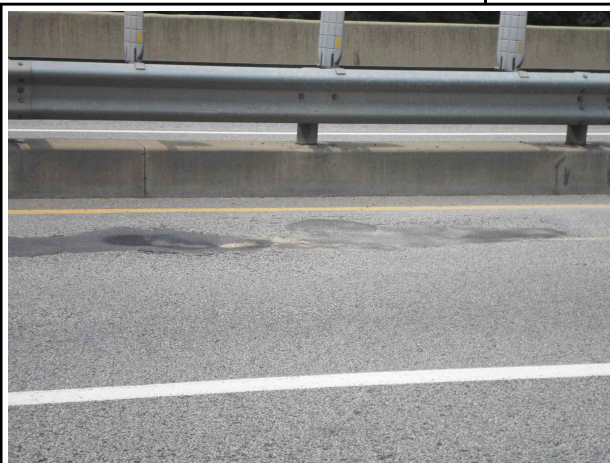


위 치	교면 S1
내 용	아스콘 소성변형 및 밀림 (0.3m×3.0m)

No. 10

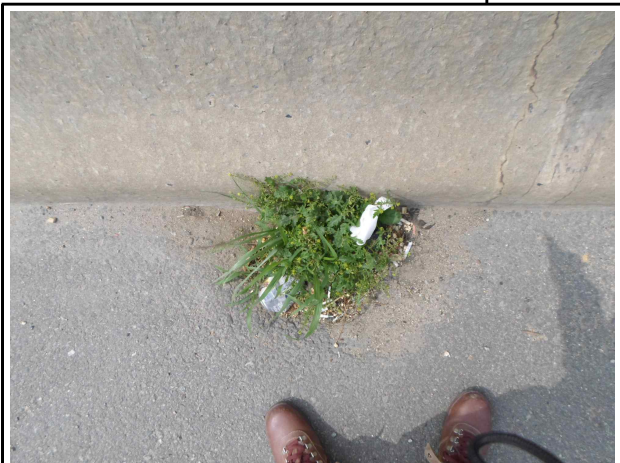

위 치	교면 S1
내 용	배수구막힘

No. 11

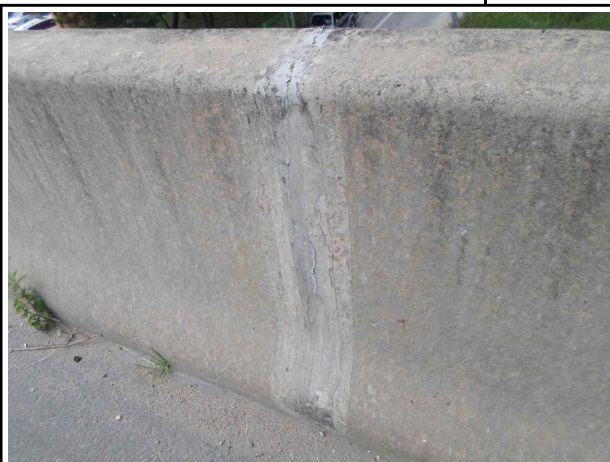

위 치	방호벽 S2
내 용	보수부재 균열 (cw:0.1mm, L=1.0m)

No. 12



위 치	교면 S2
내 용	보수부 아스콘 변형 (1.0m×1.0m)

No. 13



위 치	교면 S2
내 용	토사퇴적 (0.5m × 43.0)

No. 14



위 치	교면 S3
내 용	아스콘요철 및 변형 (2.0m × 3.0m)

No. 15



위 치	교면 S4
내 용	배수구막힘

No. 16




위 치	방호벽 S5
내 용	균열 (cw:0.3mm, L=1.0m)

No. 17



위 치	방호벽 S5
내 용	차량사고흔적 (0.3m × 1.0m)

No. 18

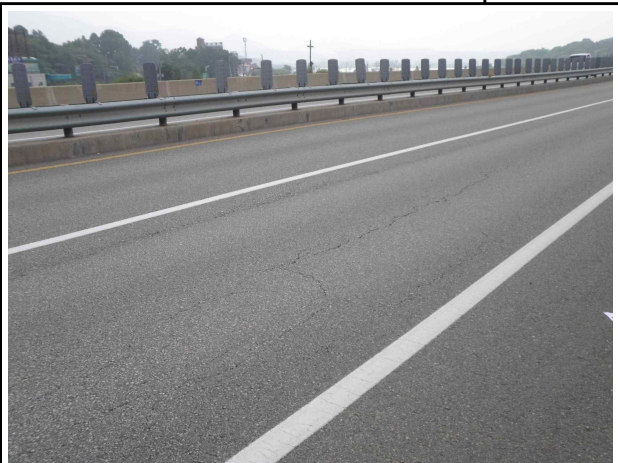

위 치	교면 S5
내 용	아스콘균열 (L=20.0m, 2EA)

No. 19




위 치	교면 S7
내 용	토사퇴적 (1.0m × 43.0m)

No. 20



위 치	중앙분리대 S7
내 용	철근노출 (0.2m × 2.0m)

No. 21

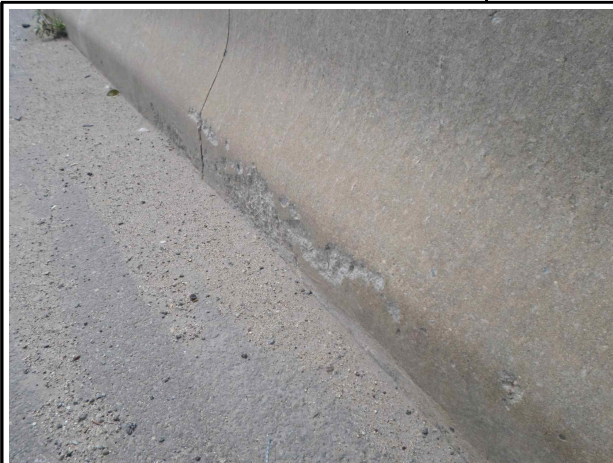


위 치	방호벽 S8
내 용	표면부스러짐 (0.3m × 2.0m)

No. 22




위 치	방호벽 S8
내 용	파손 (0.3m × 0.6m)

No. 23

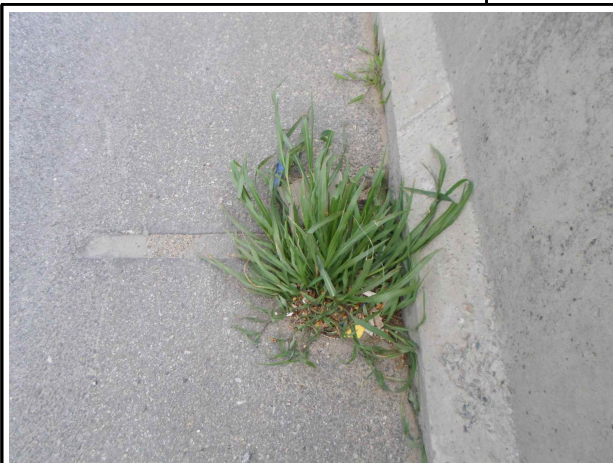

위 치	교면 S9
내 용	배수구막힘

No. 24

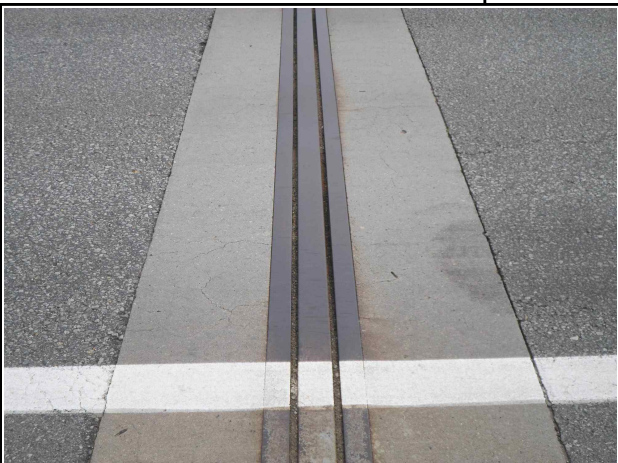

위 치	신축이음 A2
내 용	후타재 망상균열 (0.4m × 0.6m)

바닥판 및 거더

No. 25



위 치	바닥판 S1
내 용	균열 (cw:0.1mm, L=1.2m)

No. 26



위 치	바닥판 S4
내 용	상태양호

No. 27



위 치	거더외부 S7
내 용	상태양호

No. 28




위 치	가로보 S6
내 용	상태양호

No. 29




위 치	거더내부 S1/G2
내 용	부식 (0.4m × 0.3m)

No. 30

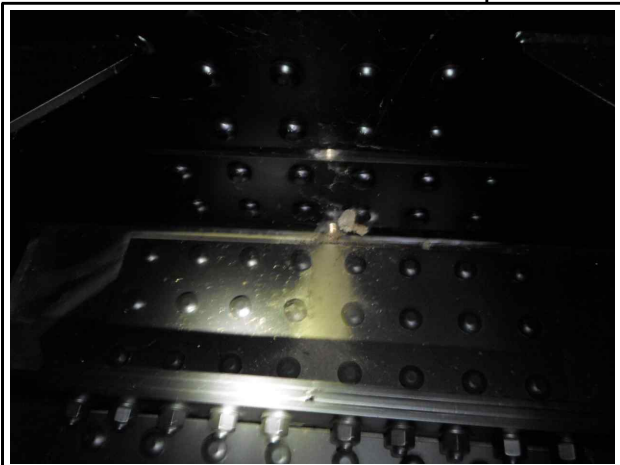


위 치	거더내부 S1/G4
내 용	우수유입흔적

No. 31

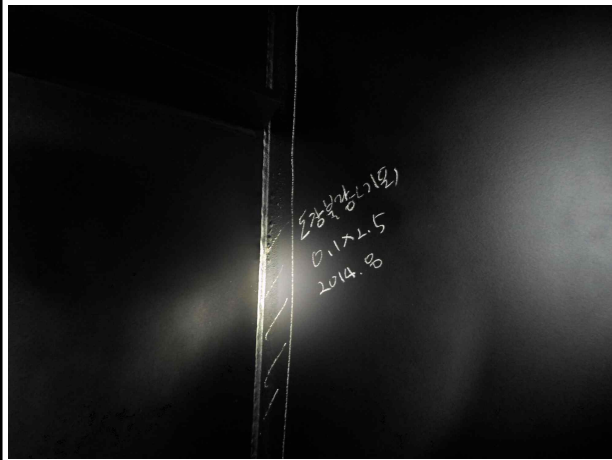


위 치	거더내부 S2/G3
내 용	도장불량(0.1m × 2.5m)

No. 32

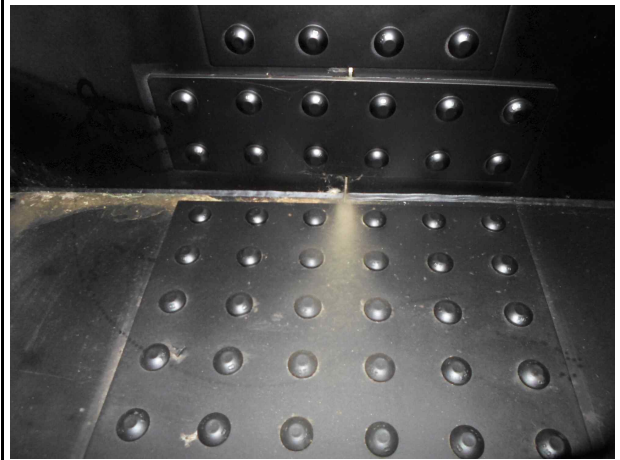


위 치	거더내부 S3/G4
내 용	우수유입흔적

No. 33

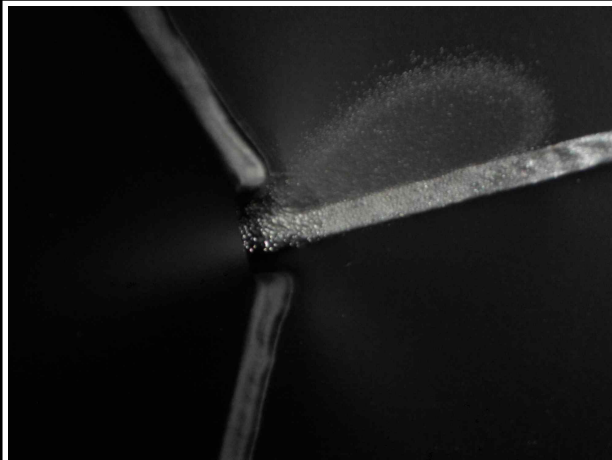


위 치	거더내부 S4/G3
내 용	도장불량(0.2m × 0.2m)

No. 34

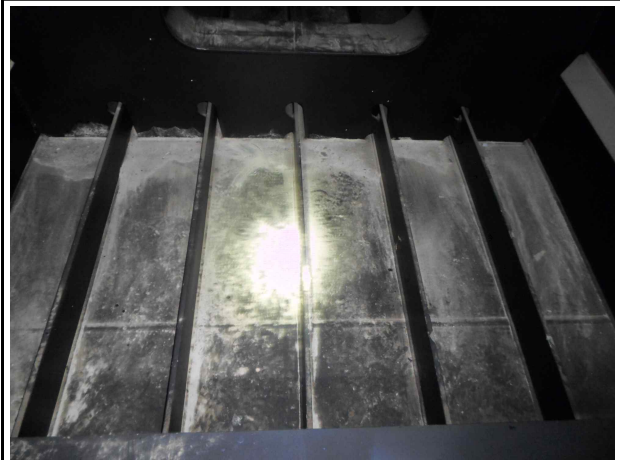


위 치	거더내부 S5/G4
내 용	이물질퇴적(2.5m × 1.5m)

No. 35

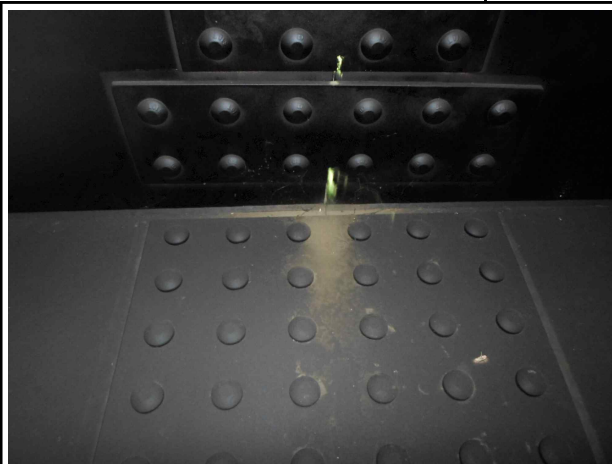

위 치	거더내부 S9/G2
내 용	우수유입흔적

No. 36

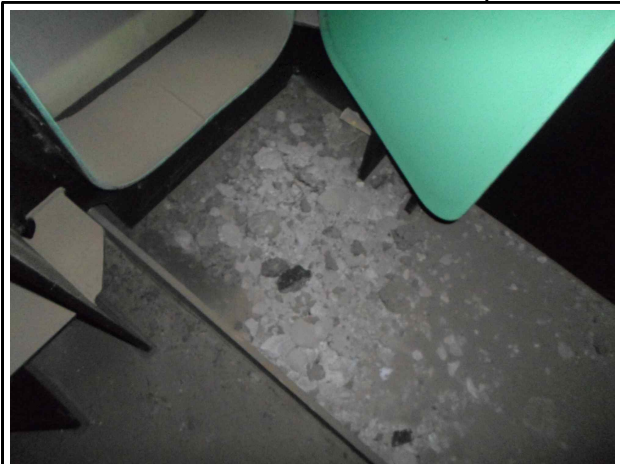

위 치	거더내부 S9/G3
내 용	버력 콘크리트 퇴적(1.0m × 1.0m)

교대

No. 37



위 치	A1/SH1
내 용	반침콘크리트파손 (0.1m×0.1m)

No. 38



위 치	A2 교좌면
내 용	철근노출 (0.1m×0.8m)

No. 39



위 치	A2 전면
내 용	균열 (cw:0.2mm, L=1.0m)

No. 40



위 치	A2/SH2
내 용	용접부부식 (0.1m×0.6m)

교각

No. 41




위 치	P1/SH4
내 용	받침콘크리트재료분리 (0.2m×0.1m)

No. 42



위 치	P1 코핑
내 용	균열 (cw:0.2mm, L=0.8m)

No. 43

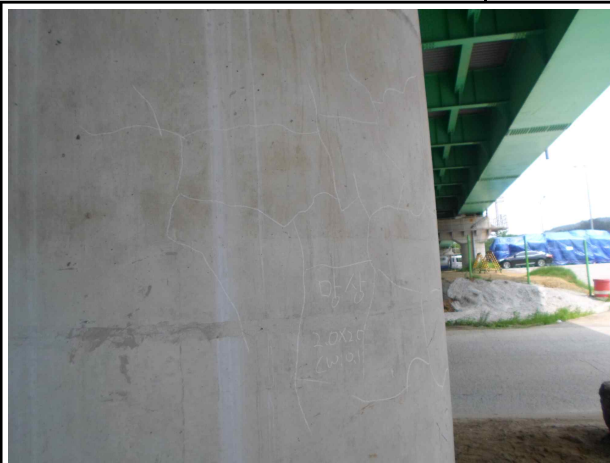

위 치	P2 기둥
내 용	망상균열 (2.0m×3.0m)

No. 44




위 치	P2/SH2
내 용	Plate 부식

No. 45



위 치	P3 이동제한장치
내 용	고정볼트와 상부판 접촉흔적

No. 46

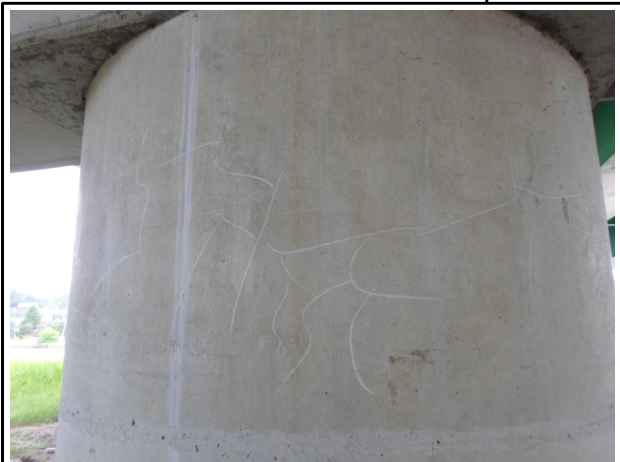

위 치	P3 기둥
내 용	망상균열 (1.0m×3.0m)

No. 47



위 치	P4 코핑
내 용	파손 (0.3m × 0.4m)

No. 48



위 치	P5 기둥
내 용	균열 (cw:0.1mm, L=1.5m)

No. 49



위 치	P6 기둥
내 용	균열 (cw:0.3mm, L=3.0m)

No. 50



위 치	P6 이동제한장치
내 용	고정볼트손상

No. 51



위 치	P7 기둥
내 용	파손 (0.2m × 0.2m)

No. 52



위 치	P8 코핑
내 용	재료분리 (0.5m × 1.0m)

비파괴시험

No. 53



위 치	바닥판 S4
내 용	반발경도시험

No. 54



위 치	바닥판 S4
내 용	피복두께 측정

No. 55



위 치	바닥판 S4
내 용	탄산화시험

No. 56



위 치	P7 기둥
내 용	반발경도시험

No. 57



위 치	P7 기둥
내 용	피복두께 측정

No. 58



위 치	P7 기둥
내 용	탄산화시험