
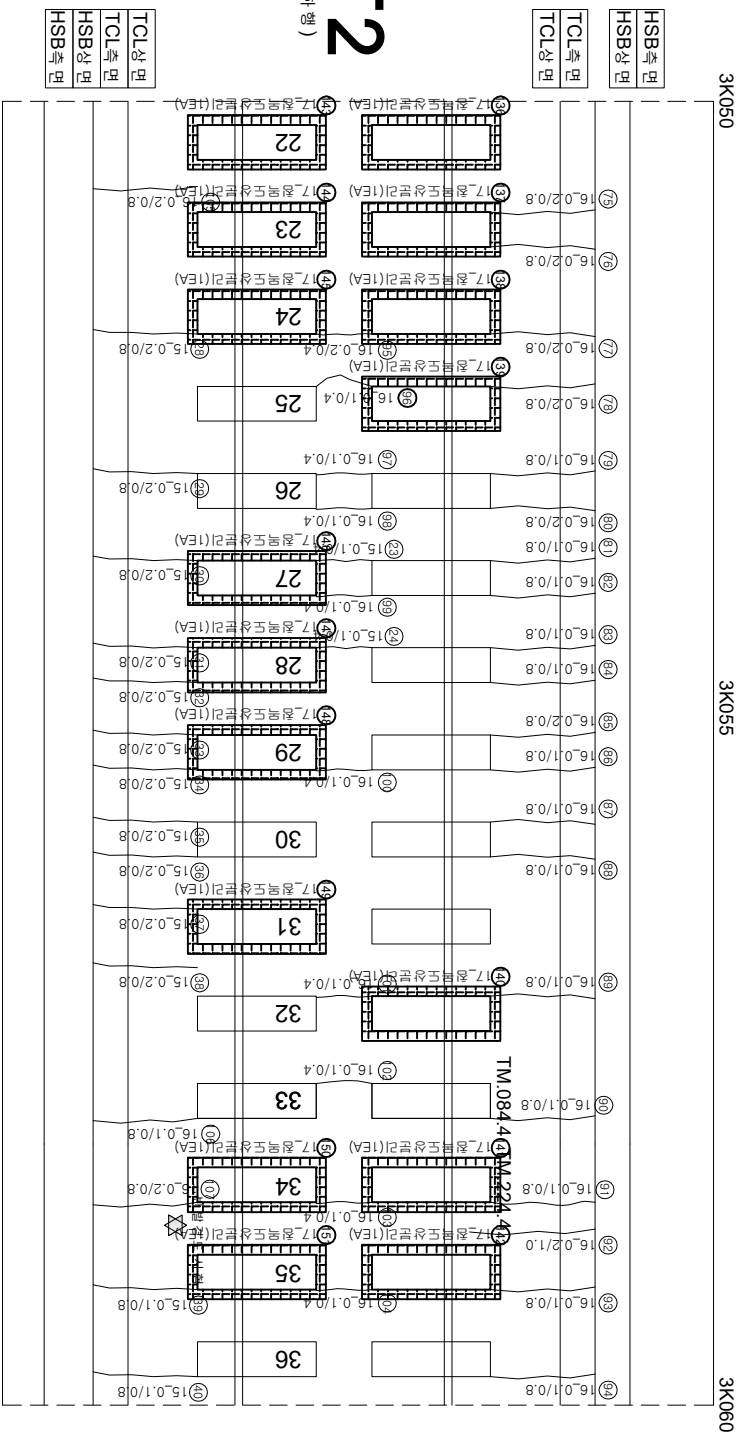


화남고속선 오송고가(T2)_토공노반_1(3.037~3.060km, L=23m)

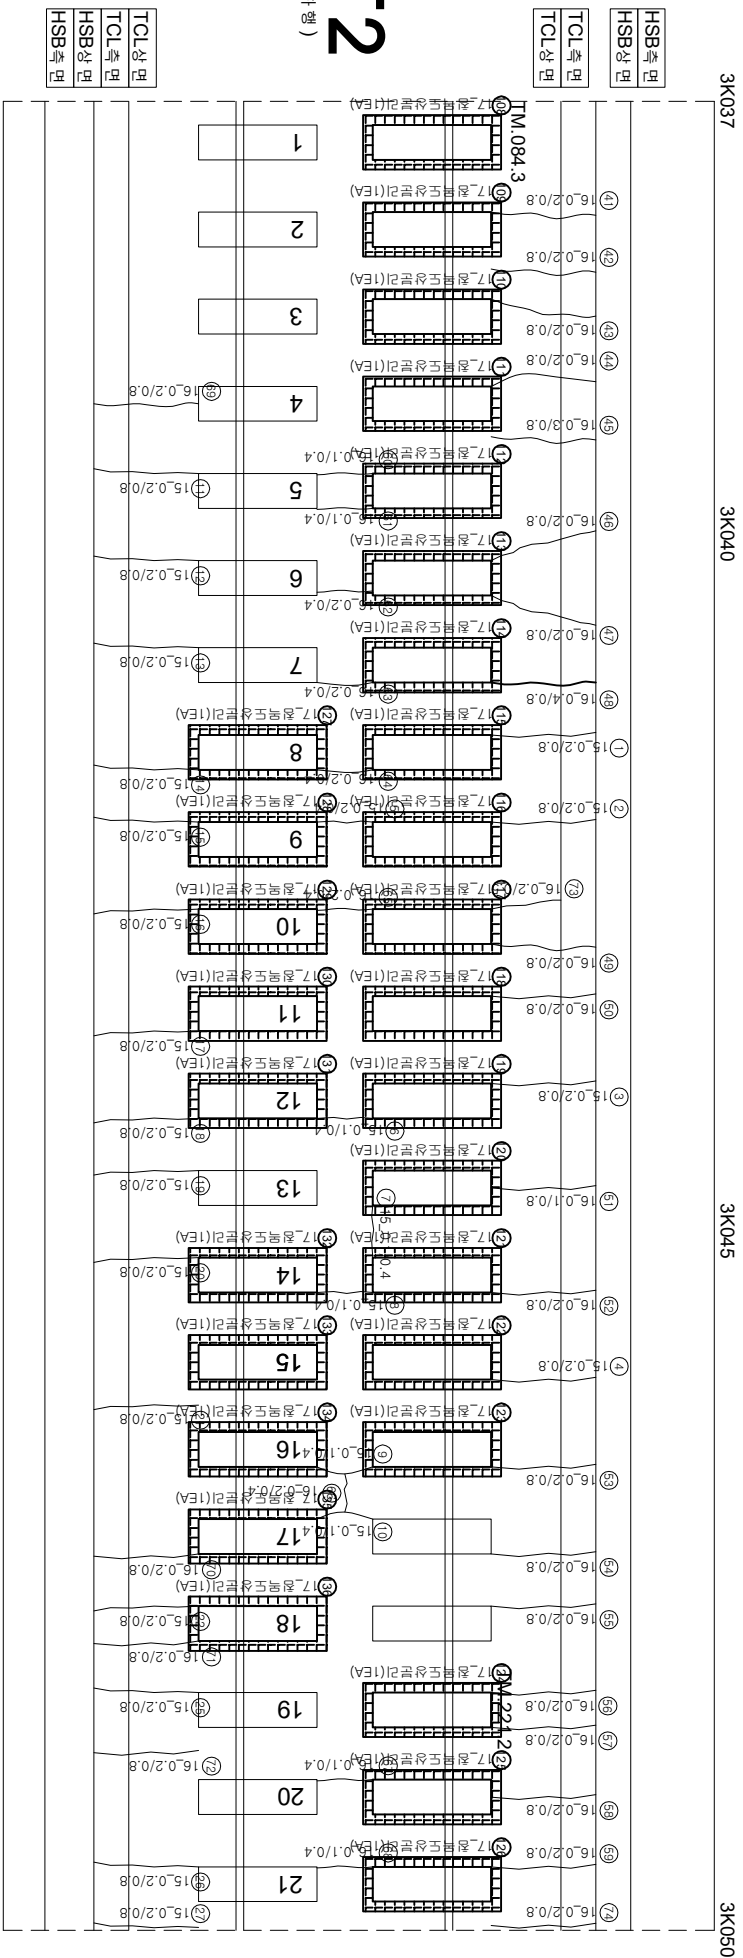

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열 0.2	mm	0.80 m		61	균열 0.1	mm	0.40 m	
2	균열 0.2	mm	0.80 m		62	균열 0.2	mm	0.40 m	
3	균열 0.2	mm	0.80 m		63	균열 0.2	mm	0.40 m	
4	균열 0.2	mm	0.80 m		64	균열 0.2	mm	0.40 m	
5	균열 0.2	mm	0.40 m		65	균열 0.2	mm	0.40 m	
6	균열 0.1	mm	0.40 m		66	균열 0.1	mm	0.40 m	
7	균열 0.1	mm	0.40 m		67	균열 0.1	mm	0.40 m	
8	균열 0.1	mm	0.40 m		68	균열 0.1	mm	0.40 m	
9	균열 0.1	mm	0.40 m		69	균열 0.2	mm	0.80 m	
10	균열 0.1	mm	0.40 m		70	균열 0.2	mm	0.80 m	
11	균열 0.2	mm	0.80 m		71	균열 0.2	mm	0.80 m	
12	균열 0.2	mm	0.80 m		72	균열 0.2	mm	0.80 m	
13	균열 0.2	mm	0.80 m		73	균열 0.2	mm	0.50 m	
14	균열 0.2	mm	0.80 m		74	균열 0.2	mm	0.80 m	
15	균열 0.2	mm	0.80 m		75	균열 0.2	mm	0.80 m	
16	균열 0.2	mm	0.80 m		76	균열 0.2	mm	0.80 m	
17	균열 0.2	mm	0.80 m		77	균열 0.2	mm	0.80 m	
18	균열 0.2	mm	0.80 m		78	균열 0.2	mm	0.80 m	
19	균열 0.2	mm	0.80 m		79	균열 0.1	mm	0.80 m	
20	균열 0.2	mm	0.80 m		80	균열 0.2	mm	0.80 m	
21	균열 0.2	mm	0.80 m		81	균열 0.1	mm	0.80 m	
22	균열 0.2	mm	0.80 m		82	균열 0.1	mm	0.80 m	
23	균열 0.1	mm	0.80 m		83	균열 0.1	mm	0.80 m	
24	균열 0.1	mm	0.80 m		84	균열 0.1	mm	0.80 m	
25	균열 0.2	mm	0.80 m		85	균열 0.2	mm	0.80 m	
26	균열 0.2	mm	0.80 m		86	균열 0.1	mm	0.80 m	
27	균열 0.2	mm	0.80 m		87	균열 0.1	mm	0.80 m	
28	균열 0.2	mm	0.80 m		88	균열 0.1	mm	0.80 m	
29	균열 0.2	mm	0.80 m		89	균열 0.1	mm	0.80 m	
30	균열 0.2	mm	0.80 m		90	균열 0.1	mm	0.80 m	
31	균열 0.2	mm	0.80 m		91	균열 0.1	mm	0.80 m	
32	균열 0.2	mm	0.80 m		92	균열 0.2	mm	1.00 m	
33	균열 0.2	mm	0.80 m		93	균열 0.1	mm	0.80 m	
34	균열 0.2	mm	0.80 m		94	균열 0.1	mm	0.80 m	
35	균열 0.2	mm	0.80 m		95	균열 0.2	mm	0.40 m	
36	균열 0.2	mm	0.80 m		96	균열 0.1	mm	0.40 m	
37	균열 0.2	mm	0.80 m		97	균열 0.1	mm	0.40 m	
38	균열 0.2	mm	0.80 m		98	균열 0.1	mm	0.40 m	
39	균열 0.1	mm	0.80 m		99	균열 0.1	mm	0.40 m	
40	균열 0.1	mm	0.80 m		100	균열 0.1	mm	0.40 m	
41	균열 0.2	mm	0.50 m		101	균열 0.1	mm	0.40 m	
42	균열 0.2	mm	0.80 m		102	균열 0.1	mm	0.40 m	
43	균열 0.2	mm	0.80 m		103	균열 0.1	mm	0.40 m	
44	균열 0.2	mm	0.80 m		104	균열 0.1	mm	0.40 m	
45	균열 0.3	mm	0.80 m		105	균열 0.2	mm	0.80 m	
46	균열 0.2	mm	0.80 m		106	균열 0.1	mm	0.80 m	
47	균열 0.2	mm	0.80 m		107	균열 0.2	mm	0.80 m	
48	균열 0.4	mm	0.80 m		108	균열도상본리		1.0 ea	신규
49	균열 0.2	mm	0.80 m		109	균열도상본리		1.0 ea	신규
50	균열 0.2	mm	0.80 m		110	균열도상본리		1.0 ea	신규
51	균열 0.1	mm	0.80 m		111	균열도상본리		1.0 ea	신규
52	균열 0.2	mm	0.80 m		112	균열도상본리		1.0 ea	신규
53	균열 0.2	mm	0.80 m		113	균열도상본리		1.0 ea	신규
54	균열 0.2	mm	0.80 m		114	균열도상본리		1.0 ea	신규
55	균열 0.2	mm	0.80 m		115	균열도상본리		1.0 ea	신규
56	균열 0.2	mm	0.80 m		116	균열도상본리		1.0 ea	신규
57	균열 0.2	mm	0.80 m		117	균열도상본리		1.0 ea	신규
58	균열 0.2	mm	0.80 m		118	균열도상본리		1.0 ea	신규
59	균열 0.2	mm	0.80 m		119	균열도상본리		1.0 ea	신규
60	균열 0.1	mm	0.40 m		120	균열도상본리		1.0 ea	신규

 한국철도공사 KOREA RAILROAD	시행사	공역명	공역사	계면영지	장대영지	단					
			(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이북영	간토강 김경기 윤석기			0.2220 (0.3m이하 : 흑색)			
								0.4820 (0.3m초과 0.5m이하 : 청색)			
								0.6920 (0.5m초과 1.0m미만 : 적색)			
								1.0220 (1.0m이상 : 분홍색)			
								원목도상판리		제로판리	
								양산근리		철판노출	
								바리,바리,파손		누수습관부	
								변태		시공이음판리,홍판리	
								양영			