


호남고속선 부용터널-135(14.180~14.190km, S133)

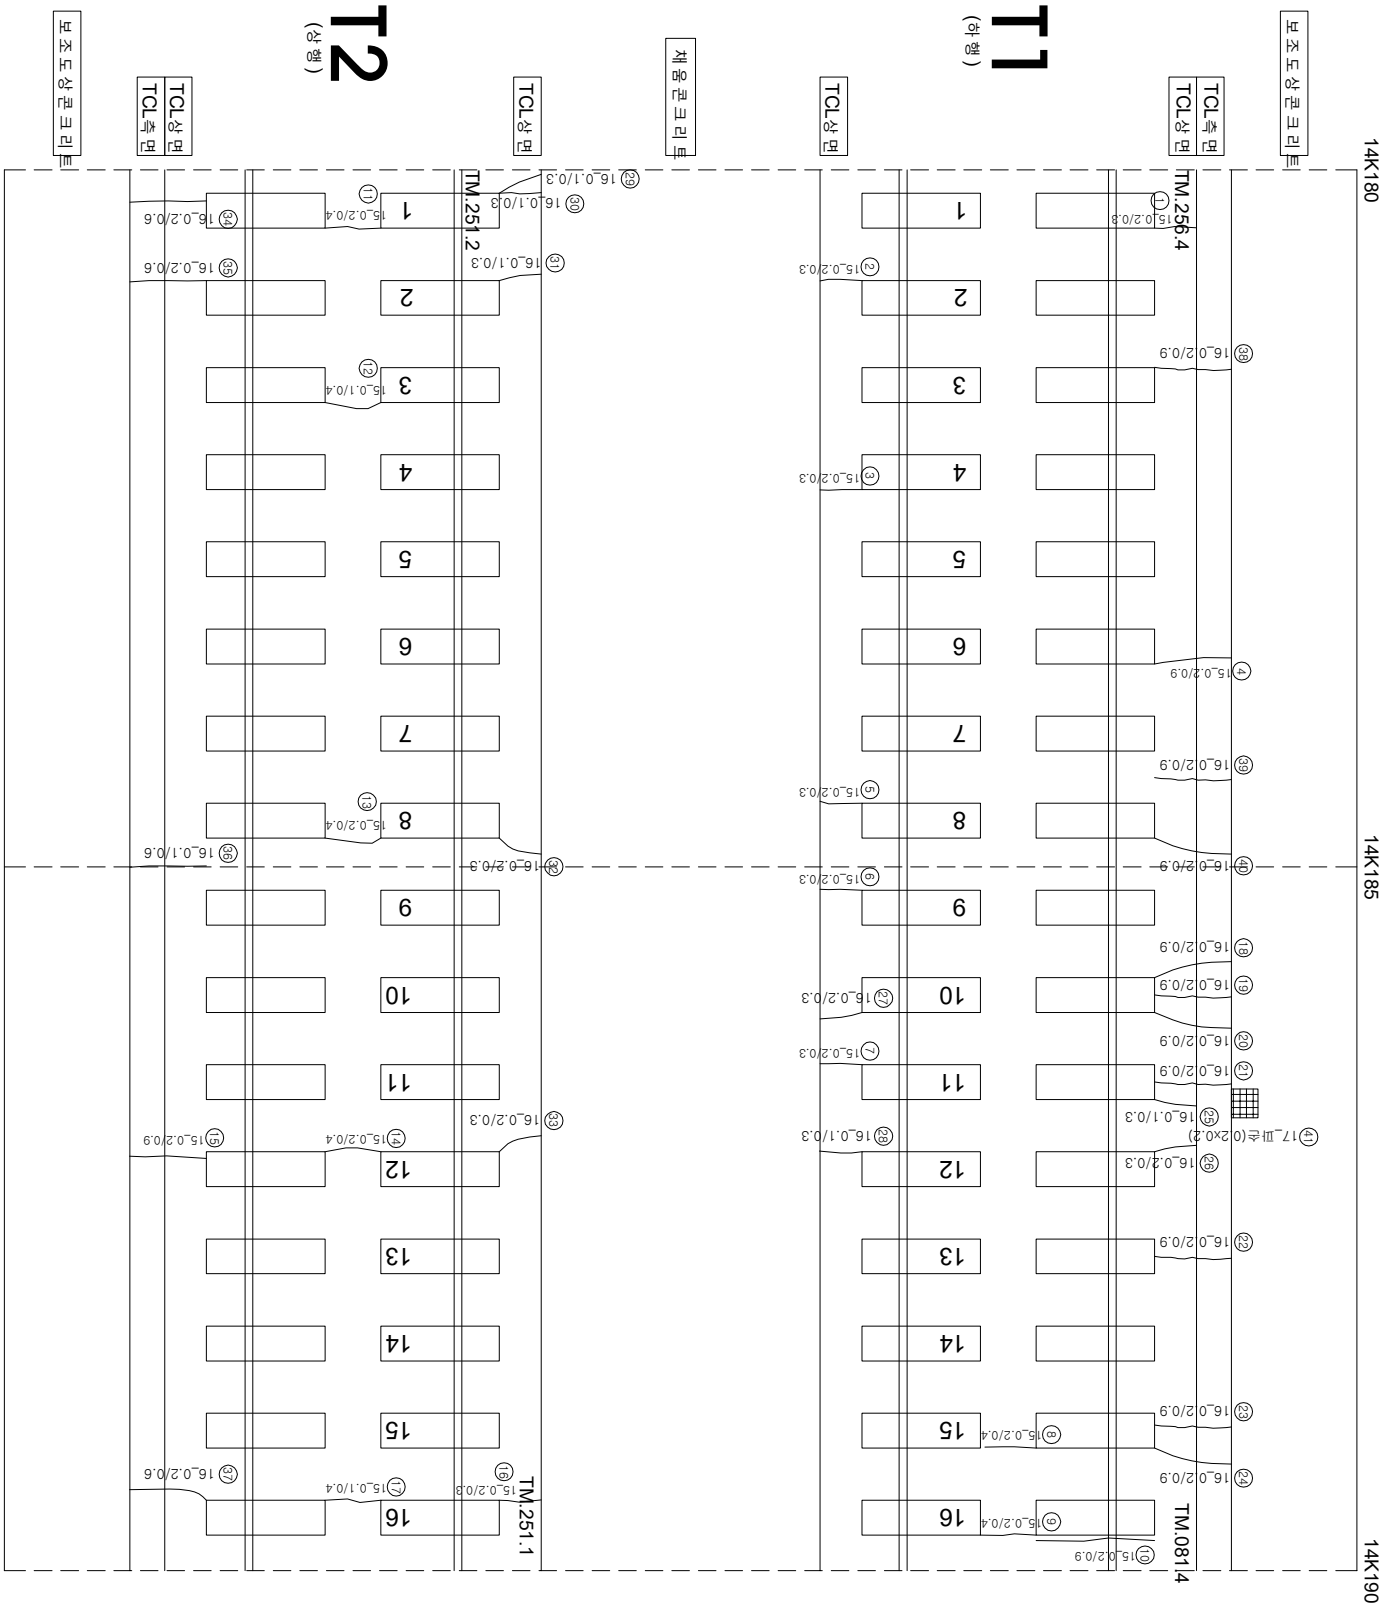

연번	순상	북	연장	비고	연번	순상	북	연장	비고
1	균열	0.2	mm	0.3	m	56			
2	균열	0.2	mm	0.3	m	57			
3	균열	0.2	mm	0.3	m	58			
4	균열(현상)	0.2	mm	0.9	m	59			
5	균열	0.2	mm	0.3	m	60			
6	균열	0.2	mm	0.3	m	61			
7	균열	0.2	mm	0.3	m	62			
8	균열	0.2	mm	0.4	m	63			
9	균열	0.2	mm	0.4	m	64			
10	경계부 균열	0.2	mm	0.9	m	65			
11	균열	0.2	mm	0.4	m	66			
12	균열	0.1	mm	0.4	m	67			
13	균열	0.2	mm	0.4	m	68			
14	균열	0.2	mm	0.4	m	69			
15	균열	0.2	mm	0.9	m	70			
16	균열	0.2	mm	0.3	m	71			
17	균열	0.1	mm	0.4	m	72			
18	균열	0.2	mm	0.9	m	73			
19	균열	0.2	mm	0.9	m	74			
20	균열	0.2	mm	0.9	m	75			
21	균열	0.2	mm	0.9	m	76			
22	균열	0.2	mm	0.9	m	77			
23	균열	0.2	mm	0.9	m	78			
24	균열	0.2	mm	0.9	m	79			
25	균열	0.1	mm	0.3	m	80			
26	균열	0.2	mm	0.3	m	81			
27	균열	0.2	mm	0.3	m	82			
28	균열	0.1	mm	0.3	m	83			
29	균열	0.1	mm	0.3	m	84			
30	균열	0.1	mm	0.3	m	85			
31	균열	0.1	mm	0.3	m	86			
32	균열	0.2	mm	0.3	m	87			
33	균열	0.2	mm	0.3	m	88			
34	균열	0.2	mm	0.6	m	89			
35	균열	0.2	mm	0.6	m	90			
36	균열	0.1	mm	0.6	m	91			
37	균열	0.2	mm	0.6	m	92			
38	균열	0.2	mm	0.9	m	93			
39	균열	0.2	mm	0.9	m	94			
40	균열	0.2	mm	0.9	m	95			
41	파손	0.2	m	0.2	m	96	신규		
42						97			
43						98			
44						99			
45						100			
46						101			
47						102			
48						103			
49						104			
50						105			
51						106			
52						107			
53						108			
54						109			
55						110			