


호남고속선 공주고가_토공노반_3(43.900~43.910km, L=10m)

43K900

43K910

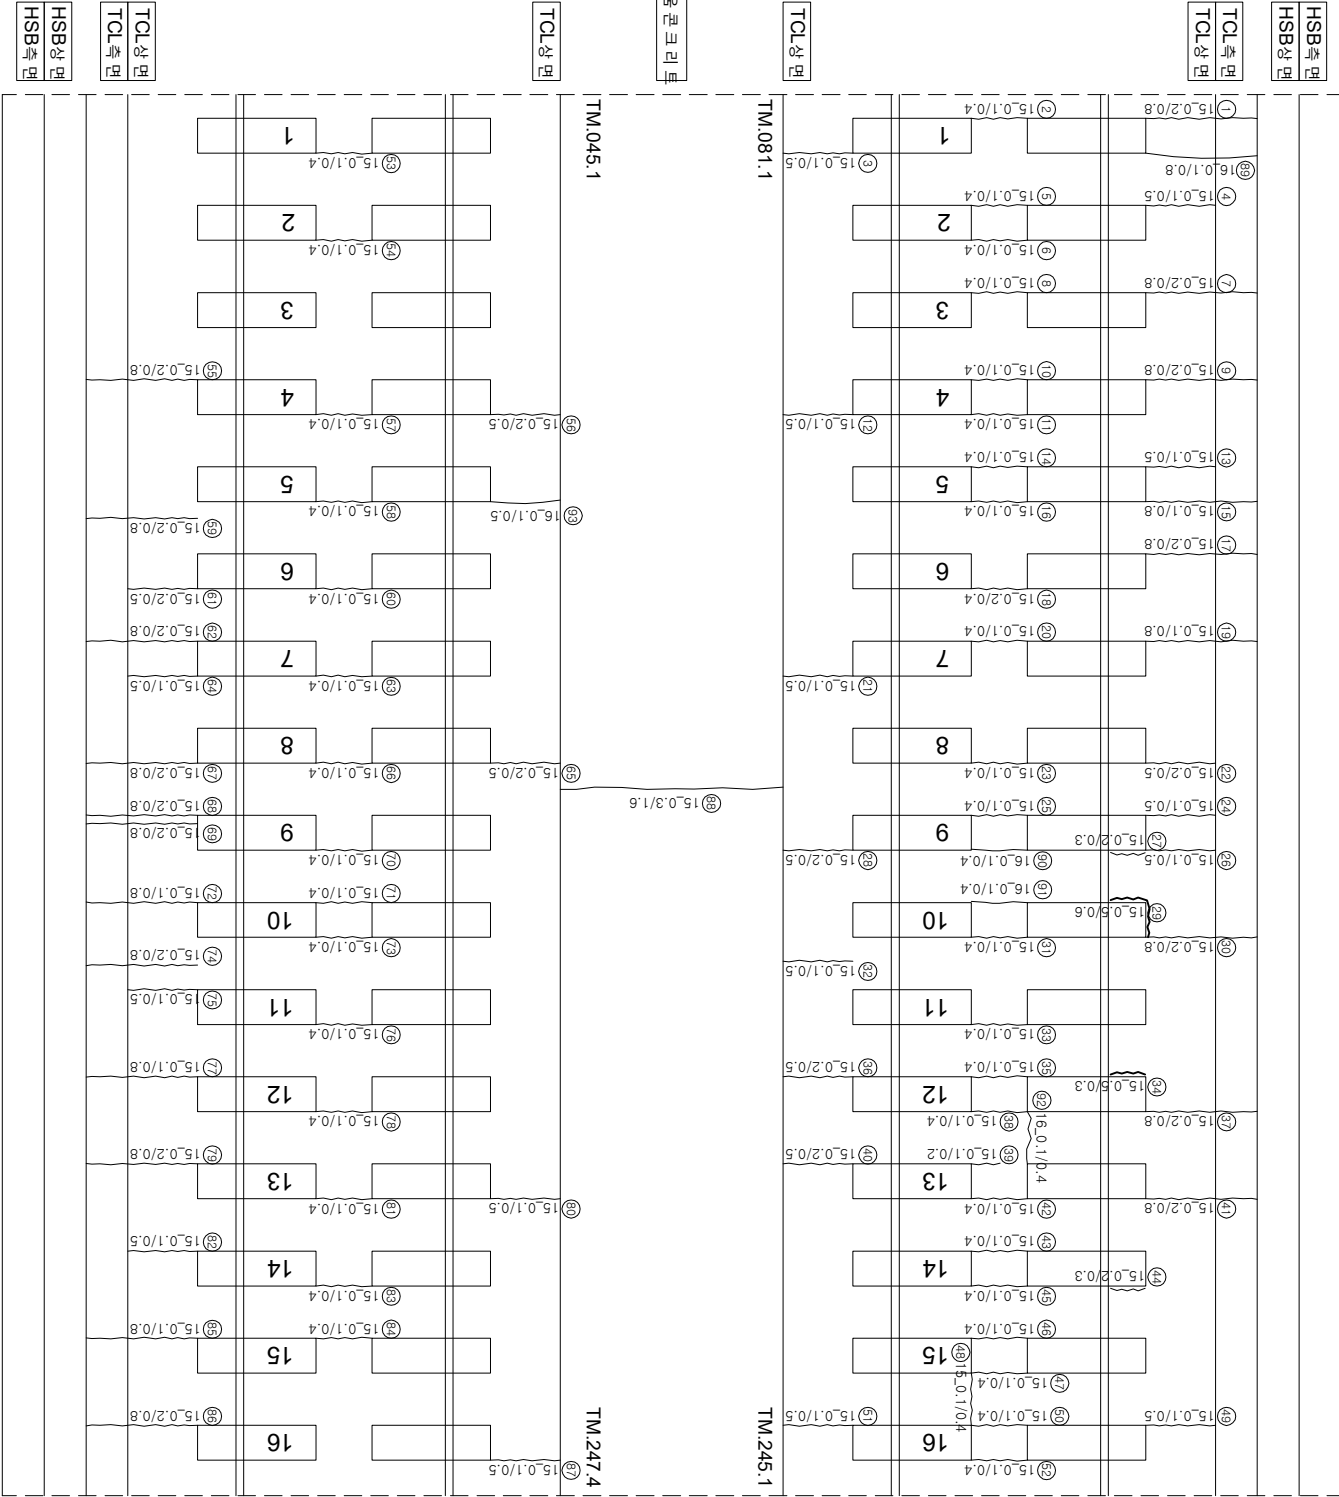

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고		
1	균열	0.2	mm	0.8	m	56	균열	0.2	mm	0.5	m
2	균열	0.1	mm	0.4	m	57	균열	0.1	mm	0.4	m
3	균열	0.1	mm	0.5	m	58	균열	0.1	mm	0.4	m
4	균열	0.1	mm	0.5	m	59	균열	0.2	mm	0.8	m
5	균열	0.1	mm	0.4	m	60	균열	0.1	mm	0.4	m
6	균열	0.1	mm	0.4	m	61	균열	0.2	mm	0.5	m
7	균열	0.2	mm	0.8	m	62	균열	0.2	mm	0.8	m
8	균열	0.1	mm	0.4	m	63	균열	0.1	mm	0.4	m
9	균열	0.2	mm	0.8	m	64	균열	0.1	mm	0.5	m
10	균열	0.1	mm	0.4	m	65	균열	0.2	mm	0.5	m
11	균열	0.1	mm	0.4	m	66	균열	0.1	mm	0.4	m
12	균열	0.1	mm	0.5	m	67	균열	0.2	mm	0.8	m
13	균열	0.1	mm	0.5	m	68	균열	0.2	mm	0.8	m
14	균열	0.1	mm	0.4	m	69	균열	0.2	mm	0.8	m
15	균열	0.1	mm	0.8	m	70	균열	0.1	mm	0.4	m
16	균열	0.1	mm	0.4	m	71	균열	0.1	mm	0.4	m
17	균열	0.2	mm	0.8	m	72	균열	0.1	mm	0.8	m
18	균열	0.2	mm	0.4	m	73	균열	0.1	mm	0.4	m
19	균열	0.1	mm	0.8	m	74	균열	0.2	mm	0.8	m
20	균열	0.1	mm	0.4	m	75	균열	0.1	mm	0.5	m
21	균열	0.1	mm	0.5	m	76	균열	0.1	mm	0.4	m
22	균열	0.2	mm	0.5	m	77	균열	0.1	mm	0.8	m
23	균열	0.1	mm	0.4	m	78	균열	0.1	mm	0.4	m
24	균열	0.1	mm	0.5	m	79	균열	0.2	mm	0.8	m
25	균열	0.1	mm	0.4	m	80	균열	0.1	mm	0.5	m
26	균열	0.1	mm	0.5	m	81	균열	0.1	mm	0.4	m
27	경사부 균열	0.2	mm	0.3	m	82	균열	0.1	mm	0.5	m
28	균열	0.2	mm	0.5	m	83	균열	0.1	mm	0.4	m
29	경사부 균열	0.2	mm	0.6	m	84	균열	0.1	mm	0.4	m
30	균열	0.2	mm	0.8	m	85	균열	0.1	mm	0.8	m
31	균열	0.1	mm	0.4	m	86	균열	0.2	mm	0.8	m
32	균열	0.1	mm	0.5	m	87	균열	0.1	mm	0.5	m
33	균열	0.1	mm	0.4	m	88	균열	0.3	mm	1.6	m
34	경사부 균열	0.5	mm	0.3	m	89	균열	0.1	mm	0.8	m
35	균열	0.1	mm	0.4	m	90	균열	0.1	mm	0.4	m
36	균열	0.2	mm	0.5	m	91	균열	0.1	mm	0.4	m
37	균열	0.2	mm	0.8	m	92	균열	0.1	mm	0.4	m
38	균열	0.1	mm	0.4	m	93	균열	0.1	mm	0.5	m
39	균열	0.1	mm	0.2	m	94					
40	균열	0.2	mm	0.5	m	95					
41	균열	0.2	mm	0.8	m	96					
42	균열	0.1	mm	0.4	m	97					
43	균열	0.1	mm	0.4	m	98					
44	경사부 균열	0.2	mm	0.3	m	99					
45	균열	0.1	mm	0.4	m	100					
46	균열	0.1	mm	0.4	m	101					
47	균열	0.1	mm	0.4	m	102					
48	균열	0.1	mm	0.4	m	103					
49	균열	0.1	mm	0.5	m	104					
50	균열	0.1	mm	0.4	m	105					
51	균열	0.1	mm	0.5	m	106					
52	균열	0.1	mm	0.4	m	107					
53	균열	0.1	mm	0.4	m	108					
54	균열	0.1	mm	0.4	m	109					
55	균열	0.2	mm	0.8	m	110					

시	행	사	물	역	면	물	역	사	관		현
									관	면	
한국철도공사 KOREA RAILROAD									이복영		관
2017년도 호남고속선 오송-광주송정간 콘크리트케도 점검용역									(주) 한국구조물안전연구원 (주) 한국토목안전연구원 (재) 한국건설품질연구원		관
									간음길 김정기 문은석		현
									〰〰		