


한남고속도로 13(47.600~47.610km, L=10.0m)

47K600

47K610

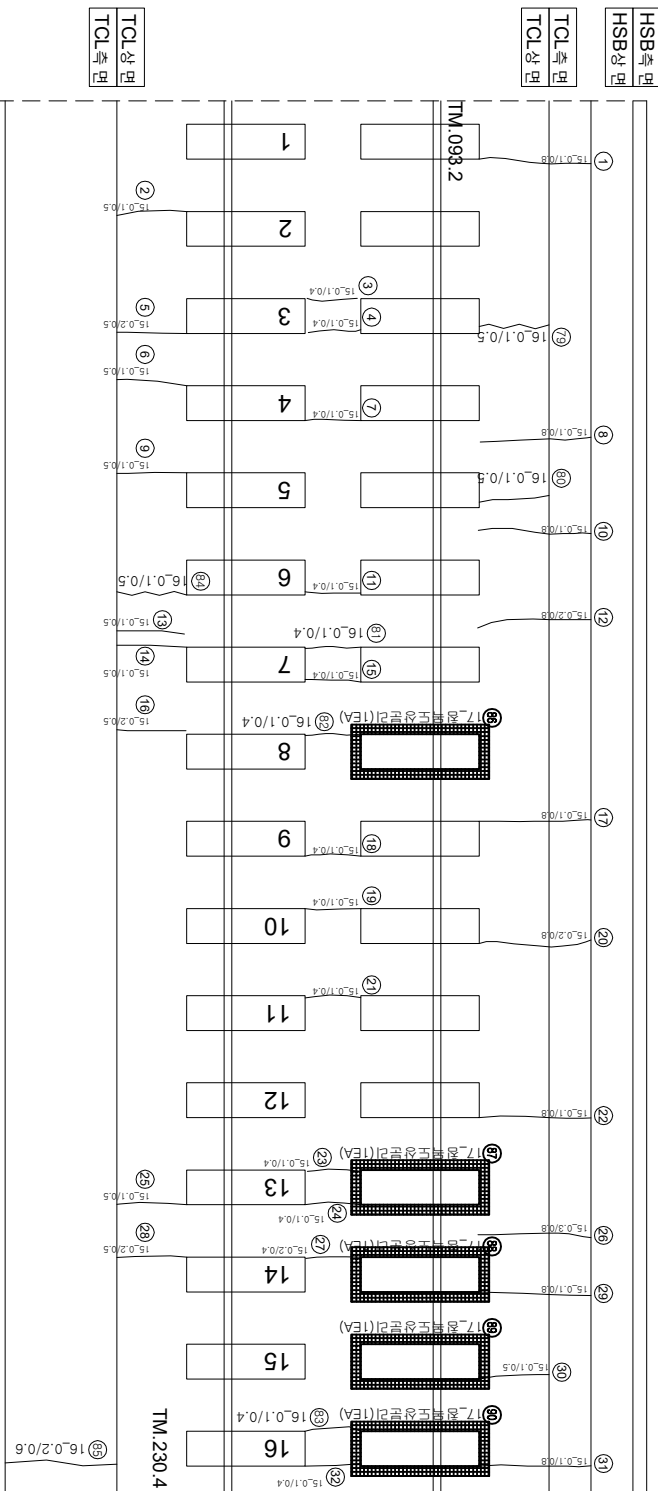

(아
호)

(아
오)

TCL상면	TCL측면
-------	-------

TCL상면	TCL측면
-------	-------

TCL 集团	TCL 产业
--------	--------

TCL	TCL
상	상
면	면

12 (사) (주)

$$\left(\begin{array}{c} 0 \\ 1 \\ 0 \end{array} \right)$$

HSB상면	HSB하면
-------	-------

HSB	HSB
HSB	HSB

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1	0.8	m	56	균열	0.1	0.8	m
2	균열	0.1	0.5	m	57	균열	0.1	0.4	m
3	균열	0.1	0.4	m	58	균열	0.1	0.8	m
4	균열	0.1	0.4	m	59	균열	0.2	0.5	m
5	균열	0.2	0.5	m	60	균열	0.1	0.4	m
6	균열	0.1	0.5	m	61	균열	0.1	0.8	m
7	균열	0.1	0.4	m	62	균열	0.2	0.5	m
8	균열	0.1	0.8	m	63	균열	0.1	0.4	m
9	균열	0.1	0.5	m	64	균열	0.1	0.8	m
10	균열	0.1	0.8	m	65	균열	0.1	0.8	m
11	균열	0.1	0.4	m	66	균열	0.1	0.4	m
12	균열	0.2	0.8	m	67	균열	0.1	0.8	m
13	균열	0.1	0.5	m	68	균열	0.1	0.4	m
14	균열	0.1	0.5	m	69	균열	0.2	0.5	m
15	균열	0.1	0.4	m	70	균열	0.2	0.5	m
16	균열	0.2	0.5	m	71	균열	0.1	0.4	m
17	균열	0.1	0.8	m	72	균열	0.1	0.7	m
18	균열	0.1	0.4	m	73	균열	0.1	0.8	m
19	균열	0.1	0.4	m	74	균열	0.2	0.5	m
20	균열	0.2	0.8	m	75	균열	0.1	0.4	m
21	균열	0.1	0.4	m	76	균열	0.1	0.8	m
22	균열	0.1	0.8	m	77	균열	0.2	0.5	m
23	균열	0.1	0.4	m	78	균열	0.1	0.8	m
24	균열	0.1	0.4	m	79	균열	0.1	0.5	m
25	균열	0.1	0.5	m	80	균열	0.1	0.5	m
26	균열	0.3	0.8	m	81	균열	0.1	0.4	m
27	균열	0.2	0.4	m	82	균열	0.1	0.4	m
28	균열	0.2	0.5	m	83	균열	0.1	0.4	m
29	균열	0.1	0.8	m	84	균열	0.1	0.5	m
30	균열	0.1	0.5	m	85	균열	0.2	0.6	m
31	균열	0.1	0.8	m	86	철근도상분리		10	ea
32	균열	0.1	0.4	m	87	철근도상분리		10	ea
33	균열	0.1	0.5	m	88	철근도상분리		10	ea
34	균열	0.1	0.4	m	89	철근도상분리		10	ea
35	균열	0.1	0.5	m	90	철근도상분리		10	ea
36	균열	0.1	0.4	m	91				
37	균열	0.1	0.8	m	92				
38	균열	0.1	0.8	m	93				
39	균열	0.1	0.8	m	94				
40	균열	0.1	0.8	m	95				
41	균열	0.1	0.5	m	96				
42	균열	0.1	0.4	m	97				
43	균열	0.1	0.4	m	98				
44	균열	0.1	0.8	m	99				
45	균열	0.1	0.5	m	100				
46	균열	0.1	0.5	m	101				
47	균열	0.1	0.4	m	102				
48	균열	0.1	0.4	m	103				
49	균열	0.1	0.8	m	104				
50	균열	0.1	0.5	m	105				
51	균열	0.1	0.5	m	106				
52	균열	0.1	0.4	m	107				
53	균열	0.1	0.8	m	108				
54	균열	0.1	0.5	m	109				
55	균열	0.1	0.4	m	110				

[illegible]