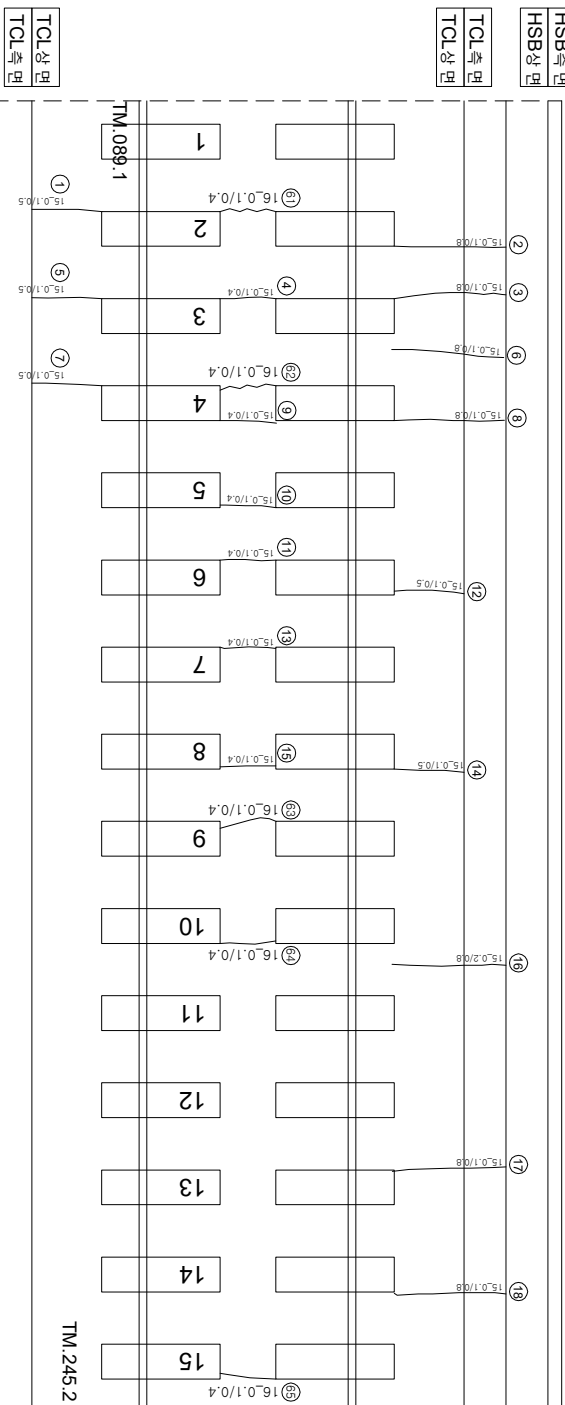



한남고속도로 35(47.820~47.830km, L=10.0m)

47K820

47K83C

(아
호)

(아호)

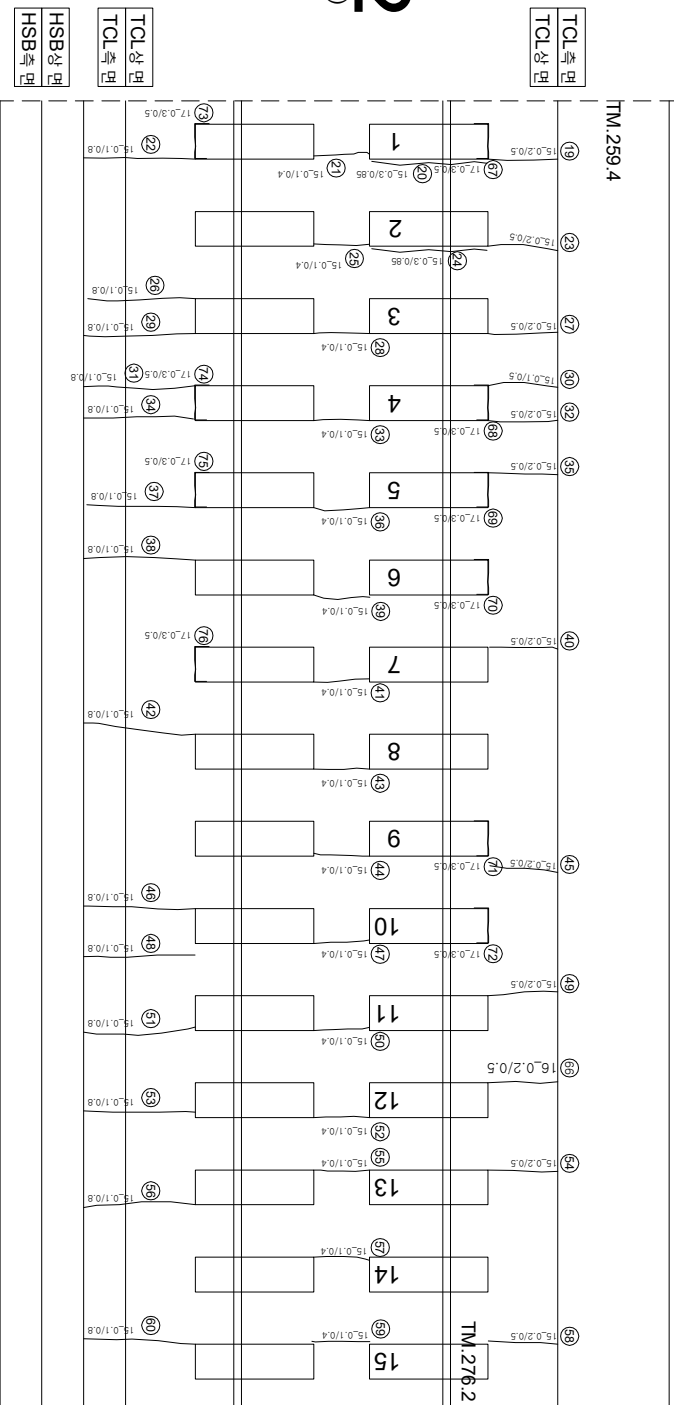

12 (주요)

(0.5점)

연번	순차	폭	연장	비고	연번	순차	폭	연장	비고
1	균열	0.1	0.5	m	56	균열	0.1	0.8	m
2	균열	0.1	0.8	m	57	균열	0.1	0.4	m
3	균열	0.1	0.8	m	58	균열	0.2	0.5	m
4	균열	0.1	0.4	m	59	균열	0.1	0.4	m
5	균열	0.1	0.5	m	60	균열	0.1	0.8	m
6	균열	0.1	0.8	m	61	균열	0.1	0.4	m
7	균열	0.1	0.5	m	62	균열	0.1	0.4	m
8	균열	0.1	0.8	m	63	균열	0.1	0.4	m
9	균열	0.1	0.4	m	64	균열	0.1	0.4	m
10	균열	0.1	0.4	m	65	균열	0.1	0.4	m
11	균열	0.1	0.4	m	66	균열	0.2	0.5	m
12	균열	0.1	0.5	m	67	균열	0.3	0.5	m
13	균열	0.1	0.4	m	68	균열	0.3	0.5	m
14	균열	0.1	0.5	m	69	균열	0.3	0.5	m
15	균열	0.1	0.4	m	70	균열	0.3	0.5	m
16	균열	0.2	0.8	m	71	균열	0.3	0.5	m
17	균열	0.1	0.8	m	72	균열	0.3	0.5	m
18	균열	0.1	0.8	m	73	균열	0.3	0.5	m
19	균열	0.2	0.5	m	74	균열	0.3	0.5	m
20	장폐부 균열	0.3	0.9	m	75	균열	0.3	0.5	m
21	균열	0.1	0.4	m	76	균열	0.3	0.5	m
22	균열	0.1	0.8	m	77				
23	균열	0.2	0.5	m	78				
24	장폐부 균열	0.3	0.9	m	79				
25	균열	0.1	0.4	m	80				
26	균열	0.1	0.8	m	81				
27	균열	0.2	0.5	m	82				
28	균열	0.1	0.4	m	83				
29	균열	0.1	0.8	m	84				
30	균열	0.1	0.5	m	85				
31	균열	0.1	0.8	m	86				
32	균열	0.2	0.5	m	87				
33	균열	0.1	0.4	m	88				
34	균열	0.1	0.8	m	89				
35	균열	0.2	0.5	m	90				
36	균열	0.1	0.4	m	91				
37	균열	0.1	0.8	m	92				
38	균열	0.1	0.8	m	93				
39	균열	0.1	0.4	m	94				
40	균열	0.2	0.5	m	95				
41	균열	0.1	0.4	m	96				
42	균열	0.1	0.8	m	97				
43	균열	0.1	0.4	m	98				
44	균열	0.1	0.4	m	99				
45	균열	0.2	0.5	m	100				
46	균열	0.1	0.8	m	101				
47	균열	0.1	0.4	m	102				
48	균열	0.1	0.8	m	103				
49	균열	0.2	0.5	m	104				
50	균열	0.1	0.4	m	105				
51	균열	0.1	0.8	m	106				
52	균열	0.1	0.4	m	107				
53	균열	0.1	0.8	m	108				
54	균열	0.2	0.5	m	109				
55	균열	0.1	0.4	m	110				

시	행	사	용	역	영	사	단		
							과업 책임지	장 소	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정리 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간윤강 김경기 문석기	영남	 0220 (0.3mm이하 : 흑색)	 점도도상판리	 재료판리
							 0420 (0.3mm초과 0.5mm이하 : 황색)	 영상	 철근노출
							 0620 (0.5mm초과 1.0mm미만 : 적색)	 바리,바라,파손	 누수수온부
							 1020 (1.0mm이상 : 홍색)	 변태	 시공이음판리,홍판리