


한남고속도로 38(47.850~47.860km, L=10.0m)

47K850

47K860

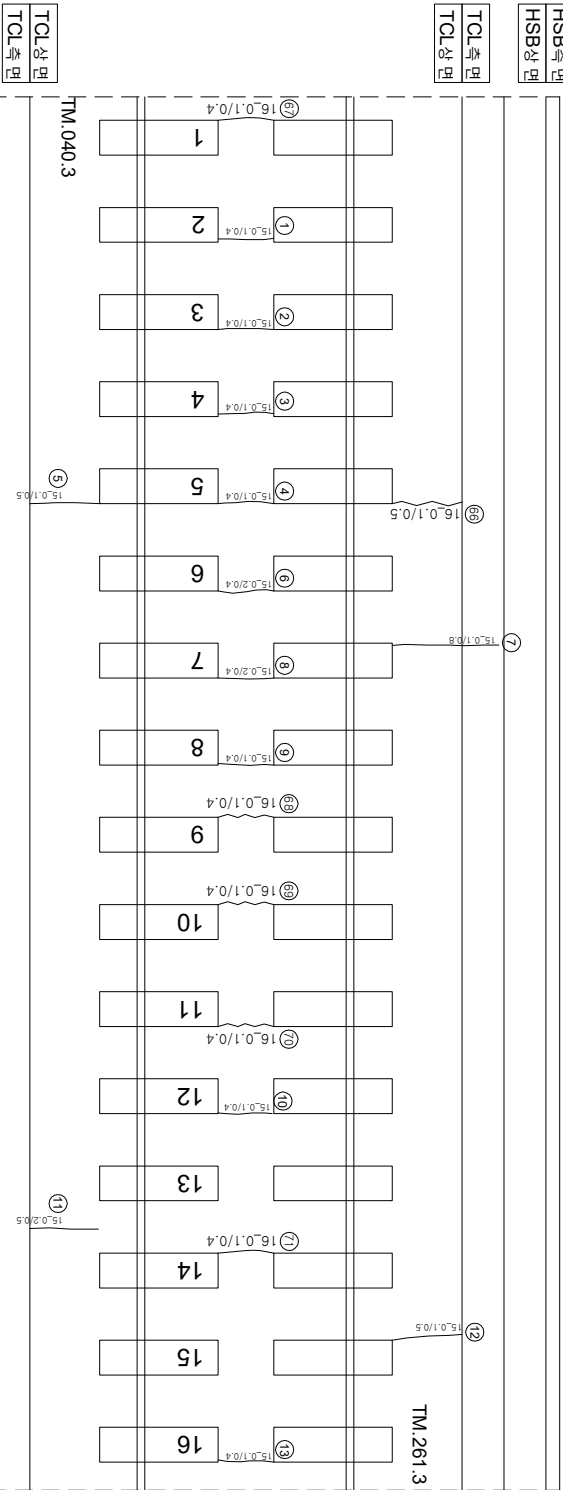


(아
호)

(아
오)

TCL상면	TCL추면
-------	-------

TCL상	TCL상
TCL상	TCL상

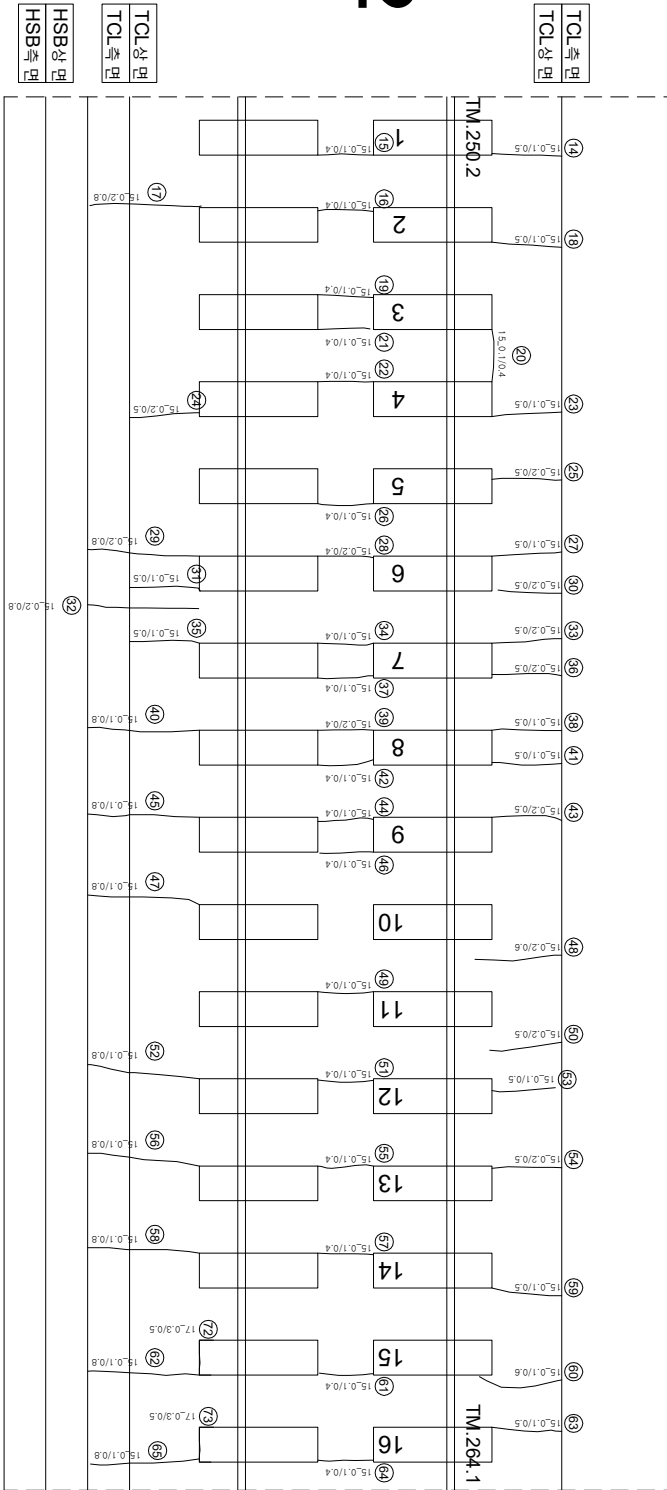

2주
0호

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

HSB상	HSB상
HSB하	HSB하

HSB	HSB
HSB	HSB

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열 0.1	0.4 m			56	균열 0.1	0.8 m		
2	균열 0.1	0.4 m			57	균열 0.1	0.4 m		
3	균열 0.1	0.4 m			58	균열 0.1	0.8 m		
4	균열 0.1	0.4 m			59	균열 0.1	0.5 m		
5	균열 0.1	0.5 m			60	균열 0.1	0.6 m		
6	균열 0.2	0.4 m			61	균열 0.1	0.4 m		
7	균열 0.1	0.8 m			62	균열 0.1	0.8 m		
8	균열 0.2	0.4 m			63	균열 0.1	0.5 m		
9	균열 0.1	0.4 m			64	균열 0.1	0.4 m		
10	균열 0.1	0.4 m			65	균열 0.1	0.8 m		
11	균열 0.2	0.5 m			66	균열 0.1	0.5 m		
12	균열 0.1	0.5 m			67	균열 0.1	0.4 m		
13	균열 0.1	0.4 m			68	균열 0.1	0.4 m		
14	균열 0.1	0.5 m			69	균열 0.1	0.4 m		
15	균열 0.1	0.4 m			70	균열 0.1	0.4 m		
16	균열 0.1	0.4 m			71	균열 0.1	0.4 m		
17	균열 0.2	0.8 m			72	균열 0.3	0.5 m	신규	
18	균열 0.1	0.5 m			73	균열 0.3	0.5 m	신규	
19	균열 0.1	0.4 m			74				
20	균열 0.1	0.4 m			75				
21	균열 0.1	0.4 m			76				
22	균열 0.1	0.4 m			77				
23	균열 0.1	0.5 m			78				
24	균열 0.2	0.5 m			79				
25	균열 0.2	0.5 m			80				
26	균열 0.1	0.4 m			81				
27	균열 0.1	0.5 m			82				
28	균열 0.2	0.4 m			83				
29	균열 0.2	0.8 m			84				
30	균열 0.2	0.5 m			85				
31	균열 0.1	0.5 m			86				
32	균열 0.2	0.8 m			87				
33	균열 0.2	0.5 m			88				
34	균열 0.1	0.4 m			89				
35	균열 0.1	0.5 m			90				
36	균열 0.2	0.5 m			91				
37	균열 0.1	0.4 m			92				
38	균열 0.1	0.5 m			93				
39	균열 0.2	0.4 m			94				
40	균열 0.1	0.8 m			95				
41	균열 0.1	0.5 m			96				
42	균열 0.1	0.4 m			97				
43	균열 0.2	0.5 m			98				
44	균열 0.1	0.4 m			99				
45	균열 0.1	0.8 m			100				
46	균열 0.1	0.4 m			101				
47	균열 0.1	0.8 m			102				
48	균열 0.3	0.6 m			103				
49	균열 0.1	0.4 m			104				
50	균열 0.2	0.5 m			105				
51	균열 0.1	0.4 m			106				
52	균열 0.1	0.8 m			107				
53	균열 0.1	0.5 m			108				
54	균열 0.2	0.5 m			109				
55	균열 0.1	0.4 m			110				

시	행	사	용	역	영	사	단		
							과업 책임지	장 소	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간 윤 강 김 경 기 문 준 기	영원	 02220 (0.3mm이하 : 흑색)	 점도도상판리	 재료판리
							 04220 (0.3mm초과 0.5mm이하 : 황색)	 영상	 철근노출
							 06220 (0.5mm초과 1.0mm미만 : 적색)	 바리,바라,파손	 누수수온부
							 10220 (1.0mm이상 : 홍색)	 변태	 시공이음판리,홍판리