


한남고속선 서편코 - 토양노반 - 26(48.240~48.250km, L=10m)

48K240

48K250

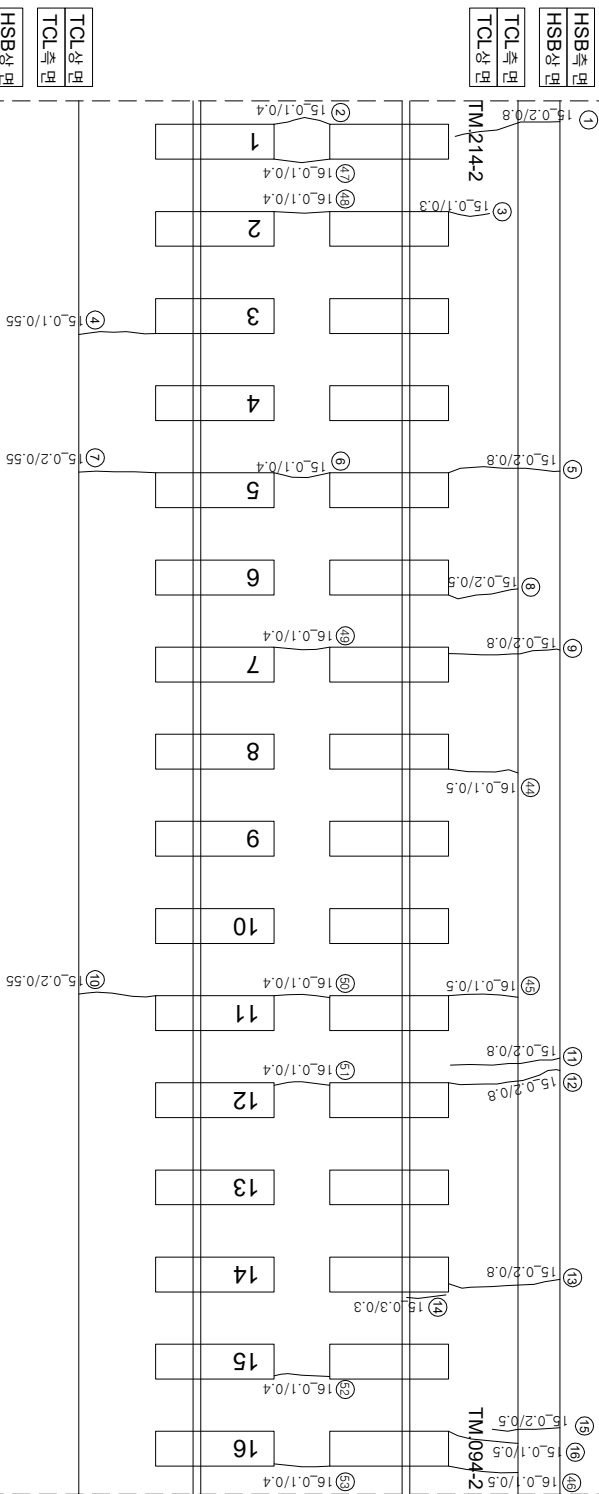

(아)

(아호)

TCL상면	HSB상면
TCL측면	HSB측면

HSB 銀行


채움콘크리트

HSB	HSB
HSB	HSB

HSB 01 01

TCL 상면	
--------	--

TCL상면

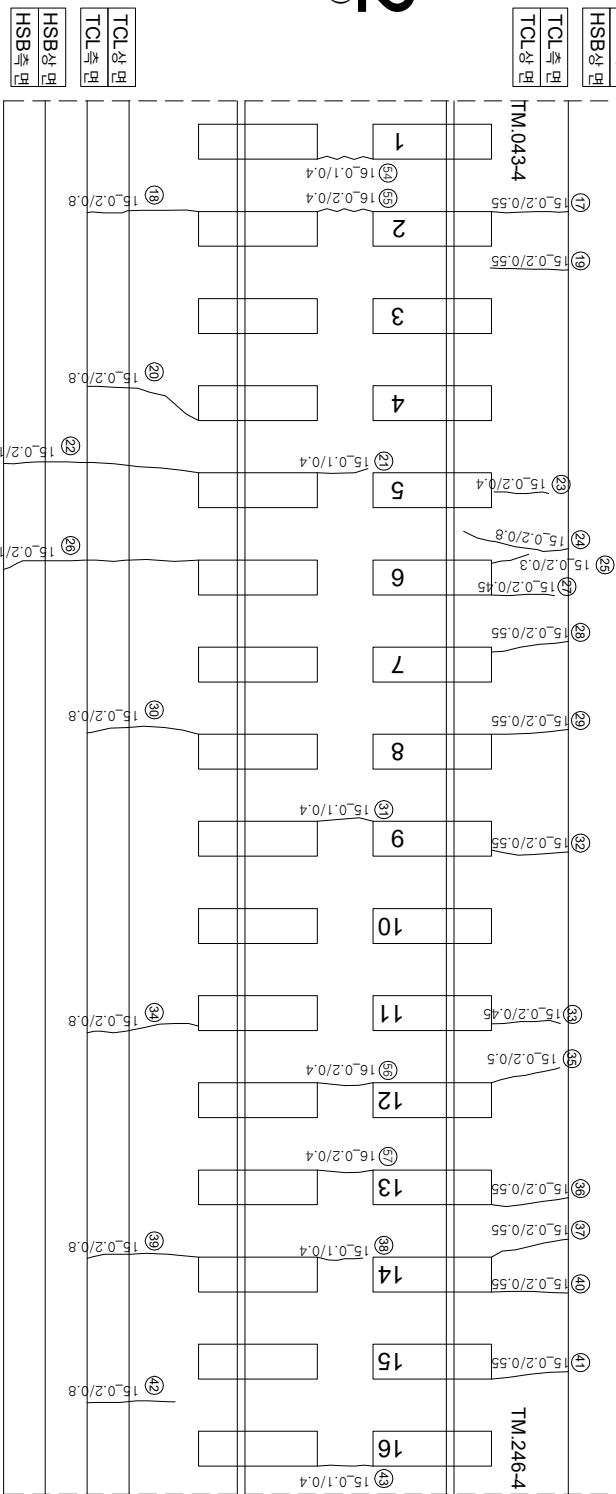

12 (주요)

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

HSB상면	HSB측면
TCL상면	TCL측면

HSB 2017

HSB 2017

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.8 m		56	균열	0.2 mm	0.4 m	
2	균열	0.1 mm	0.4 m		57	균열	0.2 mm		
3	균열	0.1 mm	0.3 m		58				
4	균열	0.1 mm	0.55 m		59				
5	균열	0.2 mm	0.8 m		60				
6	균열	0.1 mm	0.4 m		61				
7	균열	0.2 mm	0.55 m		62				
8	균열	0.2 mm	0.5 m		63				
9	균열	0.2 mm	0.55 m		64				
10	균열	0.2 mm	0.55 m		65				
11	균열	0.2 mm	0.8 m		66				
12	균열	0.2 mm	0.8 m		67				
13	균열	0.2 mm	0.8 m		68				
14	경계부 균열	0.3 mm	0.3 m		69				
15	균열	0.3 mm	0.3 m		70				
16	균열	0.2 mm	0.2 m		71				
17	균열	0.2 mm	0.55 m		72				
18	균열	0.2 mm	0.8 m		73				
19	균열	0.2 mm	0.55 m		74				
20	균열	0.2 mm	0.8 m		75				
21	균열	0.1 mm	0.4 m		76				
22	균열	0.2 mm	1.5 m		77				
23	균열	0.2 mm	0.4 m		78				
24	균열	0.2 mm	0.8 m		79				
25	균열	0.2 mm	0.3 m		80				
26	균열	0.2 mm	1.5 m		81				
27	균열	0.2 mm	0.45 m		82				
28	균열	0.2 mm	0.55 m		83				
29	균열	0.2 mm	0.55 m		84				
30	균열	0.2 mm	0.8 m		85				
31	균열	0.2 mm	0.55 m		86				
32	균열	0.2 mm	0.45 m		87				
33	균열	0.2 mm	0.8 m		88				
34	균열	0.2 mm	0.5 m		89				
35	균열	0.2 mm	0.55 m		90				
36	균열	0.2 mm	0.55 m		91				
37	균열	0.2 mm	0.55 m		92				
38	균열	0.1 mm	0.4 m		93				
39	균열	0.2 mm	0.8 m		94				
40	균열	0.2 mm	0.55 m		95				
41	균열	0.2 mm	0.55 m		96				
42	균열	0.2 mm	0.8 m		97				
43	균열	0.1 mm	0.4 m		98				
44	균열	0.1 mm	0.5 m		99				
45	균열	0.1 mm	0.5 m		100				
46	균열	0.1 mm	0.5 m		101				
47	균열	0.1 mm	0.4 m		102				
48	균열	0.1 mm	0.4 m		103				
49	균열	0.1 mm	0.4 m		104				
50	균열	0.1 mm	0.4 m		105				
51	균열	0.1 mm	0.4 m		106				
52	균열	0.1 mm	0.4 m		107				
53	균열	0.1 mm	0.4 m		108				
54	균열	0.1 mm	0.4 m		109				
55	균열	0.2 mm	0.4 m		110				

[illegible]