


한남고속선 서평교 - 토아노반 - 32(48.300~48.310km, L=10m)

48K300

48K310

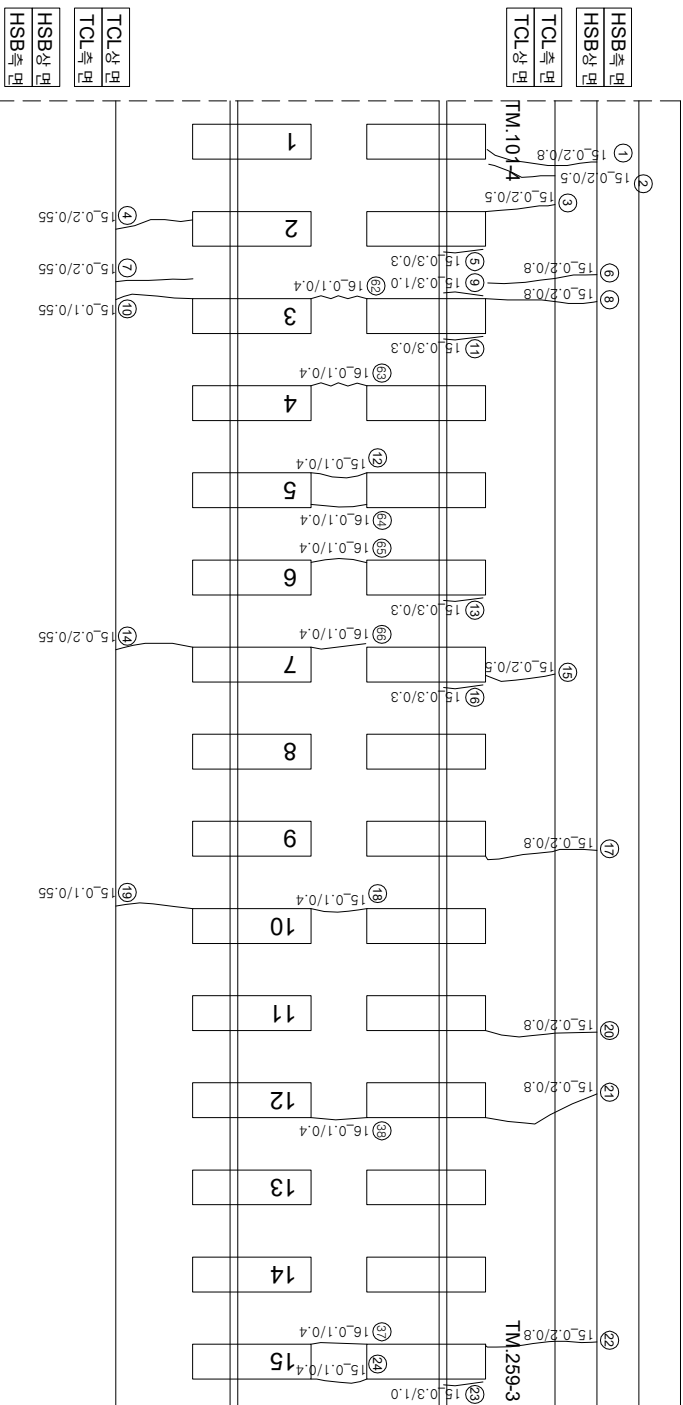

(아)

(와
0와
)

TCL상면	HSB상면
TCL측면	HSB측면

HSB 銀行

HSB 銀行

채움콘크리트

HSB 銀行

HSB 銀行

HSB 銀行

TCL상면

TCL상면

TCL상면

12 (주요)

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

TCL상면	HSB상면
TCL측면	HSB측면

HSB 銀行

HSB 銀行

연번	순상	특	연장	비고	연번	순상	특	연장	비고
1	균열 0.2	mm 0.8	m		56	균열 0.2	mm 0.5	m	
2	균열 0.2	mm 0.5	m		57	균열 0.1	mm 0.3	m	
3	균열 0.2	mm 0.5	m		58	균열 0.1	mm 0.4	m	
4	균열 0.2	mm 0.55	m		59	균열 0.1	mm 0.4	m	
5	균열부 균열 0.3	mm 0.3	m		60	균열 0.1	mm 0.55	m	
6	균열 0.2	mm 0.8	m		61	균열 0.1	mm 0.4	m	
7	균열 0.2	mm 0.55	m		62	균열 0.1	mm 0.4	m	
8	균열 0.2	mm 0.8	m		63	균열 0.1	mm 0.4	m	
9	균열부 균열 0.3	mm 1.0	m	같이줄가	64	균열 0.1	mm 0.4	m	
10	균열 0.1	mm 0.55	m		65	균열 0.1	mm 0.4	m	
11	균열부 균열 0.3	mm 0.3	m		66	균열 0.1	mm 0.4	m	
12	균열 0.1	mm 0.4	m		67	균열도상판리			
13	균열부 균열 0.3	mm 0.3	m		68	균열도상판리			
14	균열 0.2	mm 0.55	m		69				
15	균열 0.2	mm 0.5	m		70				
16	균열부 균열 0.3	mm 0.3	m		71				
17	균열 0.2	mm 0.8	m		72				
18	균열 0.1	mm 0.4	m		73				
19	균열 0.1	mm 0.55	m		74				
20	균열 0.2	mm 0.8	m		75				
21	균열 0.2	mm 0.8	m		76				
22	균열 0.2	mm 0.8	m		77				
23	균열부 균열 0.3	mm 1.0	m	같이줄가	78				
24	균열 0.1	mm 0.4	m		79				
25	균열 0.2	mm 0.55	m		80				
26	균열 0.2	mm 0.55	m		81				
27	균열 0.1	mm 0.4	m		82				
28	균열 0.2	mm 1.5	m		83				
29	균열 0.1	mm 0.55	m		84				
30	균열 0.1	mm 0.4	m		85				
31	균열 0.1	mm 0.75	m		86				
32	균열 0.2	mm 0.7	m		87				
33	균열 0.1	mm 0.55	m		88				
34	균열 0.2	mm 0.55	m		89				
35	균열 0.1	mm 0.4	m		90				
36	균열 0.1	mm 0.4	m		91				
37	균열 0.1	mm 0.4	m		92				
38	균열 0.1	mm 0.4	m		93				
39	균열 0.2	mm 0.55	m		94				
40	균열 0.2	mm 0.8	m		95				
41	균열 0.1	mm 0.4	m		96				
42	균열 0.1	mm 0.65	m		97				
43	균열 0.1	mm 0.4	m		98				
44	균열 0.2	mm 0.8	m		99				
45	균열 0.1	mm 0.55	m		100				
46	균열 0.1	mm 0.55	m		101				
47	균열 0.2	mm 0.8	m		102				
48	균열 0.2	mm 0.65	m		103				
49	균열 0.2	mm 0.8	m		104				
50	균열 0.2	mm 0.55	m		105				
51	균열 0.1	mm 0.4	m		106				
52	균열 0.1	mm 0.55	m		107				
53	균열 0.1	mm 0.4	m		108				
54	균열 0.2	mm 1	m		109				
55	균열 0.1	mm 0.55	m		110				

시	행	사	영	역	영	영	역	사	인		장	아	지	단		
									과	인					지	분
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 편크리트캐도 점경영역						(주)한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원	이	박	영	간원강 김경기 윤석기	영	 0220 (0.3m이하 : 흑색)	점목도상문리	
														 0420 (0.3m초과 0.5m이하 : 황색)	양상	
														 0620 (0.5m초과 1.0m이하 : 적색)	바리,바리,파손	
														 1020 (1.0m이상 : 분홍색)	백태	
														 0220	차로이음문리,종문리	