


장구교\_토공노반\_104(51.350~51.360km, L=10m)

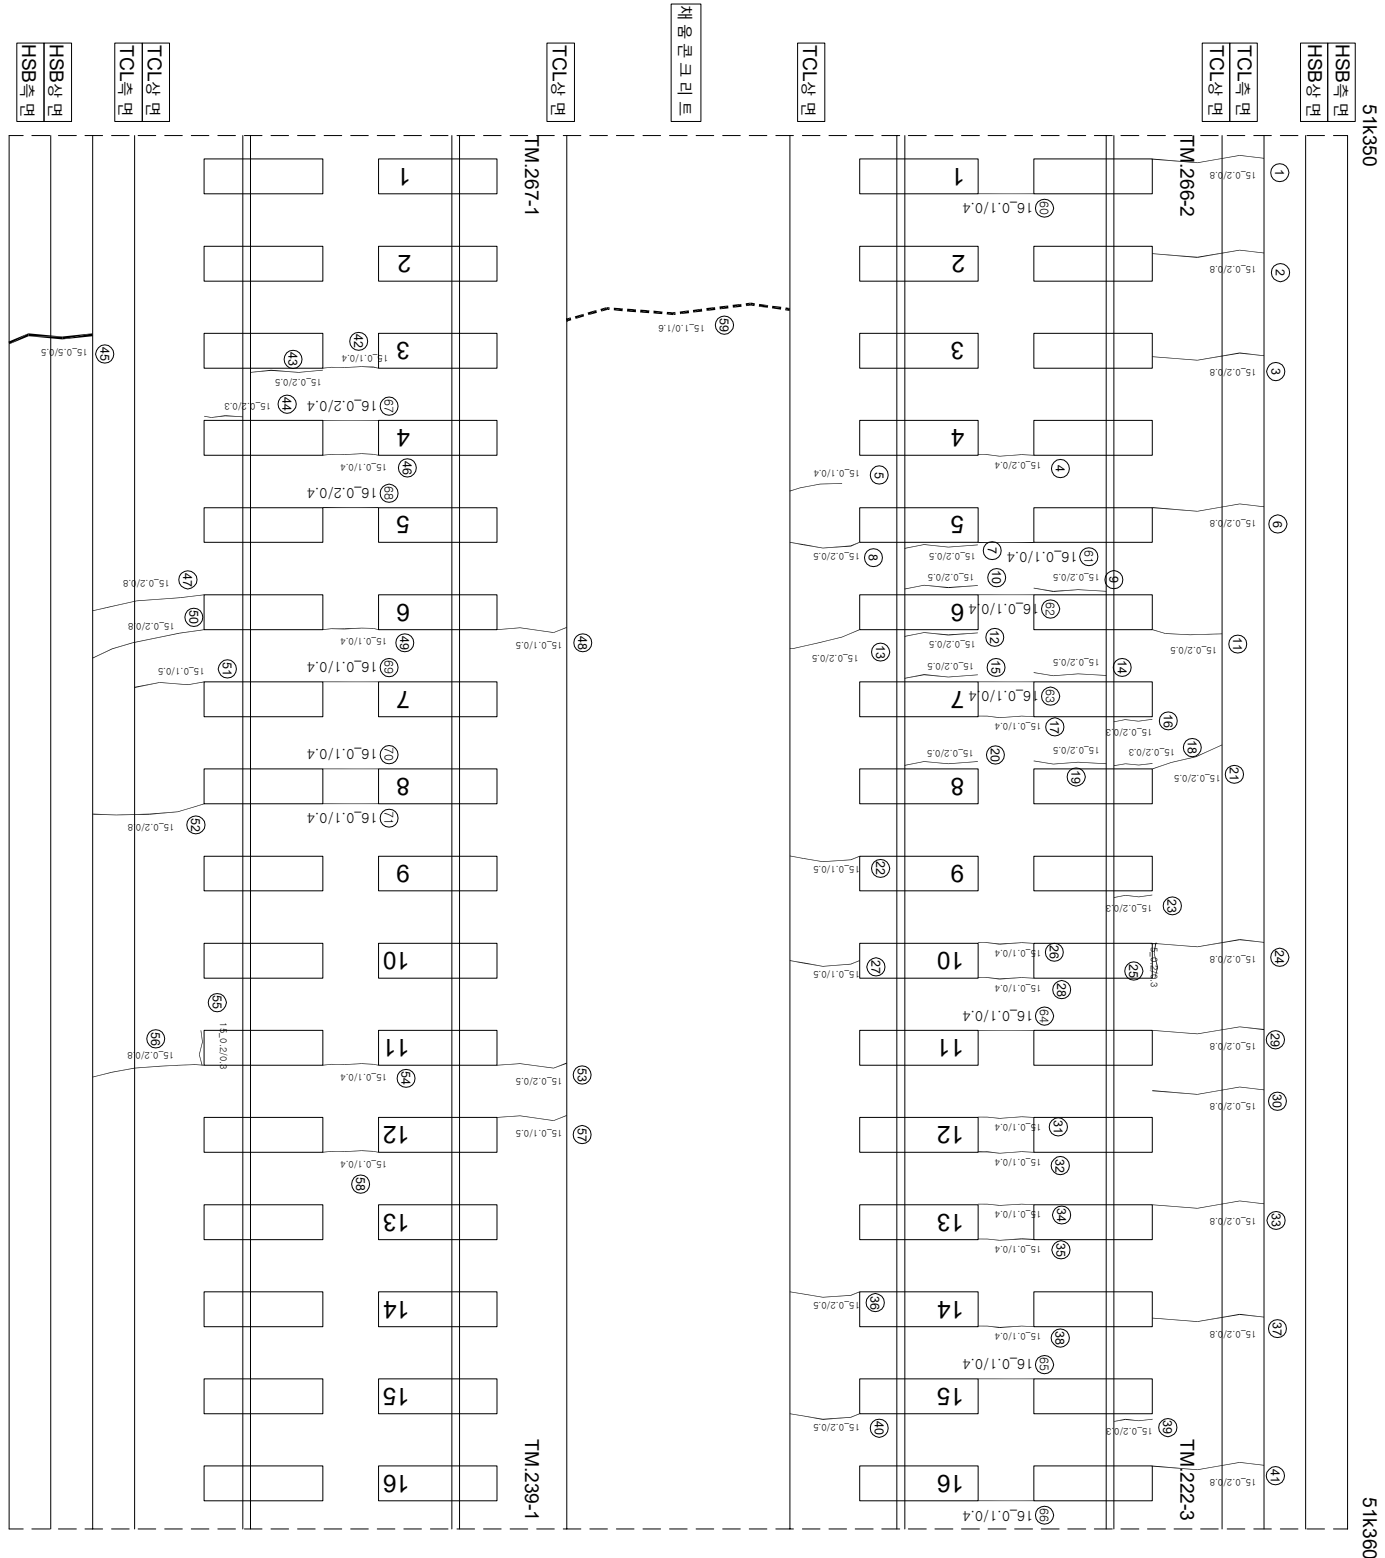

| 연번 | 순상     | 폭      | 연장    | 비고 | 연번  | 순상     | 폭      | 연장    | 비고 |
|----|--------|--------|-------|----|-----|--------|--------|-------|----|
| 1  | 균열     | 0.2 mm | 0.8 m |    | 55  | 경계부 균열 | 0.2 mm | 0.3 m |    |
| 2  | 균열     | 0.2 mm | 0.8 m |    | 56  | 균열     | 0.2 mm | 0.8 m |    |
| 3  | 균열     | 0.2 mm | 0.8 m |    | 57  | 균열     | 0.1 mm | 0.5 m |    |
| 4  | 균열     | 0.2 mm | 0.4 m |    | 58  | 균열     | 0.1 mm | 0.4 m |    |
| 5  | 균열     | 0.1 mm | 0.4 m |    | 59  | 균열     | 1.0 mm | 1.6 m |    |
| 6  | 균열     | 0.2 mm | 0.8 m |    | 60  | 균열     | 0.1 mm | 0.4 m |    |
| 7  | 경계부 균열 | 0.2 mm | 0.5 m |    | 61  | 균열     | 0.1 mm | 0.4 m |    |
| 8  | 균열     | 0.2 mm | 0.5 m |    | 62  | 균열     | 0.1 mm | 0.4 m |    |
| 9  | 경계부 균열 | 0.2 mm | 0.5 m |    | 63  | 균열     | 0.1 mm | 0.4 m |    |
| 10 | 경계부 균열 | 0.2 mm | 0.5 m |    | 64  | 균열     | 0.1 mm | 0.4 m |    |
| 11 | 균열     | 0.2 mm | 0.5 m |    | 65  | 균열     | 0.1 mm | 0.4 m |    |
| 12 | 경계부 균열 | 0.2 mm | 0.5 m |    | 66  | 균열     | 0.1 mm | 0.4 m |    |
| 13 | 균열     | 0.2 mm | 0.5 m |    | 67  | 균열     | 0.2 mm | 0.4 m |    |
| 14 | 경계부 균열 | 0.2 mm | 0.5 m |    | 68  | 균열     | 0.2 mm | 0.4 m |    |
| 15 | 경계부 균열 | 0.2 mm | 0.5 m |    | 69  | 균열     | 0.1 mm | 0.4 m |    |
| 16 | 경계부 균열 | 0.2 mm | 0.3 m |    | 70  | 균열     | 0.1 mm | 0.4 m |    |
| 17 | 균열     | 0.1 mm | 0.4 m |    | 71  | 균열     | 0.1 mm | 0.4 m |    |
| 18 | 경계부 균열 | 0.2 mm | 0.3 m |    | 72  |        |        |       |    |
| 19 | 경계부 균열 | 0.2 mm | 0.5 m |    | 73  |        |        |       |    |
| 20 | 경계부 균열 | 0.2 mm | 0.5 m |    | 74  |        |        |       |    |
| 21 | 균열     | 0.2 mm | 0.5 m |    | 75  |        |        |       |    |
| 22 | 균열     | 0.1 mm | 0.5 m |    | 76  |        |        |       |    |
| 23 | 경계부 균열 | 0.2 mm | 0.3 m |    | 77  |        |        |       |    |
| 24 | 균열     | 0.2 mm | 0.8 m |    | 78  |        |        |       |    |
| 25 | 경계부 균열 | 0.2 mm | 0.3 m |    | 79  |        |        |       |    |
| 26 | 균열     | 0.1 mm | 0.4 m |    | 80  |        |        |       |    |
| 27 | 균열     | 0.1 mm | 0.5 m |    | 81  |        |        |       |    |
| 28 | 균열     | 0.1 mm | 0.4 m |    | 82  |        |        |       |    |
| 29 | 균열     | 0.2 mm | 0.8 m |    | 83  |        |        |       |    |
| 30 | 균열     | 0.2 mm | 0.8 m |    | 84  |        |        |       |    |
| 31 | 균열     | 0.1 mm | 0.4 m |    | 85  |        |        |       |    |
| 32 | 균열     | 0.1 mm | 0.4 m |    | 86  |        |        |       |    |
| 33 | 균열     | 0.2 mm | 0.8 m |    | 87  |        |        |       |    |
| 34 | 균열     | 0.1 mm | 0.4 m |    | 88  |        |        |       |    |
| 35 | 균열     | 0.1 mm | 0.4 m |    | 89  |        |        |       |    |
| 36 | 균열     | 0.2 mm | 0.5 m |    | 90  |        |        |       |    |
| 37 | 균열     | 0.2 mm | 0.8 m |    | 91  |        |        |       |    |
| 38 | 균열     | 0.1 mm | 0.4 m |    | 92  |        |        |       |    |
| 39 | 경계부 균열 | 0.2 mm | 0.3 m |    | 93  |        |        |       |    |
| 40 | 균열     | 0.2 mm | 0.5 m |    | 94  |        |        |       |    |
| 41 | 균열     | 0.2 mm | 0.8 m |    | 95  |        |        |       |    |
| 42 | 균열     | 0.1 mm | 0.4 m |    | 96  |        |        |       |    |
| 43 | 경계부 균열 | 0.2 mm | 0.5 m |    | 97  |        |        |       |    |
| 44 | 경계부 균열 | 0.2 mm | 0.3 m |    | 98  |        |        |       |    |
| 45 | 균열     | 0.5 mm | 0.5 m |    | 99  |        |        |       |    |
| 46 | 균열     | 0.1 mm | 0.4 m |    | 100 |        |        |       |    |
| 47 | 균열     | 0.2 mm | 0.8 m |    | 101 |        |        |       |    |
| 48 | 균열     | 0.1 mm | 0.5 m |    | 102 |        |        |       |    |
| 49 | 균열     | 0.1 mm | 0.4 m |    | 103 |        |        |       |    |
| 50 | 균열     | 0.2 mm | 0.8 m |    | 104 |        |        |       |    |
| 51 | 균열     | 0.1 mm | 0.5 m |    | 105 |        |        |       |    |
| 52 | 균열     | 0.2 mm | 0.8 m |    | 106 |        |        |       |    |
| 53 | 균열     | 0.2 mm | 0.5 m |    | 107 |        |        |       |    |
| 54 | 균열     | 0.1 mm | 0.4 m |    | 108 |        |        |       |    |

| 시행사                      |        | 영역                                |                                               | 영역사 |                   | 이력영 |                             | 구분       |                                                                                     | 구분         |                                                                                     |
|--------------------------|--------|-----------------------------------|-----------------------------------------------|-----|-------------------|-----|-----------------------------|----------|-------------------------------------------------------------------------------------|------------|-------------------------------------------------------------------------------------|
| KORAIL<br>KOREA RAILROAD | 한국철도공사 | 2017년도 호남고속선 오송-광주승정간 편곡리트캐도 정경영역 | (주)한국구조물안전연구원<br>(주)한국도로안전연구원<br>(재)한국건설품질연구원 | 이력영 | 간영강<br>김정기<br>윤석기 | 영역  | 0220 (0.3mm이하 : 황색)         | 한목도상본리   |  | 재료본리       |  |
|                          |        |                                   |                                               |     |                   |     | 0420 (0.3mm초과 0.5mm이하 : 황색) | 양상       |  | 철근노출       |  |
|                          |        |                                   |                                               |     |                   |     | 0620 (0.5mm초과 1.0mm미만 : 적색) | 바닥,벽면,표면 |  | 누수,슬럼부     |  |
|                          |        |                                   |                                               |     |                   |     | 1020 (1.0mm이상 : 분홍색)        | 백태       |  | 시공이음본리,종본리 |  |
|                          |        |                                   |                                               |     |                   |     | 1220 (1.0mm이상 : 분홍색)        | 백태       |  | 시공이음본리,종본리 |  |