


호남고속선 정지 고가_585(60.989~60.996km, S113-3)

60K989

60K996
113 SPAN-3

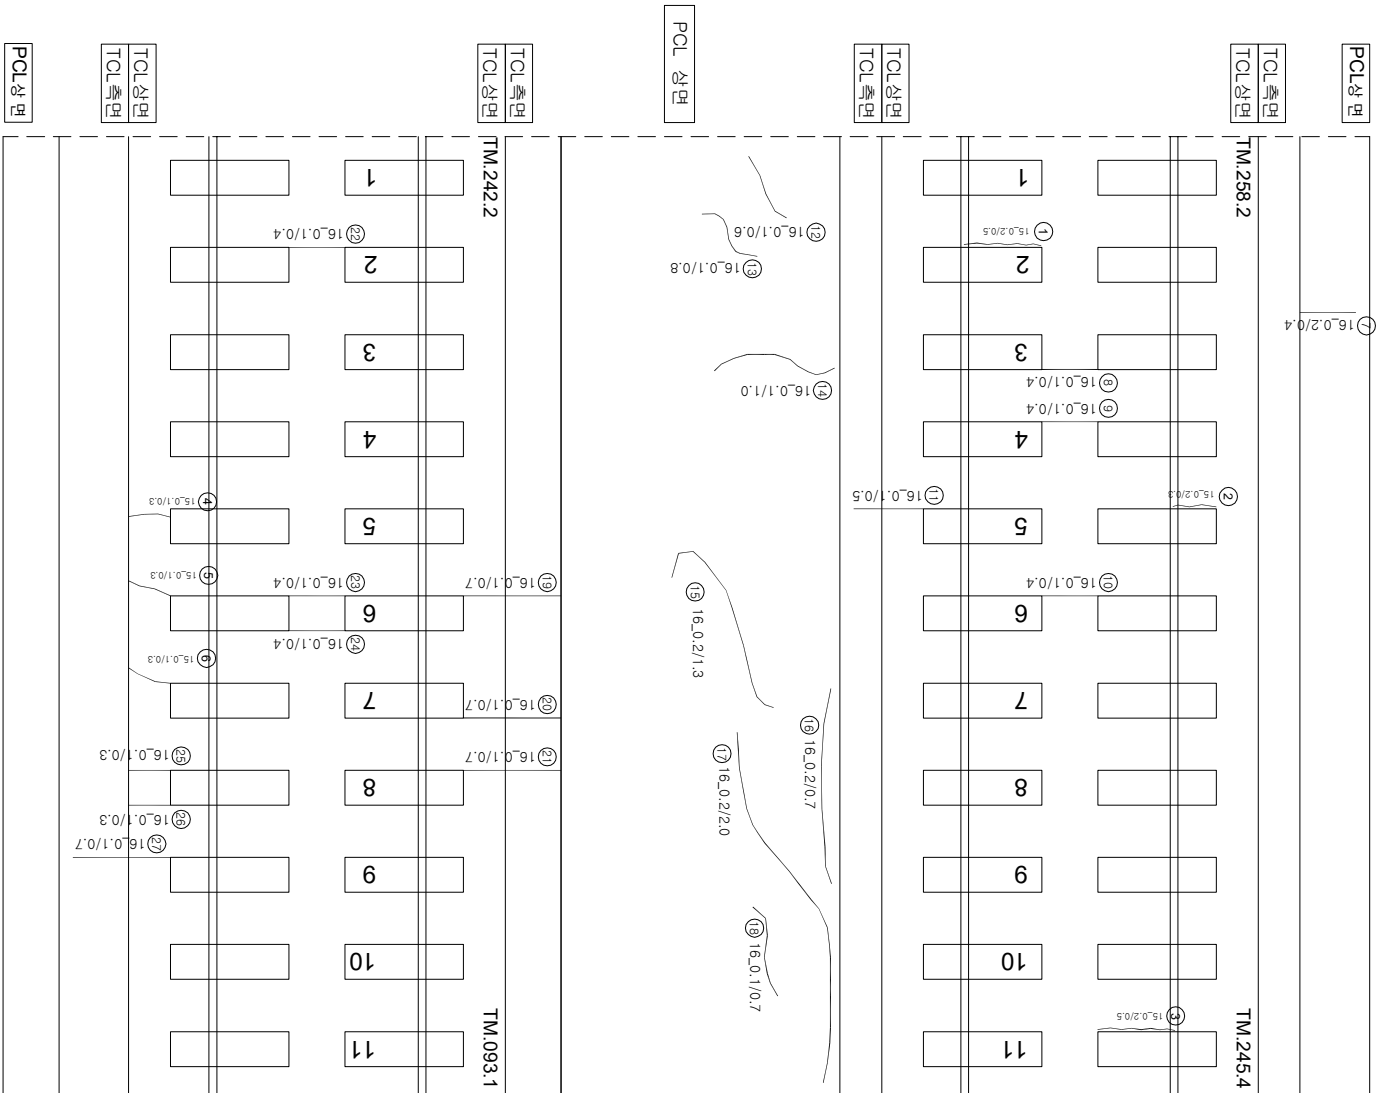

번호	산상	폭	연장	비고	번호	산상	폭	연장	비고
1	경계부 군열	0.2 mm	0.5 m		55				
2	경계부 군열	0.2 mm	0.3 m		56				
3	경계부 군열	0.2 mm	0.5 m		57				
4	군열	0.1 mm	0.3 m		58				
5	군열	0.1 mm	0.3 m		59				
6	군열	0.1 mm	0.3 m		60				
7	군열	0.2 mm	0.4 m		61				
8	군열	0.1 mm	0.4 m		62				
9	군열	0.1 mm	0.4 m		63				
10	군열	0.1 mm	0.4 m		64				
11	군열	0.1 mm	0.5 m		65				
12	군열	0.1 mm	0.6 m		66				
13	군열	0.1 mm	0.8 m		67				
14	군열	0.1 mm	1.0 m		68				
15	군열	0.2 mm	1.3 m		69				
16	군열	0.2 mm	0.7 m		70				
17	군열	0.2 mm	2.0 m		71				
18	군열	0.1 mm	0.7 m		72				
19	군열	0.1 mm	0.7 m		73				
20	군열	0.1 mm	0.7 m		74				
21	군열	0.1 mm	0.7 m		75				
22	군열	0.1 mm	0.4 m		76				
23	군열	0.1 mm	0.4 m		77				
24	군열	0.1 mm	0.4 m		78				
25	군열	0.1 mm	0.3 m		79				
26	군열	0.1 mm	0.3 m		80				
27	군열	0.1 mm	0.7 m		81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행	사	영	여	명	영	여	사	단		
									계	영	장
KORAIL 한국철도공사 KOREA RAILROAD											
2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역 (주)한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원											
이복영 김은경 김경기 윤석기											
영											
 0.220 (0.30m이하 : 흑색) 관목도장본리  재료본리 											
 0.420 (0.30m초과 0.50m이하 : 청색) 망상  철근노출 											
 0.620 (0.50m초과 1.00m이하 : 적색) 바리,바락,파손  누수,습윤부 											
 1.020 (1.00m이상 : 분홍색) 변태  시공이음본리,종본리 											