

호남고속선 죽산교_61(73.535~73.542km, S12-5)

73K535


73K542
10 SPAN - 1

PCL상표

TCL	TCL상
-----	------

TM.227.1

TM.238.3

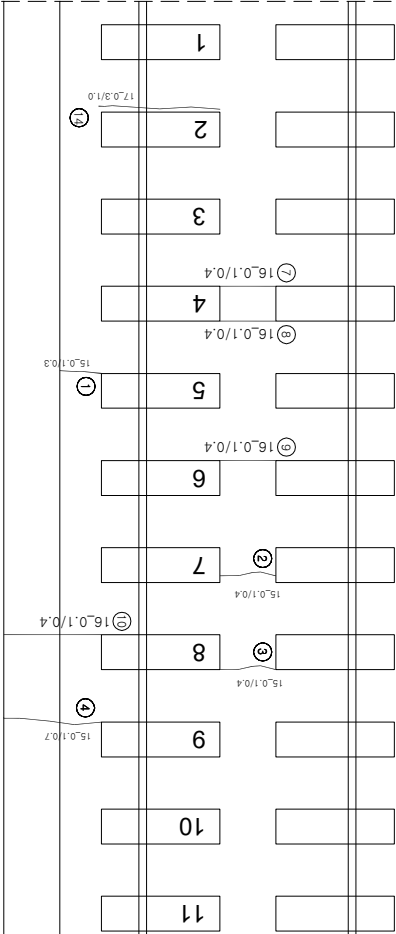


TCL	추진
TCL	상대

PCL상 100%

TCL	TCL
상	상
사	사

TM.250.1

TM.231.3

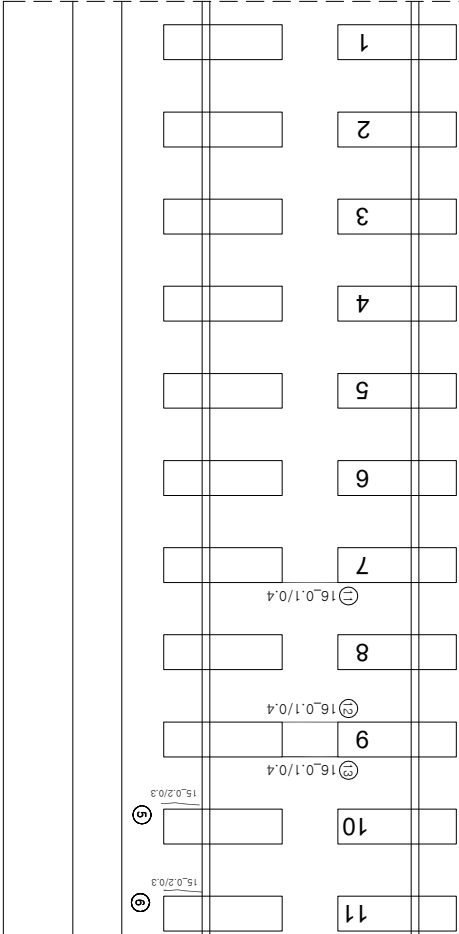

TCL상면	TCL추면
-------	-------

PCL상면

1401

연번	순번	종	연장	비고	연번	순번	종	연장	비고
1	군열	0.1	mm	0.3	m	55			
2	군열	0.1	mm	0.4	m	56			
3	군열	0.1	mm	0.4	m	57			
4	군열	0.1	mm	0.7	m	58			
5	장계부 군열	0.2	mm	0.3	m	59			
6	장계부 군열	0.2	mm	0.3	m	60			
7	군열	0.1	mm	0.4	m	61			
8	군열	0.1	mm	0.4	m	62			
9	군열	0.1	mm	0.4	m	63			
10	군열	0.1	mm	0.4	m	64			
11	군열	0.1	mm	0.4	m	65			
12	군열	0.1	mm	0.4	m	66			
13	군열	0.1	mm	0.4	m	67			
14	장계부 군열	0.3	mm	1.0	m	68			
15						69			
16						70			
17						71			
18						72			
19						73			
20						74			
21						75			
22						76			
23						77			
24						78			
25						79			
26						80			
27						81			
28						82			
29						83			
30						84			
31						85			
32						86			
33						87			
34						88			
35						89			
36						90			
37						91			
38						92			
39						93			
40						94			
41						95			
42						96			
43						97			
44						98			
45						99			
46						100			
47						101			
48						102			
49						103			
50						104			
51						105			
52						106			
53						107			
54						108			

시	행 사	영 역	영 역	영 역	사	인 지		구 간				
						과 업	인 지		장 분	아 별	지 영 지	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검공역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 박 영	강 완 강 김 경 기 윤 석 기	영 역		0220 (0.3m이하 : 흑색)		점목 도상본리		재료본리
								0420 (0.3m초과 0.5m이하 : 황색)		양상		철타노출
								0620 (0.5m초과 1.0m이하 : 적색)		바닥, 벽면, 파손		누수, 슬럼부
								1020 (1.0m이상 : 분홍색)		백태		시공이음본리, 종본리
												