


화남고성선 동리 표-55 (76.077~76.084km, S11-4)

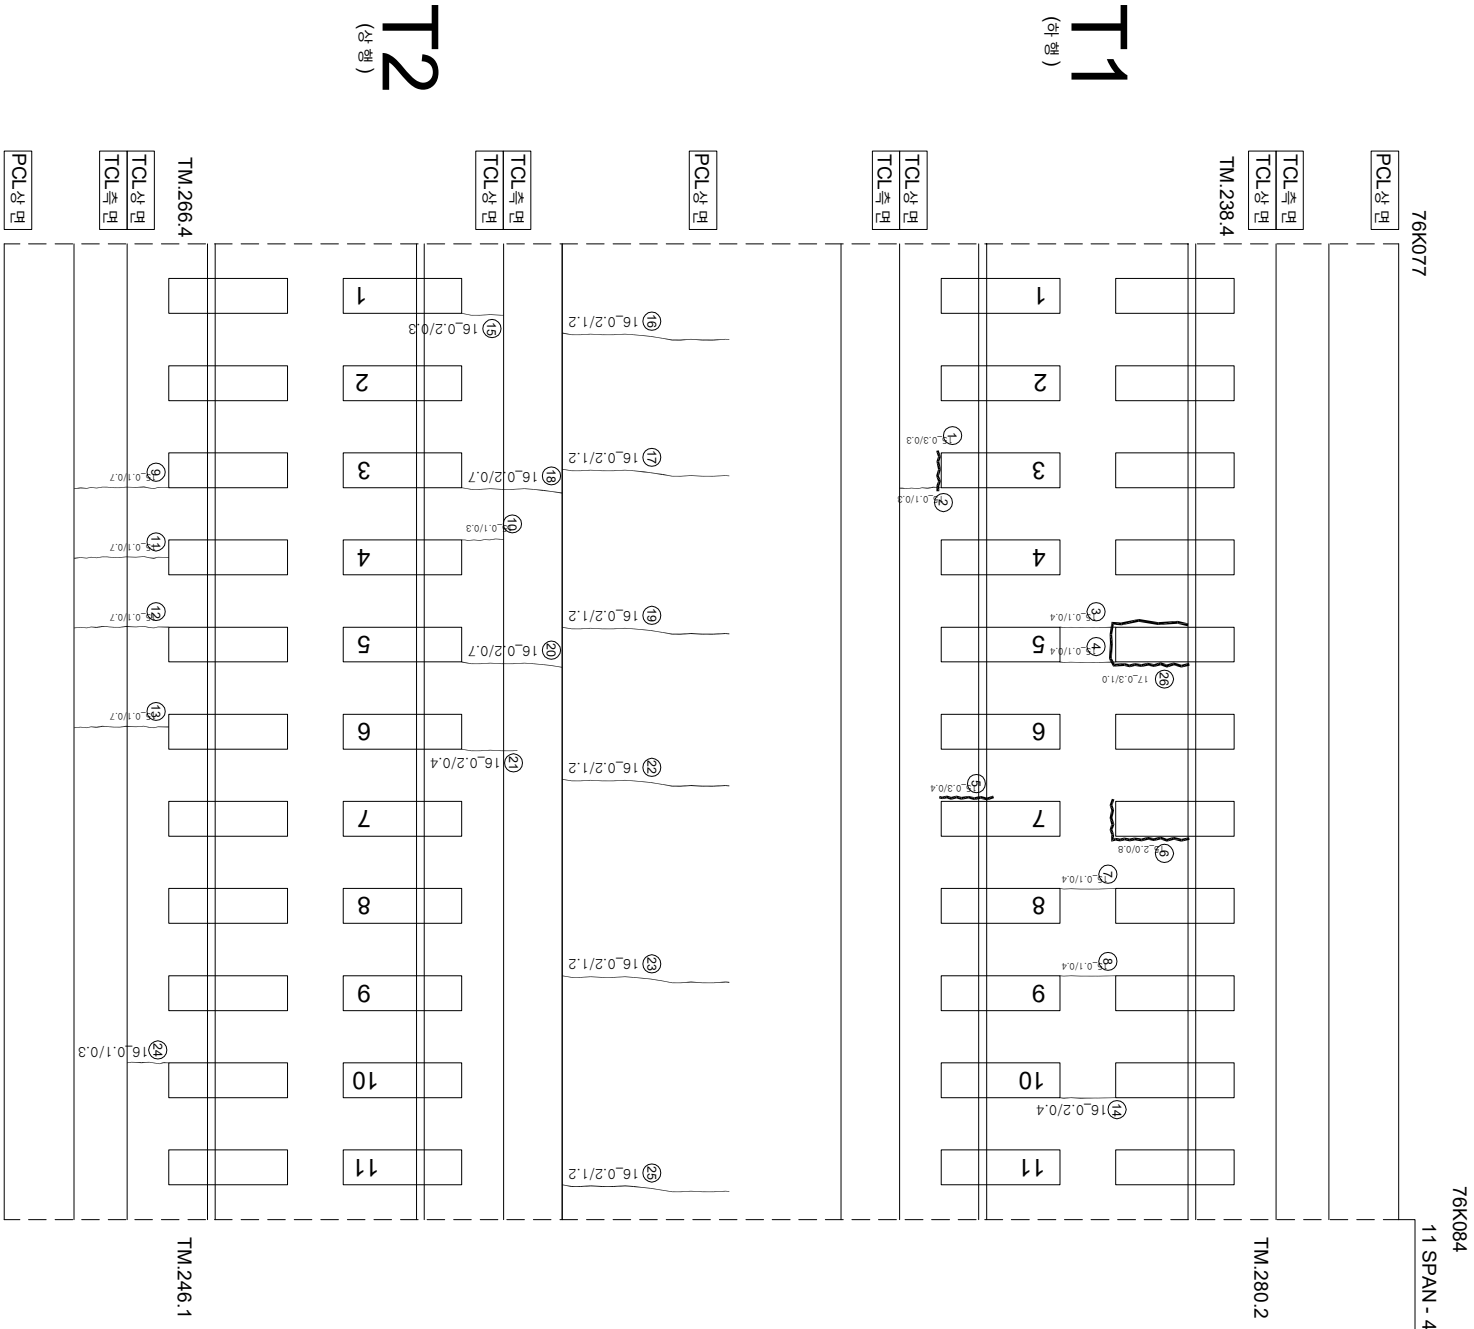

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	관측부 관월	0.3 mm	0.3 m		55				
2	관월	0.1 mm	0.3 m		56				
3	관월	0.1 mm	0.4 m		57				
4	관월	0.1 mm	0.4 m		58				
5	관측부 관월	0.3 mm	0.4 m		59				
6	관측부 관월	2.0 mm	0.8 m		60				
7	관월	0.1 mm	0.4 m		61				
8	관월	0.1 mm	0.4 m		62				
9	관월	0.1 mm	0.7 m		63				
10	관월	0.1 mm	0.3 m		64				
11	관월	0.1 mm	0.7 m		65				
12	관월	0.1 mm	0.7 m		66				
13	관월	0.1 mm	0.7 m		67				
14	관월	0.2 mm	0.4 m		68				
15	관월	0.2 mm	0.3 m		69				
16	관월	0.2 mm	1.2 m		70				
17	관월	0.2 mm	1.2 m		71				
18	관월	0.2 mm	0.7 m		72				
19	관월	0.2 mm	1.2 m		73				
20	관월	0.2 mm	0.7 m		74				
21	관월	0.2 mm	0.4 m		75				
22	관월	0.2 mm	1.2 m		76				
23	관월	0.2 mm	1.2 m		77				
24	관월	0.1 mm	0.3 m		78				
25	관월	0.2 mm	1.2 m		79				
26	관측부 관월	0.3 mm	1.0 m	신규	80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행	사	영	역	명	영	역	사	간		영
									과 업 책 임 자	참 가 비 책 임 자	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주선정가 콘크리트케도 점검영역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설철도안전연구원	이 복 영	간 윤 경 김 경 기 윤 석 기	경 원	0.22%	(0.3%)이하 : 녹색		천목도상봉리	
							0.42%	(0.3%)초과 0.5%)이하 : 황색		망상	
							0.62%	(0.5%)초과 1.0%)미만 : 적색		바리,바락,파손	
							1.02%	(1.0%)이상 : 분홍색		번태	
							0.0%			차료분리	
										철근노출	
										누수,습윤부	
										시공이음분리,홍분리	