



한남고속선영제1교-토공노반-4(79.784~79.794km, L=10.4m)

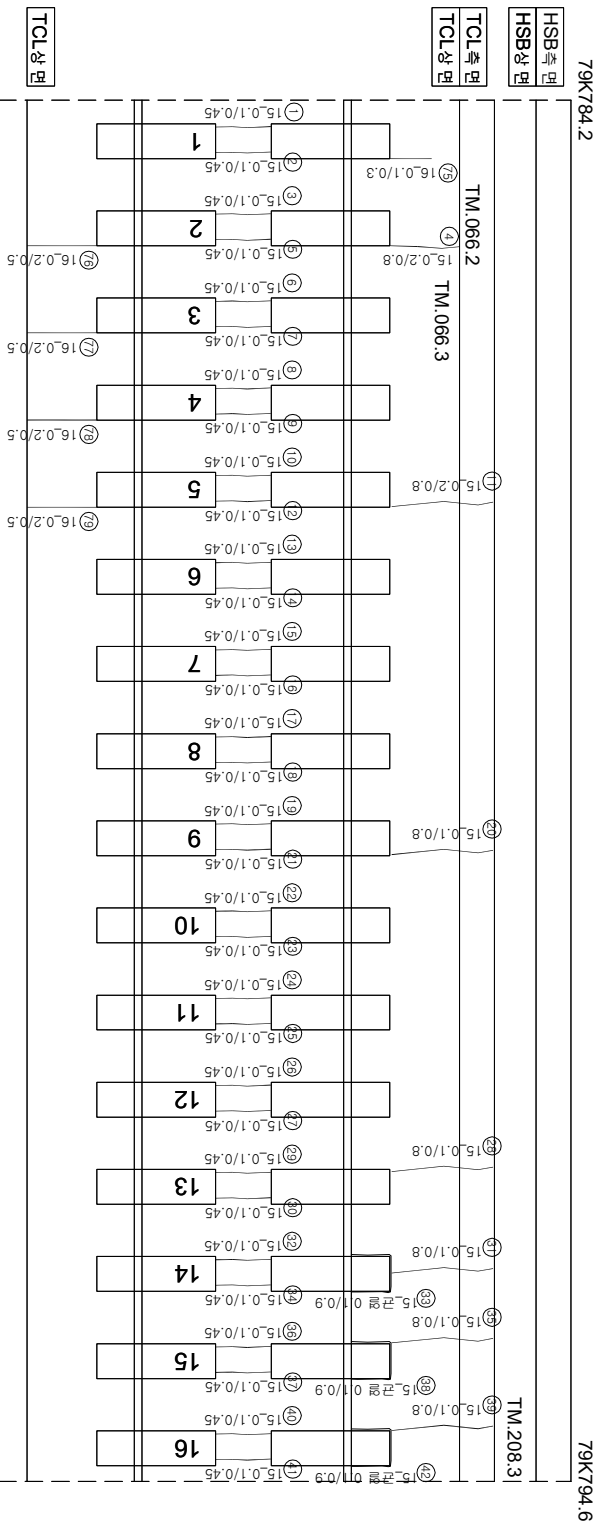

(아
0앞
)

(아
0호
)

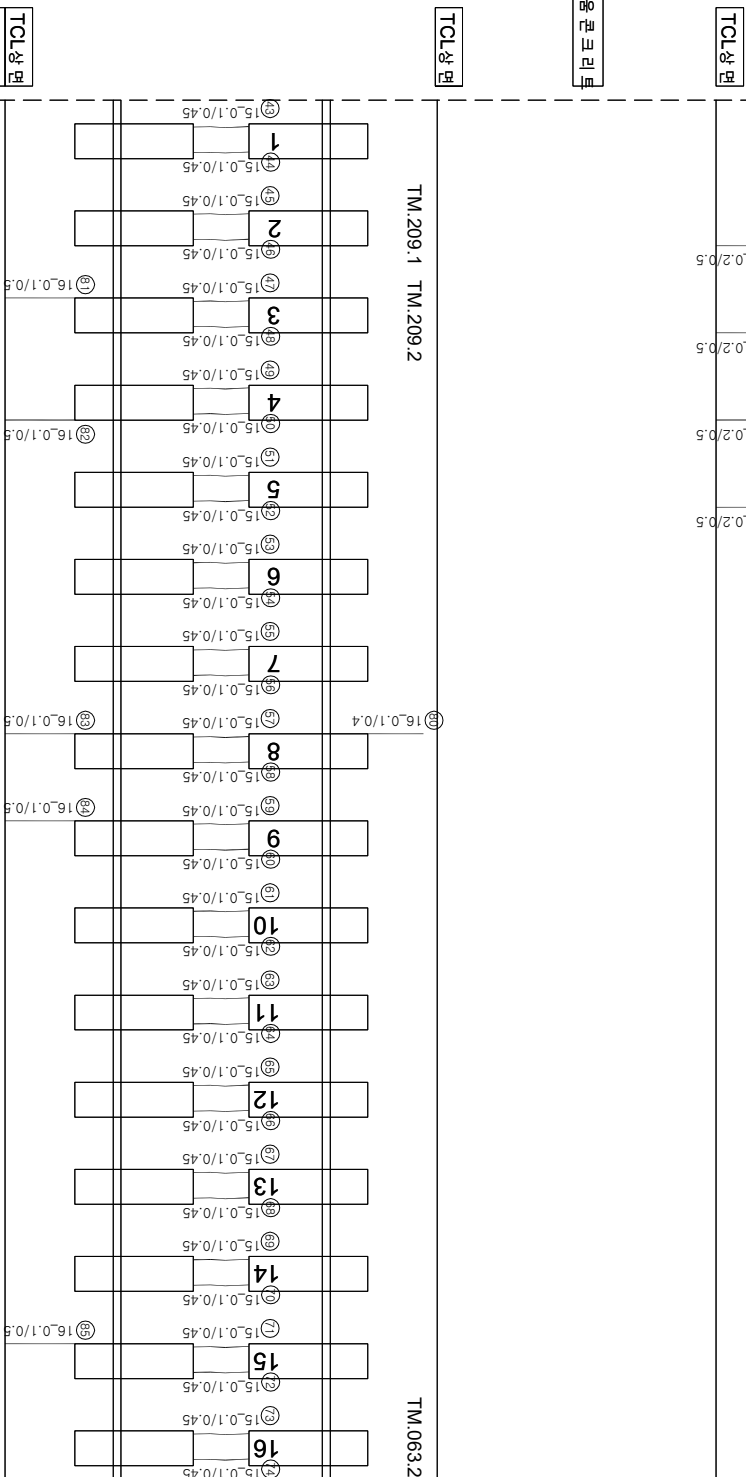

2차 (0차, 0차)

(유형)

연번	순상	목	연결	비고	연번	순상	목	연결	비고
1	균열	0.1 mm	0.45 m		51	균열	0.1 mm	0.45 m	
2	균열	0.1 mm	0.45 m		52	균열	0.1 mm	0.45 m	
3	균열	0.1 mm	0.45 m		53	균열	0.1 mm	0.45 m	
4	균열	0.2 mm	0.8 m		54	균열	0.1 mm	0.45 m	
5	균열	0.1 mm	0.45 m		55	균열	0.1 mm	0.45 m	
6	균열	0.1 mm	0.45 m		56	균열	0.1 mm	0.45 m	
7	균열	0.1 mm	0.45 m		57	균열	0.1 mm	0.45 m	
8	균열	0.1 mm	0.45 m		58	균열	0.1 mm	0.45 m	
9	균열	0.1 mm	0.45 m		59	균열	0.1 mm	0.45 m	
10	균열	0.1 mm	0.45 m		61	균열	0.1 mm	0.45 m	
11	균열	0.2 mm	0.8 m		61	균열	0.1 mm	0.45 m	
12	균열	0.1 mm	0.45 m		62	균열	0.1 mm	0.45 m	
13	균열	0.1 mm	0.45 m		63	균열	0.1 mm	0.45 m	
14	균열	0.1 mm	0.45 m		64	균열	0.1 mm	0.45 m	
15	균열	0.1 mm	0.45 m		65	균열	0.1 mm	0.45 m	
16	균열	0.1 mm	0.45 m		66	균열	0.1 mm	0.45 m	
17	균열	0.1 mm	0.45 m		67	균열	0.1 mm	0.45 m	
18	균열	0.1 mm	0.45 m		68	균열	0.1 mm	0.45 m	
19	균열	0.1 mm	0.45 m		69	균열	0.1 mm	0.45 m	
20	균열	0.1 mm	0.8 m		70	균열	0.1 mm	0.45 m	
21	균열	0.1 mm	0.45 m		71	균열	0.1 mm	0.45 m	
22	균열	0.1 mm	0.45 m		72	균열	0.1 mm	0.45 m	
23	균열	0.1 mm	0.45 m		73	균열	0.1 mm	0.45 m	
24	균열	0.1 mm	0.45 m		74	균열	0.1 mm	0.45 m	
25	균열	0.1 mm	0.45 m		75	균열	0.1 mm	0.3 m	
26	균열	0.1 mm	0.45 m		76	균열	0.2 mm	0.5 m	
27	균열	0.1 mm	0.45 m		77	균열	0.2 mm	0.5 m	
28	균열	0.1 mm	0.8 m		78	균열	0.2 mm	0.5 m	
29	균열	0.1 mm	0.45 m		79	균열	0.2 mm	0.5 m	
30	균열	0.1 mm	0.45 m		80	균열	0.1 mm	0.4 m	
31	균열	0.1 mm	0.8 m		81	균열	0.1 mm	0.5 m	
32	균열	0.1 mm	0.45 m		82	균열	0.1 mm	0.5 m	
33	관개부 균열	0.1 mm	0.9 m		83	균열	0.1 mm	0.5 m	
34	균열	0.1 mm	0.45 m		84	균열	0.1 mm	0.5 m	
35	균열	0.1 mm	0.8 m			균열	0.1 mm	0.5 m	
36	균열	0.1 mm	0.45 m						
37	균열	0.1 mm	0.45 m						
38	관개부 균열	0.1 mm	0.9 m						
39	균열	0.1 mm	0.8 m						
40	균열	0.1 mm	0.45 m						
41	균열	0.1 mm	0.45 m						
42	관개부 균열	0.1 mm	0.9 m						
43	균열	0.1 mm	0.45 m						
44	균열	0.1 mm	0.45 m						
45	균열	0.1 mm	0.45 m						
46	균열	0.1 mm	0.45 m						
47	균열	0.1 mm	0.45 m						
48	균열	0.1 mm	0.45 m						
49	균열	0.1 mm	0.45 m						
50	균열	0.1 mm	0.45 m						

시행사	영역	영역명	용역사	단면		구분	
				개입범위	정비방법		
KORAIL 한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송~광주승정간 콘크리트케도 점검공역 (재)한국건설품질연구원	(주)한국구조물안전연구원 (주)한국국토안전연구원 (재)한국건설품질연구원	이 박 영 김 경 기 윤 석 기		0220 (0.3m이하 : 복식)	점목도상판리	
					0420 (0.3m초과 0.5m이하 : 형식)	망상	
					0620 (0.5m초과 1.0m이하 : 직식)	박리·박막·표손	
					1020 (1.0m이상 : 분출식)	백태	
					0820 (0.5m초과 1.0m이하 : 직식)	누수, 음연부	
					0920 (1.0m이상 : 분출식)	시공이음 분리, 종반리	