



강 정 고 가

바닥판 상면

도면번호

1

목포쪽

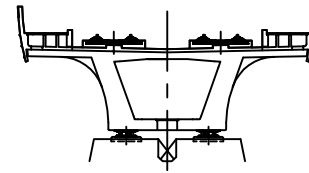


손상물량표










[illegible]

강정고가

ID 바닥판 상면 (S6)

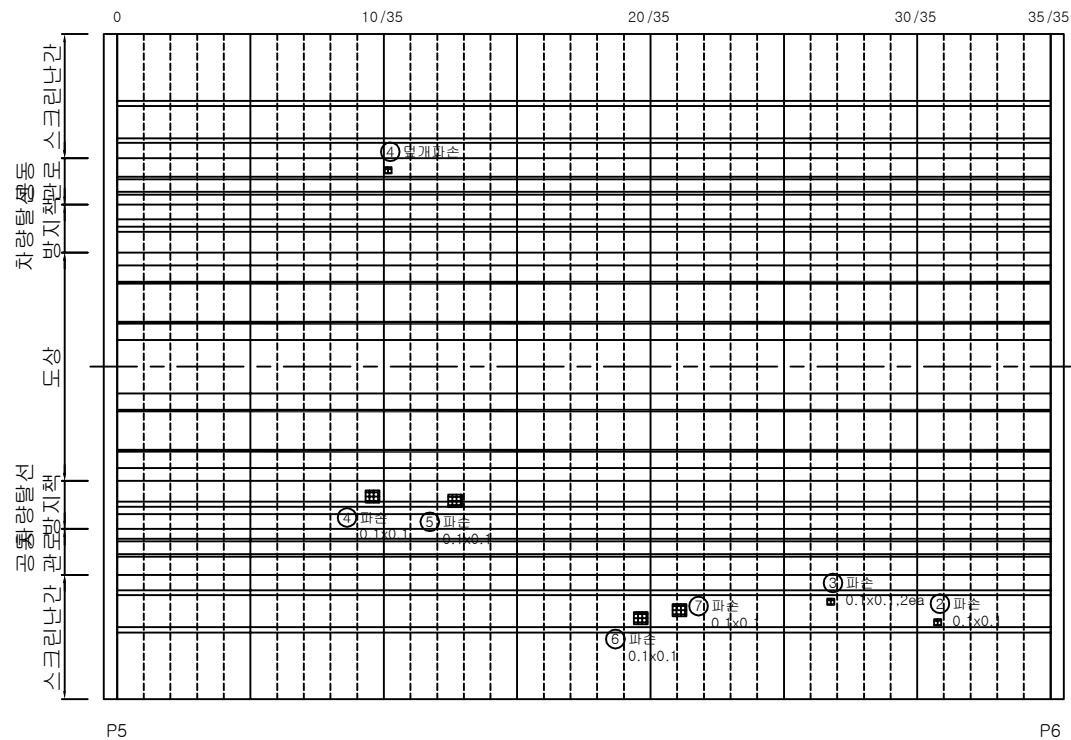

품
례



[illegible]

바닥판 하면

도 면 번 호

25


도 면 번 호

27



28

[illegible]



거더 내부

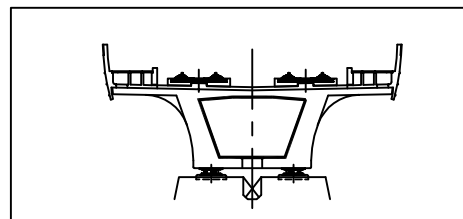

손상물량표

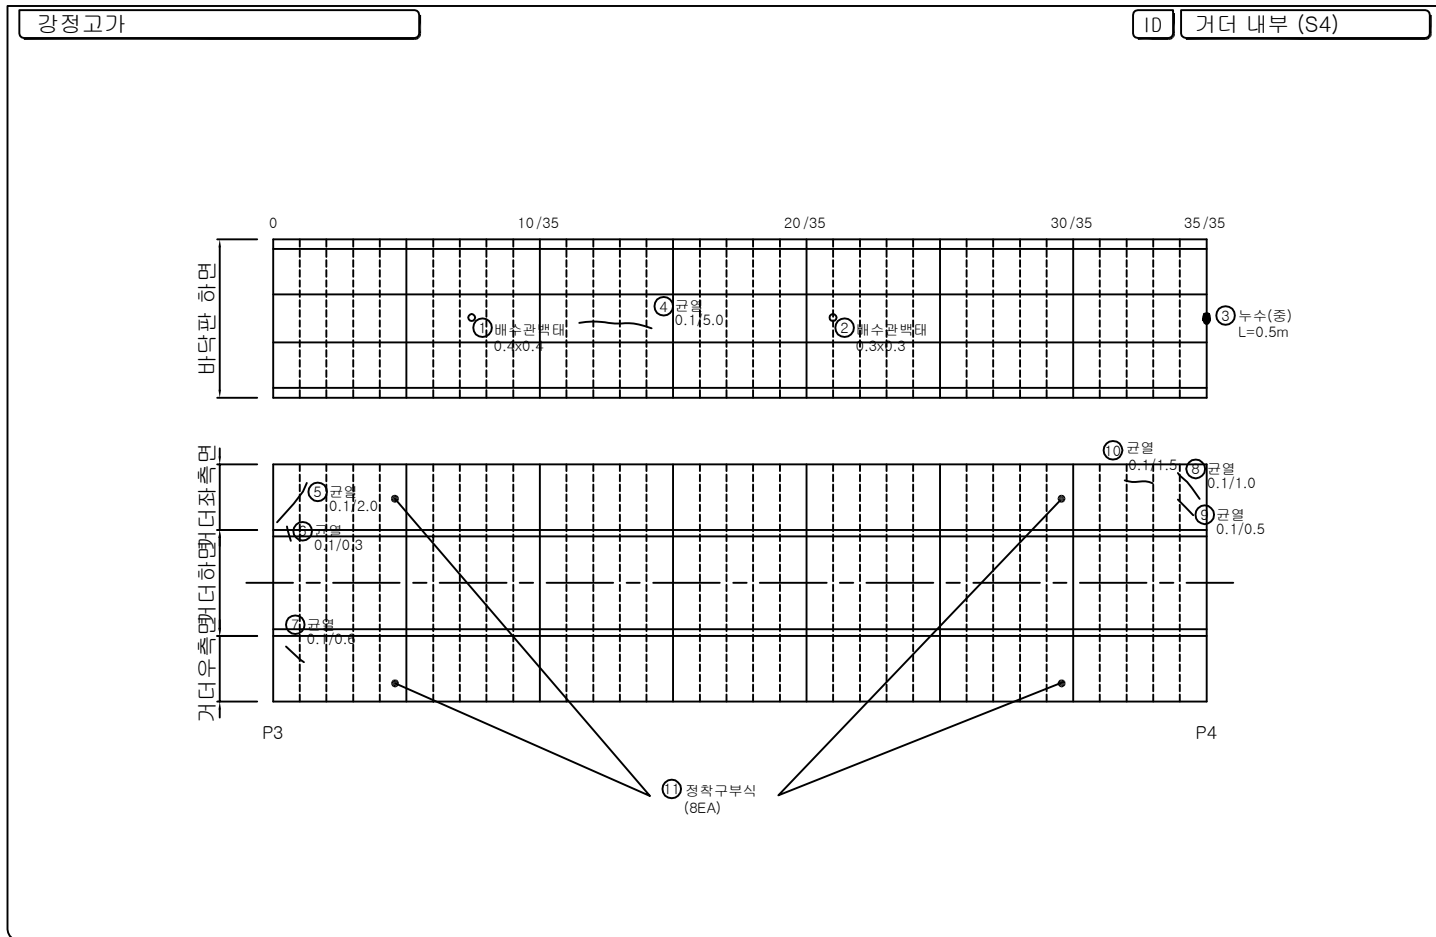[illegible]

목포쪽

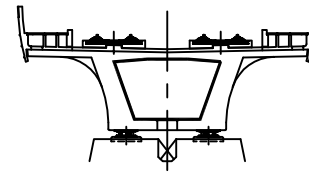


손상물량표









[illegible]

강정고가



ID	거더 내부 (S10)
----	-------------

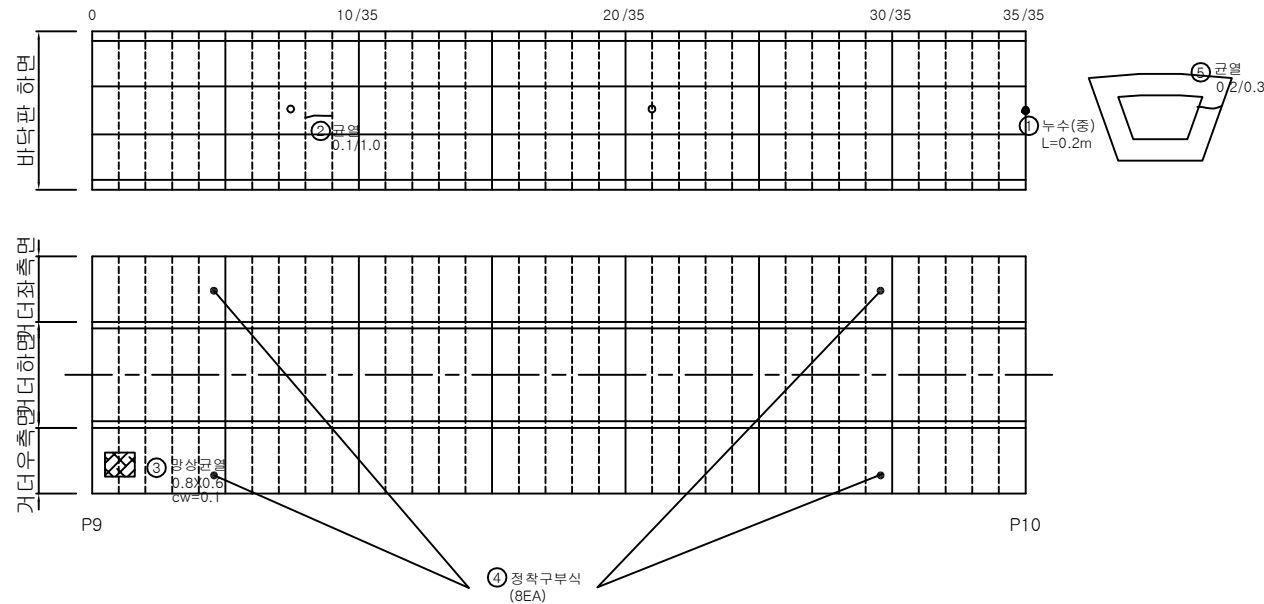

50 51



목포쪽

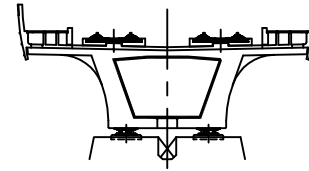


손상물량표








순 상 번 호	손 상 현 황	손상규모			손상물량	비고
		폭	길이	개수		
1	누수(중)	-	0.5m	1	0.50m	기존
2	벽태	0.3 m	0.3 m	1	0.09 m ²	기존
3	균열	0.1mm	0.5m	1	0.50m	기존
4	균열	0.1mm	0.5m	3	1.50m	기존
5	균열	0.1mm	0.4m	1	0.40m	기존
6	균열	0.1mm	1.0m	1	1.00m	기존
7	균열	0.2mm	0.7m	1	0.70m	기존
8	정착구부식	-	-	8	8 EA	기존
9	균열	0.1mm	1.2m	1	1.20m	기존
10	균열	0.2mm	0.6m	1	0.60m	기존

강정고가



ID 거더 내부 (S12)

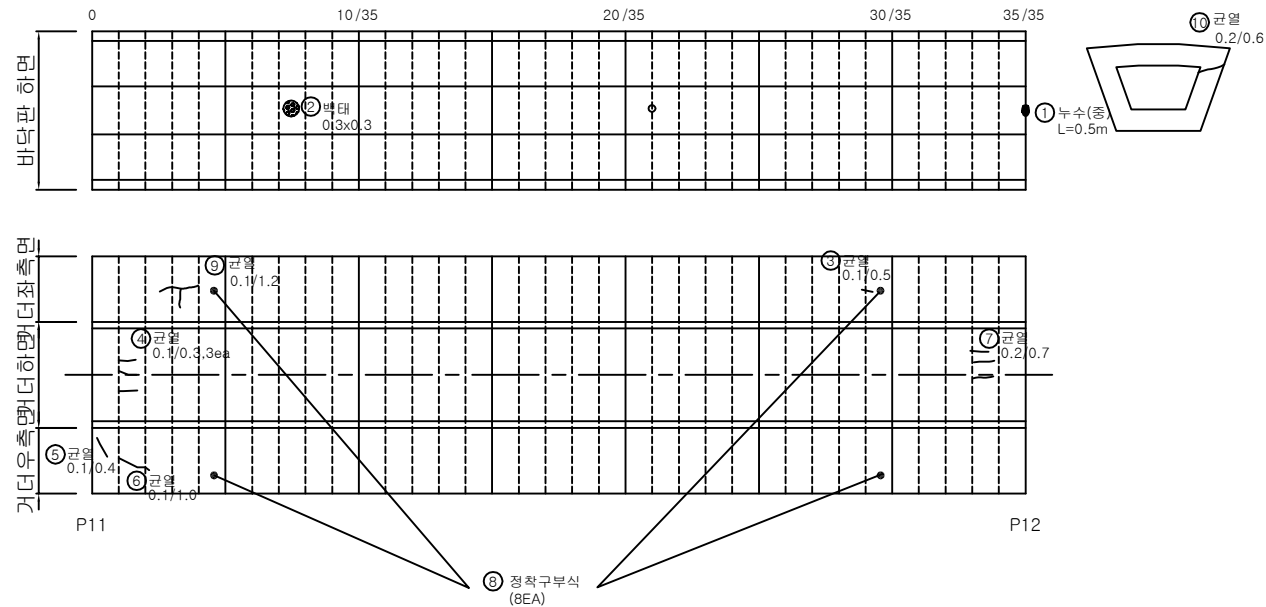

50 25




목포쪽






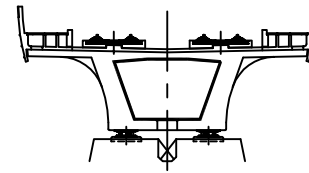



강정고가

ID 거더 내부 (S14)

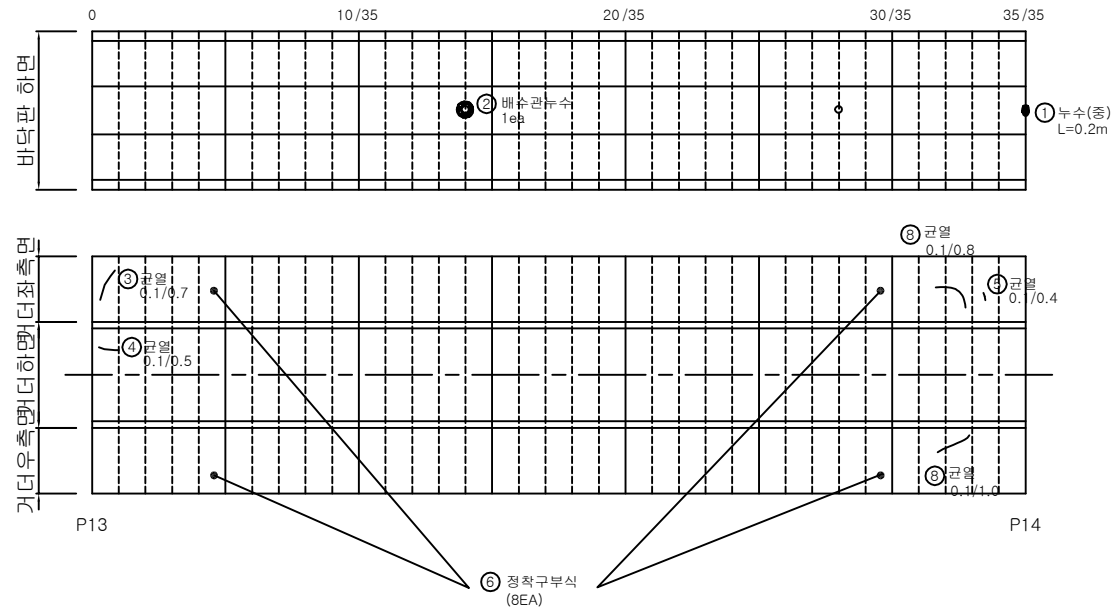

품
례



KORAIL 한국철도공사
정읍고속철도시설사무소

노 선 명
2018년도 하반기 호남고속선 오송-정읍간 황룡고가외 48개소 (옹벽2개) 구조물 하자(정기, 정밀)점검 용역

점 검 기 관
(재)한국건설품질연구원
(주)한국국토안전연구원
(주)한국구조물안전연구원

조사기간
2018. 09. ~ 2018. 12.

축척

NONE

도 면 명

거더 내부 외관조사망도



도 면 번 호

58

손상물량표

[illegible]

목포쪽

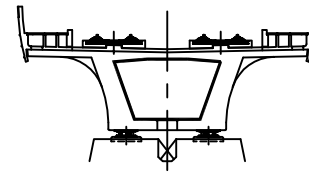


손상물량표










순상 번호	순상원형	순상규모			순상물량	비고
		폭	길이	개수		
1	누수(중)	-	0.5m	1	0.50m	기존
2	균열	0.1mm	1.0m	1	1.00m	기존
3	균열	0.1mm	0.8m	1	0.80m	기존
4	균열	0.2mm	1.7m	1	1.70m	기존
5	균열	0.2mm	1.0m	2	2.00m	기존
6	정착구부식	-	-	8	8 EA	기존
7	배수관벽대	0.3m	0.3m	1	0.09 m ²	기존

강정고가

ID 거더 내부 (S15)

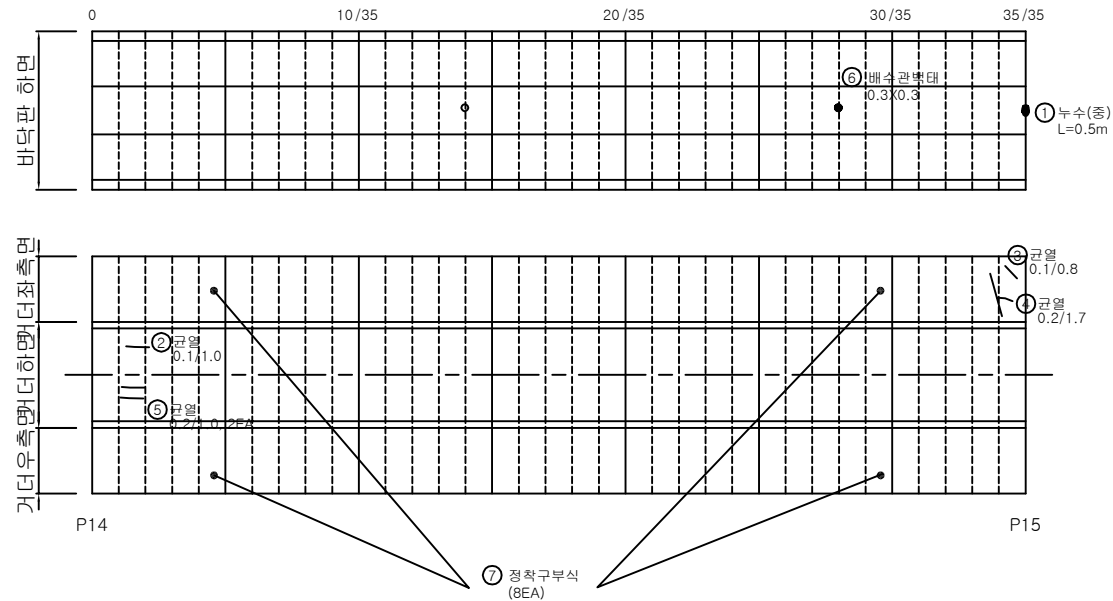



품
례



도 면 번 호

60

목포쪽

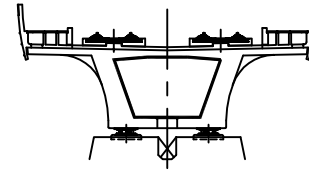


손상물량표





[illegible]

강정고가

ID 거더 내부 (S17)

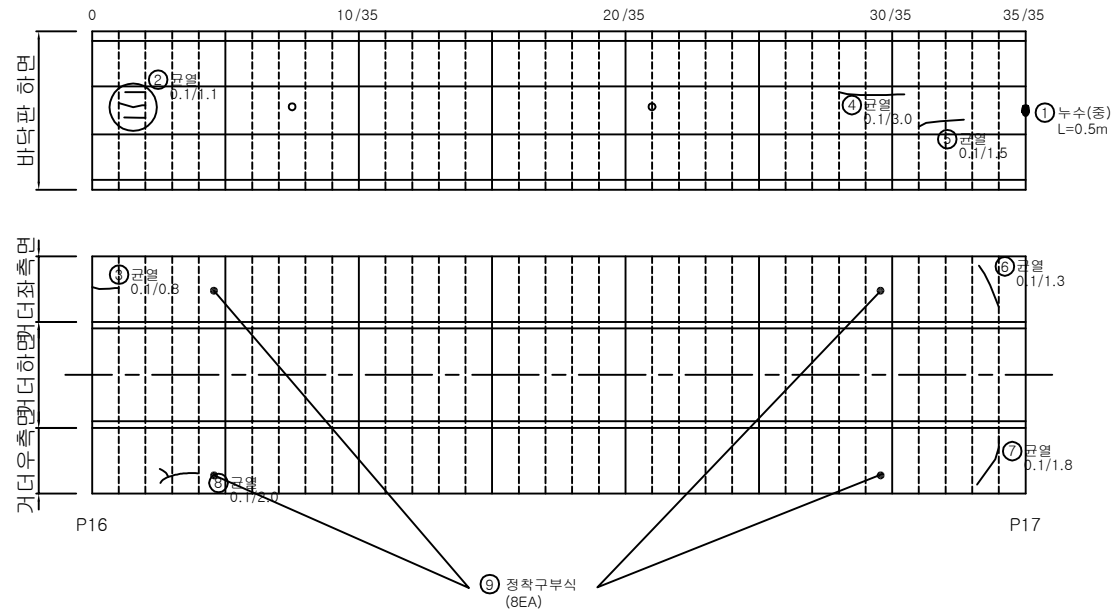

품
례



[illegible]

교 각

도 면 번 호

75

도 면 번 호

78

교대

