
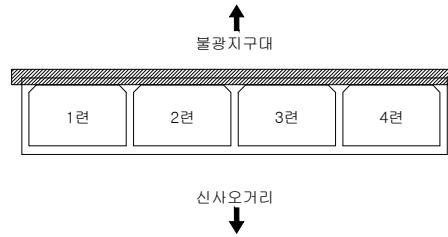


KEY PLAN

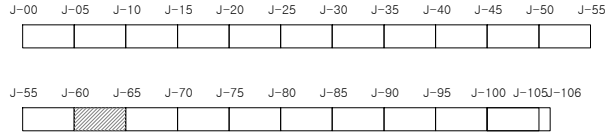


불 광 천 포 장 부 J60(1K 624) ~ J65(1K 752)

손 상 물 량 표

범 례			㉠ - 2013 신규		기① - 기존순성		㉡ 보수완료				
번 호	손 상 위 치		적출년도	결함규모						비 고	
				내 용	폭	길이	깊이	물 량	단위		개소
1	60-61	S	2013	망상균열	3.5	10.0		35.0	m	1	신규
2	60-61	S	2013	균열		26.0		26.0	m	1	신규
3	60-61	S	2013	균열		8.0		8.00	m	1	신규
4	60-61	S	2013	균열		8.0		8.00	m	1	신규
5	60-61	S	2013	균열		26.0		26.0	m	1	신규
6	60-61	S	2013	소성변형	2.0	3.0		6.00	m	1	신규
7	60-61	S	2013	망상균열	4.0	8.0		32.0	m	1	신규
8	61-62	S	2013	균열		3.0		3.00	m	1	신규
9	61-62	S	2013	균열		15.0		15.0	m	1	신규
10	61-62	S	2013	균열		15.0		15.0	m	1	신규
11	61-62	S	2013	균열		25.0		25.0	m	1	신규
12	62-63	S	2013	망상균열	3.5	12.5		43.75	m	1	신규
13	62-63	S	2013	망상균열	3.5	10.0		35.0	m	1	신규
14	62-63	S	2013	망상균열	4.0	24.0		96.0	m	1	신규
15	63-64	S	2013	망상균열	3.5	29.0		101.5	m	1	신규
16	63-64	S	2013	망상균열	3.5	29.0		101.5	m	1	신규
17	63-64	S	2013	망상균열	2.0	19.0		38.0	m	1	신규
18	63-64	S	2013	망상균열	8.0	10.0		80.0	m	1	신규
19	64-65	S	2013	균열	1.5	5.0		5.00	m	1	신규
20											
21											
22											
23											
24											
25											
26											
27											
28											
29											
30											
31											
32											
33											

-1순위 : Type-7~9 (예일여고~역말사거리)
-2순위 : Type-9~11 (역말사거리~신사오거리) 및 조인트 손상
-3순위 : Type-1~7 (시점~예일여고) 및 포장균열

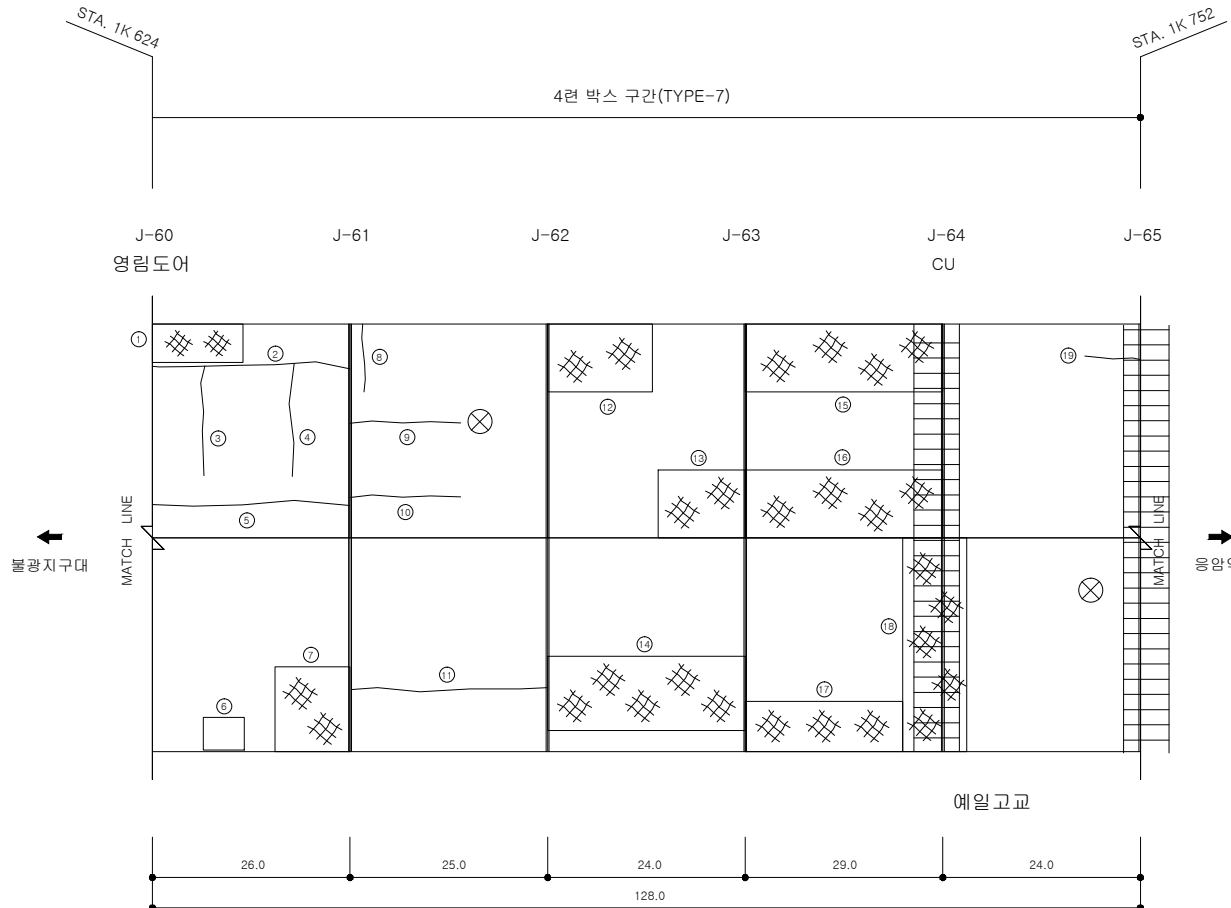

범 례



단 위



지름

두께

면적

발주처

서울특별시 서부도로사업소

용역사

(주)한국시설안전연구원

PROJECT

불광천1복개 정밀안전진단 및 북변천복개 정밀점검 용역

TITLE

불 광 천 포 장 부
J60(1K 624) ~ J65(1K 752)

SCALE

NOTE

0-15