

02. 오송1교(T1)

1.전경사진



교량 상부 전경



교량 측면 전경



거더 내부 전경



받침 장치 전경

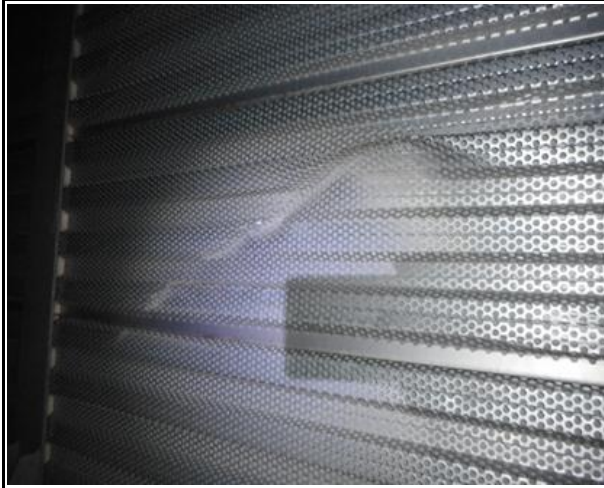


하부 구조 전경(1)



하부 구조 전경(2)

2.현황사진

1					2						
	위치	S1	방음벽	도면번호		HK-오송1교(T1)-1	위치	S1	보도부	도면번호	HK-오송1교(T1)-3
	내용	변형	0.1m, 0.3m, 1EA	연번	HK-오송1교(T1)-1-1		내용	덮개설치불량	--, --, 1EA	연번	HK-오송1교(T1)-3-1
3					4						
	위치	S2	보도부	도면번호		HK-오송1교(T1)-4	위치	S2	보도부	도면번호	HK-오송1교(T1)-5
	내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-4-1		내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-5-1
5					6						
	위치	S2	보도부	도면번호		HK-오송1교(T1)-6	위치	S3	방음벽	도면번호	HK-오송1교(T1)-7
	내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-6-1		내용	변형	1m, 0.5m, 1EA	연번	HK-오송1교(T1)-7-1

7					8						
	위치	S3	보도부	도면번호		HK-오송1교(T1)-7	위치	S3	보도부	도면번호	HK-오송1교(T1)-7
	내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-7-2		내용	덮개설치불량	--, --, 1EA	연번	HK-오송1교(T1)-7-3
9					10						
	위치	S3	보도부	도면번호		HK-오송1교(T1)-7	위치	S3	보도부	도면번호	HK-오송1교(T1)-8
	내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-7-4		내용	덮개설치불량	--, --, 1EA	연번	HK-오송1교(T1)-8-1
11					12						
	위치	S4	보도부	도면번호		HK-오송1교(T1)-10	위치	S4	보도부	도면번호	HK-오송1교(T1)-10
	내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-10-1		내용	덮개파손	--, --, 1EA	연번	HK-오송1교(T1)-10-2

13					14						
위치		S4	보도부	도면번호	HK-오송1교(T1)-11	위치		S1	좌벽체	도면번호	HK-오송1교(T1)-12
내용		뒷개파손	--, --, 1EA	연번	HK-오송1교(T1)-11-1	내용		균열(0.3mm미만) 0.2mm, 1m, 1EA	연번	HK-오송1교(T1)-12-1	
15					16						
위치		S1	좌벽체	도면번호	HK-오송1교(T1)-12	위치		S1	좌벽체	도면번호	HK-오송1교(T1)-12
내용		균열(0.3mm미만) 0.2mm, 1.5m, 1EA	연번	HK-오송1교(T1)-12-2	내용		망상균열 1.5m, 1.5m, 1EA	연번	HK-오송1교(T1)-12-3		
17					18						
위치		S1	좌벽체	도면번호	HK-오송1교(T1)-12	위치		S1	좌벽체	도면번호	HK-오송1교(T1)-12
내용		균열(0.3mm이상) 0.3mm, 2.5m, 1EA	연번	HK-오송1교(T1)-12-4	내용		균열(0.3mm이상) 0.3mm, 2m, 1EA	연번	HK-오송1교(T1)-12-5		

19					20						
	위치	S1	좌벽체	도면번호		HK-오송1교(T1)-12	위치	S1	켄틸레버하면	도면번호	HK-오송1교(T1)-12
내용		균열(0.3mm미만) 0.2mm, 1.5m, 1EA		연번	HK-오송1교(T1)-12-6	내용		콘크리트파손 0.2m, 0.4m, 1EA		연번	HK-오송1교(T1)-12-7
21					22						
	위치	S1	켄틸레버하면	도면번호		HK-오송1교(T1)-12	위치	S1	좌벽체	도면번호	HK-오송1교(T1)-12
내용		백태 0.2m, 15m, 1EA		연번	HK-오송1교(T1)-12-8	내용		균열(0.3mm미만) 0.2mm, 0.5m, 1EA		연번	HK-오송1교(T1)-12-9
23					24						
	위치	S1	좌측켄틸레버	도면번호		HK-오송1교(T1)-13	위치	S1	좌벽체	도면번호	HK-오송1교(T1)-13
내용		균열(0.3mm미만) 0.2mm, 5m, 1EA		연번	HK-오송1교(T1)-13-1	내용		균열(0.3mm미만) 0.2mm, 2.5m, 1EA		연번	HK-오송1교(T1)-13-2

25					26					
	위치	S1	좌벽체	도면번호		HK-오송1교(T1)-13	위치	S1	좌벽체	도면번호
	내용	균열(0.3mm이상) 0.3mm, 2m, 1EA		연번	HK-오송1교(T1)-13-3	내용	균열(0.3mm미만) 0.2mm, 2m, 1EA		연번	HK-오송1교(T1)-13-4

27					28					
	위치	S1	바닥판하면	도면번호		HK-오송1교(T1)-14	위치	S1	좌벽체	도면번호
	내용	균열(0.3mm미만) 0.2mm, 0.5m, 3EA		연번	HK-오송1교(T1)-14-1	내용	균열(0.3mm미만) 0.2mm, 2m, 2EA		연번	HK-오송1교(T1)-14-2

29					30					
	위치	S1	좌벽체	도면번호		HK-오송1교(T1)-14	위치	S1	우벽체	도면번호
	내용	망상균열 1m, 3m, 1EA		연번	HK-오송1교(T1)-14-3	내용	백태 0.2m, 7m, 1EA		연번	HK-오송1교(T1)-14-4

31



위치	S1	우벽체	도면번호	HK-오송1교(T1)-14
내용	누수흔적	0.6m, 2m, 1EA	연번	HK-오송1교(T1)-14-5

32



위치	S1	우벽체	도면번호	HK-오송1교(T1)-14
내용	백태	0.2m, 3m, 1EA	연번	HK-오송1교(T1)-14-6

33



위치	S1	우벽체	도면번호	HK-오송1교(T1)-14
내용	누수흔적	1.5m, 2m, 1EA	연번	HK-오송1교(T1)-14-7

34



위치	S1	우벽체	도면번호	HK-오송1교(T1)-14
내용	백태	0.2m, 4m, 1EA	연번	HK-오송1교(T1)-14-8

35



위치	S3	바닥판하면	도면번호	HK-오송1교(T1)-19
내용	기타	0.5m, 0.5m, 1EA	연번	HK-오송1교(T1)-19-1

36



위치	S1	상부슬래브	도면번호	HK-오송1교(T1)-23
내용	망상균열	4m, 2.5m, 1EA	연번	HK-오송1교(T1)-23-1

37			
위치	S1 상부슬래브	도면번호 HK-오송1교(T1)-23	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23
내용	균열(0.3mm미만) 0.2mm, 2m, 1EA	연번 HK-오송1교(T1)-23-2	내용 망상균열 0.8m, 0.8m, 1EA 연번 HK-오송1교(T1)-23-3
39			
위치	S1 상부슬래브	도면번호 HK-오송1교(T1)-23	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23
내용	망상균열 0.8m, 2.2m, 1EA	연번 HK-오송1교(T1)-23-4	내용 균열(0.3mm이상) 0.3mm, 2.5m, 1EA 연번 HK-오송1교(T1)-23-5
41			
위치	S1 상부슬래브	도면번호 HK-오송1교(T1)-23	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23
내용	백태 0.2m, 2.5m, 1EA	연번 HK-오송1교(T1)-23-6	내용 백태 0.2m, 2.5m, 1EA 연번 HK-오송1교(T1)-23-7

43 	44 
위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23
내용 백태 0.2m, 2.5m, 1EA 연번 HK-오송1교(T1)-23-8	내용 균열(0.3mm미만) 0.2mm, 2m, 1EA 연번 HK-오송1교(T1)-23-9
45 	46 
위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23
내용 백태 0.4m, 3m, 1EA 연번 HK-오송1교(T1)-23-10	내용 망상균열 0.8m, 3m, 1EA 연번 HK-오송1교(T1)-23-11
47 	48 
위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23	위치 S1 좌벽체 도면번호 HK-오송1교(T1)-23
내용 균열(0.3mm미만) 0.2mm, 1m, 1EA 연번 HK-오송1교(T1)-23-12	내용 백태 0.2m, 0.4m, 1EA 연번 HK-오송1교(T1)-23-13

49 	50 
위치 S1 좌벽체 도면번호 HK-오송1교(T1)-23 내용 백태 0.2m, 0.8m, 1EA 연번 HK-오송1교(T1)-23-14	위치 S1 좌벽체 도면번호 HK-오송1교(T1)-23 내용 백태 0.1m, 0.8m, 1EA 연번 HK-오송1교(T1)-23-15
51 	52 
위치 S1 우벽체 도면번호 HK-오송1교(T1)-23 내용 균열(0.3mm미만) 0.2mm, 0.8m, 1EA 연번 HK-오송1교(T1)-23-16	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23 내용 박락 0.2m, 0.2m, 1EA 연번 HK-오송1교(T1)-23-17
53 	54 
위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23 내용 망상균열 1m, 1.5m, 1EA 연번 HK-오송1교(T1)-23-18	위치 S1 상부슬래브 도면번호 HK-오송1교(T1)-23 내용 균열(0.3mm미만) 0.2mm, 0.7m, 1EA 연번 HK-오송1교(T1)-23-19

55					56				
	위치	S1 상부슬래브	도면번호	HK-오송1교(T1)-23		위치	S1 우벽체	도면번호	HK-오송1교(T1)-23
	내용	균열(0.3mm미만) 0.2mm, 2m, 2EA	연번	HK-오송1교(T1)-23-20		내용	균열(0.3mm미만) 0.2mm, 0.8m, 1EA	연번	HK-오송1교(T1)-23-21
57					58				
	위치	S1 우벽체	도면번호	HK-오송1교(T1)-23		위치	S1 우벽체	도면번호	HK-오송1교(T1)-23
	내용	균열(0.3mm미만) 0.2mm, 1.5m, 1EA	연번	HK-오송1교(T1)-23-22		내용	균열(0.3mm미만) 0.2mm, 1.5m, 1EA	연번	HK-오송1교(T1)-23-23
59					60				
	위치	S1 우벽체	도면번호	HK-오송1교(T1)-23		위치	S1 상부슬래브	도면번호	HK-오송1교(T1)-23
	내용	균열(0.3mm미만) 0.2mm, 1.5m, 1EA	연번	HK-오송1교(T1)-23-24		내용	균열(0.3mm미만) 0.2mm, 2.5m, 1EA	연번	HK-오송1교(T1)-23-25

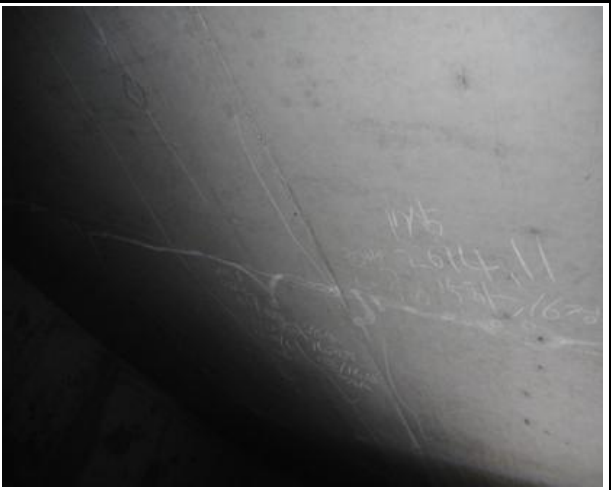
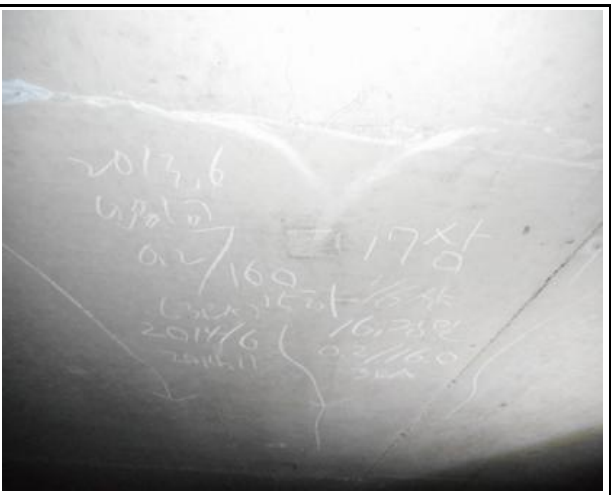
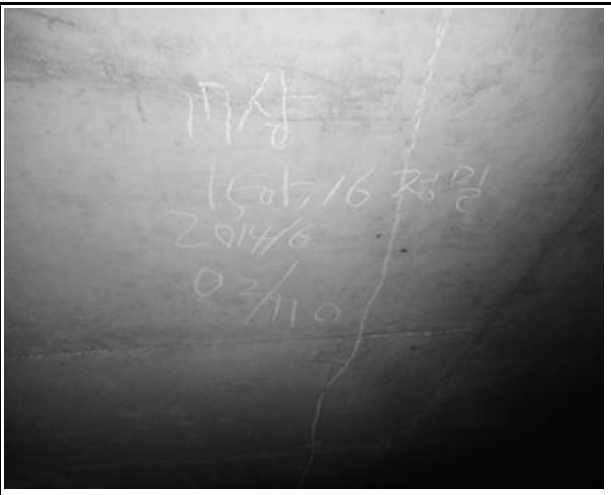
61					62				
위치	S1	상부슬래브	도면번호	HK-오송1교(T1)-23	위치	S1	상부슬래브	도면번호	HK-오송1교(T1)-23
내용	백태	0.1m, 1m, 1EA	연번	HK-오송1교(T1)-23-26	내용	균열(0.3mm미만)	0.2mm, 4m, 1EA	연번	HK-오송1교(T1)-23-27

63					64				
위치	S1	상부슬래브	도면번호	HK-오송1교(T1)-23	위치	S1	상부슬래브	도면번호	HK-오송1교(T1)-23
내용	균열(0.3mm미만)	0.1mm, 2m, 1EA	연번	HK-오송1교(T1)-23-28	내용	균열(0.3mm미만)	0.1mm, 2.5m, 2EA	연번	HK-오송1교(T1)-23-29

65					66				
위치	S1	좌벽체	도면번호	HK-오송1교(T1)-23	위치	S1	좌벽체	도면번호	HK-오송1교(T1)-23
내용	균열(0.3mm미만)	0.1mm, 1m, 1EA	연번	HK-오송1교(T1)-23-30	내용	균열(0.3mm미만)	0.1mm, 0.3m, 1EA	연번	HK-오송1교(T1)-23-31

67					68						
위치		S1	좌벽체	도면번호	HK-오송1교(T1)-23	위치		S1	좌벽체	도면번호	HK-오송1교(T1)-23
내용		균열(0.3mm미만) 0.1mm, 1m, 1EA		연번	HK-오송1교(T1)-23-32	내용		균열(0.3mm미만) 0.2mm, 2m, 1EA		연번	HK-오송1교(T1)-23-33
69					70						
위치		S1	우벽체	도면번호	HK-오송1교(T1)-23	위치		S1	우벽체	도면번호	HK-오송1교(T1)-23
내용		균열(0.3mm미만) 0.2mm, 1m, 1EA		연번	HK-오송1교(T1)-23-34	내용		균열(0.3mm미만) 0.2mm, 2m, 1EA		연번	HK-오송1교(T1)-23-35
71					72						
위치		S2	상부슬래브	도면번호	HK-오송1교(T1)-24	위치		S2	상부슬래브	도면번호	HK-오송1교(T1)-24
내용		균열(0.3mm미만) 0.2mm, 7m, 2EA		연번	HK-오송1교(T1)-24-1	내용		균열(0.3mm미만) 0.2mm, 15m, 2EA		연번	HK-오송1교(T1)-24-2

73 	74 
위치 S2 상부슬래브 도면번호 HK-오송1교(T1)-24 내용 균열(0.3mm미만) 0.2mm, 20m, 1EA 연번 HK-오송1교(T1)-24-3	위치 S2 상부슬래브 도면번호 HK-오송1교(T1)-24 내용 균열(0.3mm미만) 0.2mm, 0.4m, 2EA 연번 HK-오송1교(T1)-24-4
75 	76 
위치 S2 상부슬래브 도면번호 HK-오송1교(T1)-24 내용 파손 0.1m, 0.8m, 1EA 연번 HK-오송1교(T1)-24-5	위치 S2 상부슬래브 도면번호 HK-오송1교(T1)-24 내용 균열(0.3mm미만) 0.1mm, 3m, 1EA 연번 HK-오송1교(T1)-24-6
77 	78 
위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 6m, 1EA 연번 HK-오송1교(T1)-25-1	위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 12m, 3EA 연번 HK-오송1교(T1)-25-2

79 	80 
위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 백태 0.2m, 2m, 1EA 연번 HK-오송1교(T1)-25-3	위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 백태 0.2m, 5m, 1EA 연번 HK-오송1교(T1)-25-4
81 	82 
위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 16m, 3EA 연번 HK-오송1교(T1)-25-5	위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 백태 0.2m, 1m, 1EA 연번 HK-오송1교(T1)-25-6
83 	84 
위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 7m, 1EA 연번 HK-오송1교(T1)-25-7	위치 S3 상부슬래브 도면번호 HK-오송1교(T1)-25 내용 백태 0.2m, 3m, 1EA 연번 HK-오송1교(T1)-25-8

85 	86 
위치 S3상부슬래브 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 19m, 1EA 연번 HK-오송1교(T1)-25-9	위치 S3좌벽체 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 3m, 1EA 연번 HK-오송1교(T1)-25-10
87 	88 
위치 S3좌벽체 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 1.5m, 1EA 연번 HK-오송1교(T1)-25-11	위치 S3우벽체 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm미만) 0.2mm, 3m, 1EA 연번 HK-오송1교(T1)-25-12
89 	90 
위치 S3우벽체 도면번호 HK-오송1교(T1)-25 내용 균열(0.3mm이상) 0.3mm, 2.5m, 1EA 연번 HK-오송1교(T1)-25-13	위치 S3배수시설 도면번호 HK-오송1교(T1)-25 내용 배수관탈락 --, --, 1EA 연번 HK-오송1교(T1)-25-14

91					92				
위치	S3	상부슬래브	도면번호	HK-오송1교(T1)-25	위치	S3	상부슬래브	도면번호	HK-오송1교(T1)-25
내용	백태	0.2m, 2m, 1EA	연번	HK-오송1교(T1)-25-15	내용	콘크리트파손	0.3m, 0.2m, 2EA	연번	HK-오송1교(T1)-25-16
93					94				
위치	S3	상부슬래브	도면번호	HK-오송1교(T1)-25	위치	S3	좌벽체	도면번호	HK-오송1교(T1)-25
내용	균열부백태	0.2m, 2m, 1EA	연번	HK-오송1교(T1)-25-17	내용	균열(0.3mm미만)	0.2mm, 3m, 1EA	연번	HK-오송1교(T1)-25-19
95					96				
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	균열(0.3mm미만)	0.2mm, 25m, 1EA	연번	HK-오송1교(T1)-26-1	내용	균열(0.3mm미만)	0.2mm, 9m, 1EA	연번	HK-오송1교(T1)-26-2

97

위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 1.5m, 1EA	연번	HK-오송1교(T1)-26-3

98

위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 4m, 1EA	연번	HK-오송1교(T1)-26-4

99

위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 4m, 1EA	연번	HK-오송1교(T1)-26-5

100

위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 2m, 2EA	연번	HK-오송1교(T1)-26-6

101

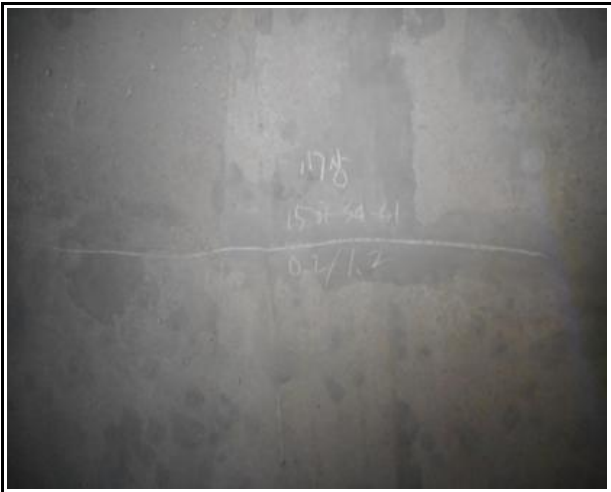
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 1.5m, 1EA	연번	HK-오송1교(T1)-26-7

102

위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 2m, 1EA	연번	HK-오송1교(T1)-26-8

									
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 2m, 1EA	연번	HK-오송1교(T1)-26-9	내용	균열(0.3mm미만)	0.2mm, 3m, 1EA	연번	HK-오송1교(T1)-26-10
									
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 3m, 1EA	연번	HK-오송1교(T1)-26-11	내용	백태	0.2m, 3.5m, 1EA	연번	HK-오송1교(T1)-26-12
									
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	백태	0.2m, 2m, 1EA	연번	HK-오송1교(T1)-26-13	내용	백태	0.2m, 1m, 1EA	연번	HK-오송1교(T1)-26-14

	
109 위치 S4상부슬래브 도면번호 HK-오송1교(T1)-26	110 위치 S4상부슬래브 도면번호 HK-오송1교(T1)-26
내용 균열(0.3mm미만) 0.2mm, 15m, 1EA 연번 HK-오송1교(T1)-26-15	내용 균열(0.3mm미만) 0.2mm, 18m, 1EA 연번 HK-오송1교(T1)-26-16
	
111 위치 S4상부슬래브 도면번호 HK-오송1교(T1)-26	112 위치 S4상부슬래브 도면번호 HK-오송1교(T1)-26
내용 균열(0.3mm미만) 0.2mm, 15m, 1EA 연번 HK-오송1교(T1)-26-17	내용 균열(0.3mm미만) 0.2mm, 5m, 1EA 연번 HK-오송1교(T1)-26-18
	
113 위치 S4상부슬래브 도면번호 HK-오송1교(T1)-26	114 위치 S4우벽체 도면번호 HK-오송1교(T1)-26
내용 균열(0.3mm미만) 0.2mm, 5m, 1EA 연번 HK-오송1교(T1)-26-19	내용 균열(0.3mm미만) 0.2mm, 1.7m, 1EA 연번 HK-오송1교(T1)-26-20

115 				116 					
위치	S4	우벽체	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	균열(0.3mm미만) 0.2mm, 1.2m, 1EA		연번	HK-오송1교(T1)-26-21	내용	배수관불량 --, --, 1EA		연번	HK-오송1교(T1)-26-22

117 				118 					
위치	S4	바닥판하면	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	체수	2m, 7m, 1EA	연번	HK-오송1교(T1)-26-23	내용	균열(0.3mm미만) 0.1mm, 5m, 1EA		연번	HK-오송1교(T1)-26-24

119 				120 					
위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26	위치	S4	상부슬래브	도면번호	HK-오송1교(T1)-26
내용	균열(0.3mm미만) 0.1mm, 3m, 1EA		연번	HK-오송1교(T1)-26-25	내용	균열(0.3mm미만) 0.2mm, 5m, 1EA		연번	HK-오송1교(T1)-26-26

121 				122 					
위치	S1	격벽	도면번호	HK-오송1교(T1)-27	위치	S1	격벽	도면번호	HK-오송1교(T1)-27
내용	망상균열	0.3m, 1m, 1EA	연번	HK-오송1교(T1)-27-1	내용	균열(0.3mm미만)	0.1mm, 0.3m, 3EA	연번	HK-오송1교(T1)-27-2

123 				124 					
위치	S2	격벽	도면번호	HK-오송1교(T1)-30	위치	S2	격벽	도면번호	HK-오송1교(T1)-30
내용	균열(0.3mm미만)	0.2mm, 0.5m, 1EA	연번	HK-오송1교(T1)-30-1	내용	균열(0.3mm이상)	0.3mm, 1m, 4EA	연번	HK-오송1교(T1)-30-2

125 				126 					
위치	S2	격벽	도면번호	HK-오송1교(T1)-30	위치	S2	격벽	도면번호	HK-오송1교(T1)-31
내용	균열(0.3mm미만)	0.2mm, 1m, 1EA	연번	HK-오송1교(T1)-30-5	내용	균열(0.3mm이상)	0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-31-1

127 	128 
위치 S2 격벽 도면번호 HK-오송1교(T1)-31 내용 균열(0.3mm이상) 0.3mm, 1m, 1EA 연번 HK-오송1교(T1)-31-2	위치 S2 격벽 도면번호 HK-오송1교(T1)-31 내용 균열(0.3mm이상) 0.3mm, 1m, 2EA 연번 HK-오송1교(T1)-31-3
129 	130 
위치 S2 격벽 도면번호 HK-오송1교(T1)-31 내용 균열(0.3mm이상) 0.3mm, 1m, 1EA 연번 HK-오송1교(T1)-31-4	위치 S2 격벽 도면번호 HK-오송1교(T1)-32 내용 균열(0.3mm이상) 0.3mm, 1m, 1EA 연번 HK-오송1교(T1)-32-1
131 	132 
위치 S2 격벽 도면번호 HK-오송1교(T1)-32 내용 균열(0.3mm이상) 0.3mm, 0.8m, 1EA 연번 HK-오송1교(T1)-32-2	위치 S2 격벽 도면번호 HK-오송1교(T1)-32 내용 균열(0.3mm이상) 0.3mm, 1m, 1EA 연번 HK-오송1교(T1)-32-3

									
위치	S2	격벽	도면번호	HK-오송1교(T1)-32	위치	S2	격벽	도면번호	HK-오송1교(T1)-33
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA		연번	HK-오송1교(T1)-32-4	내용	균열(0.3mm미만) 0.2mm, 0.6m, 6EA		연번	HK-오송1교(T1)-33-1

									
위치	S3	격벽	도면번호	HK-오송1교(T1)-34	위치	S3	격벽	도면번호	HK-오송1교(T1)-34
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA		연번	HK-오송1교(T1)-34-1	내용	균열(0.3mm미만) 0.2mm, 0.6m, 3EA		연번	HK-오송1교(T1)-34-2

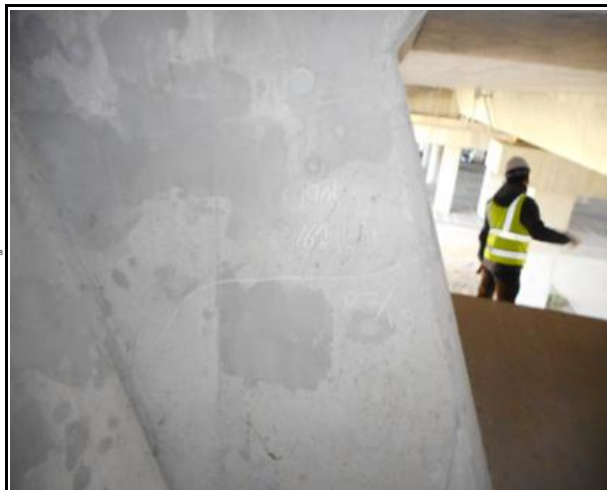
									
위치	S3	격벽	도면번호	HK-오송1교(T1)-34	위치	S3	격벽	도면번호	HK-오송1교(T1)-34
내용	균열(0.3mm이상) 0.3mm, 0.8m, 1EA		연번	HK-오송1교(T1)-34-3	내용	균열(0.3mm미만) 0.2mm, 0.6m, 1EA		연번	HK-오송1교(T1)-34-4

									
위치	S3	격벽	도면번호	HK-오송1교(T1)-34	위치	S3	격벽	도면번호	HK-오송1교(T1)-35
내용	박락	0.2m, 0.7m, 1EA	연번	HK-오송1교(T1)-34-5	내용	균열(0.3mm이상) 0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-35-1	

									
위치	S3	격벽	도면번호	HK-오송1교(T1)-35	위치	S3	격벽	도면번호	HK-오송1교(T1)-35
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-35-2		내용	균열(0.3mm이상) 0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-35-3	

									
위치	S3	격벽	도면번호	HK-오송1교(T1)-35	위치	S3	격벽	도면번호	HK-오송1교(T1)-36
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-35-4		내용	균열(0.3mm이상) 0.3mm, 1m, 1EA	연번	HK-오송1교(T1)-36-1	

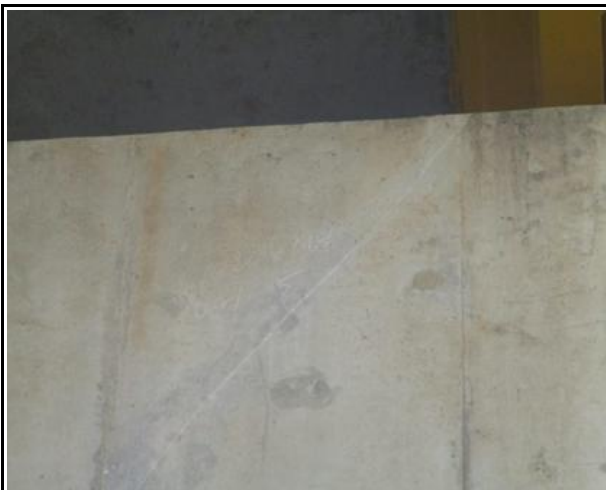
									
위치	S3	격벽	도면번호	HK-오송1교(T1)-36	위치	S3	격벽	도면번호	HK-오송1교(T1)-36
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA		연번	HK-오송1교(T1)-36-2	내용	균열(0.3mm이상) 0.3mm, 1m, 1EA		연번	HK-오송1교(T1)-36-3

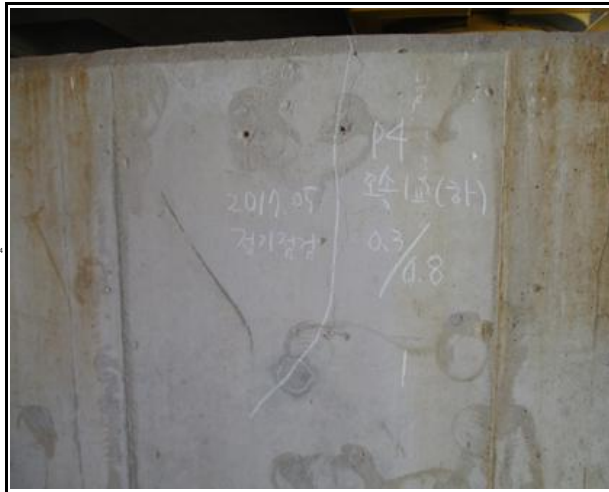
									
위치	S3	격벽	도면번호	HK-오송1교(T1)-36	위치	S3	격벽	도면번호	HK-오송1교(T1)-37
내용	균열(0.3mm이상) 0.3mm, 1m, 1EA		연번	HK-오송1교(T1)-36-4	내용	균열(0.3mm미만) 0.2mm, 1.5m, 1EA		연번	HK-오송1교(T1)-37-1

									
위치	S3	격벽	도면번호	HK-오송1교(T1)-37	위치	S3	격벽	도면번호	HK-오송1교(T1)-37
내용	균열(0.3mm미만) 0.2mm, 1m, 2EA		연번	HK-오송1교(T1)-37-2	내용	균열(0.3mm이상) 0.3mm, 0.8m, 6EA		연번	HK-오송1교(T1)-37-3

157 				158 					
위치	P3	코핑	도면번호	HK-오송1교(T1)-43	위치	P3	코핑	도면번호	HK-오송1교(T1)-43
내용	콘크리트파손 0.5m, 0.5m, 3EA		연번	HK-오송1교(T1)-43-1	내용	균열(0.3mm이상) 0.3mm, 0.6m, 1EA		연번	HK-오송1교(T1)-43-2

159 				160 					
위치	P3	코핑	도면번호	HK-오송1교(T1)-43	위치	P3	코핑	도면번호	HK-오송1교(T1)-43
내용	균열부백태 0.1mm, 0.8m, 1EA		연번	HK-오송1교(T1)-43-3	내용	누수오염 1.5m, 1.5m, 1EA		연번	HK-오송1교(T1)-43-4

161 				162 					
위치	P3	코핑	도면번호	HK-오송1교(T1)-43	위치	P3	코핑	도면번호	HK-오송1교(T1)-43
내용	균열(0.3mm미만) 0.2mm, 2.5m, 1EA		연번	HK-오송1교(T1)-43-5	내용	누수흔적 1.5m, 2m, 1EA		연번	HK-오송1교(T1)-43-6

									
위치	P4	코핑	도면번호	HK-오송1교(T1)-44	위치	P4	코핑	도면번호	HK-오송1교(T1)-44
내용	균열(0.3mm이상) 0.3mm, 1.1m, 1EA		연번	HK-오송1교(T1)-44-1	내용	균열(0.3mm이상) 0.3mm, 0.8m, 1EA		연번	HK-오송1교(T1)-44-2
									
위치	P5	기둥	도면번호	HK-오송1교(T1)-45	위치	P5	기둥	도면번호	HK-오송1교(T1)-46
내용	균열(0.3mm미만) 0.2mm, 4m, 1EA		연번	HK-오송1교(T1)-45-1	내용	균열(0.3mm미만) 0.1mm, 0.4m, 1EA		연번	HK-오송1교(T1)-46-1
									
위치	P6	기둥	도면번호	HK-오송1교(T1)-46	위치	P6	기둥	도면번호	HK-오송1교(T1)-46
내용	망상균열 1m, 2m, 1EA		연번	HK-오송1교(T1)-46-1	내용	균열(0.3mm미만) 0.2mm, 0.8m, 1EA		연번	HK-오송1교(T1)-46-2

									
위치	P6	코핑	도면번호	HK-오송1교(T1)-46	위치	P6	기둥	도면번호	HK-오송1교(T1)-46
내용	망상균열	1m, 2m, 1EA	연번	HK-오송1교(T1)-46-3	내용	균열(0.3mm미만)	0.2mm, 0.6m, 5EA	연번	HK-오송1교(T1)-46-4
									
위치	P6	기둥	도면번호	HK-오송1교(T1)-46	위치	P6	기둥	도면번호	HK-오송1교(T1)-46
내용	균열(0.3mm미만)	0.1mm, 0.6m, 2EA	연번	HK-오송1교(T1)-46-5	내용	균열(0.3mm미만)	0.1mm, 0.6m, 2EA	연번	HK-오송1교(T1)-46-6
									
위치	P7	코핑	도면번호	HK-오송1교(T1)-47	위치	P8	코핑	도면번호	HK-오송1교(T1)-48
내용	균열(0.3mm미만)	0.1mm, 0.4m, 1EA	연번	HK-오송1교(T1)-47-1	내용	균열(0.3mm미만)	0.2mm, 0.3m, 1EA	연번	HK-오송1교(T1)-48-1

위치	P9	받침장치	도면번호	HK-오송1교(T1)-49	위치	P10	기둥	도면번호	HK-오송1교(T1)-50
내용	무수축물탈파손 0.3m, 0.4m, 1EA		연번	HK-오송1교(T1)-49-1	내용	콘크리트파손 0.2m, 0.2m, 1EA		연번	HK-오송1교(T1)-50-1