


호남고속선 부용터널_95(13k780.~13k790.km, S93)

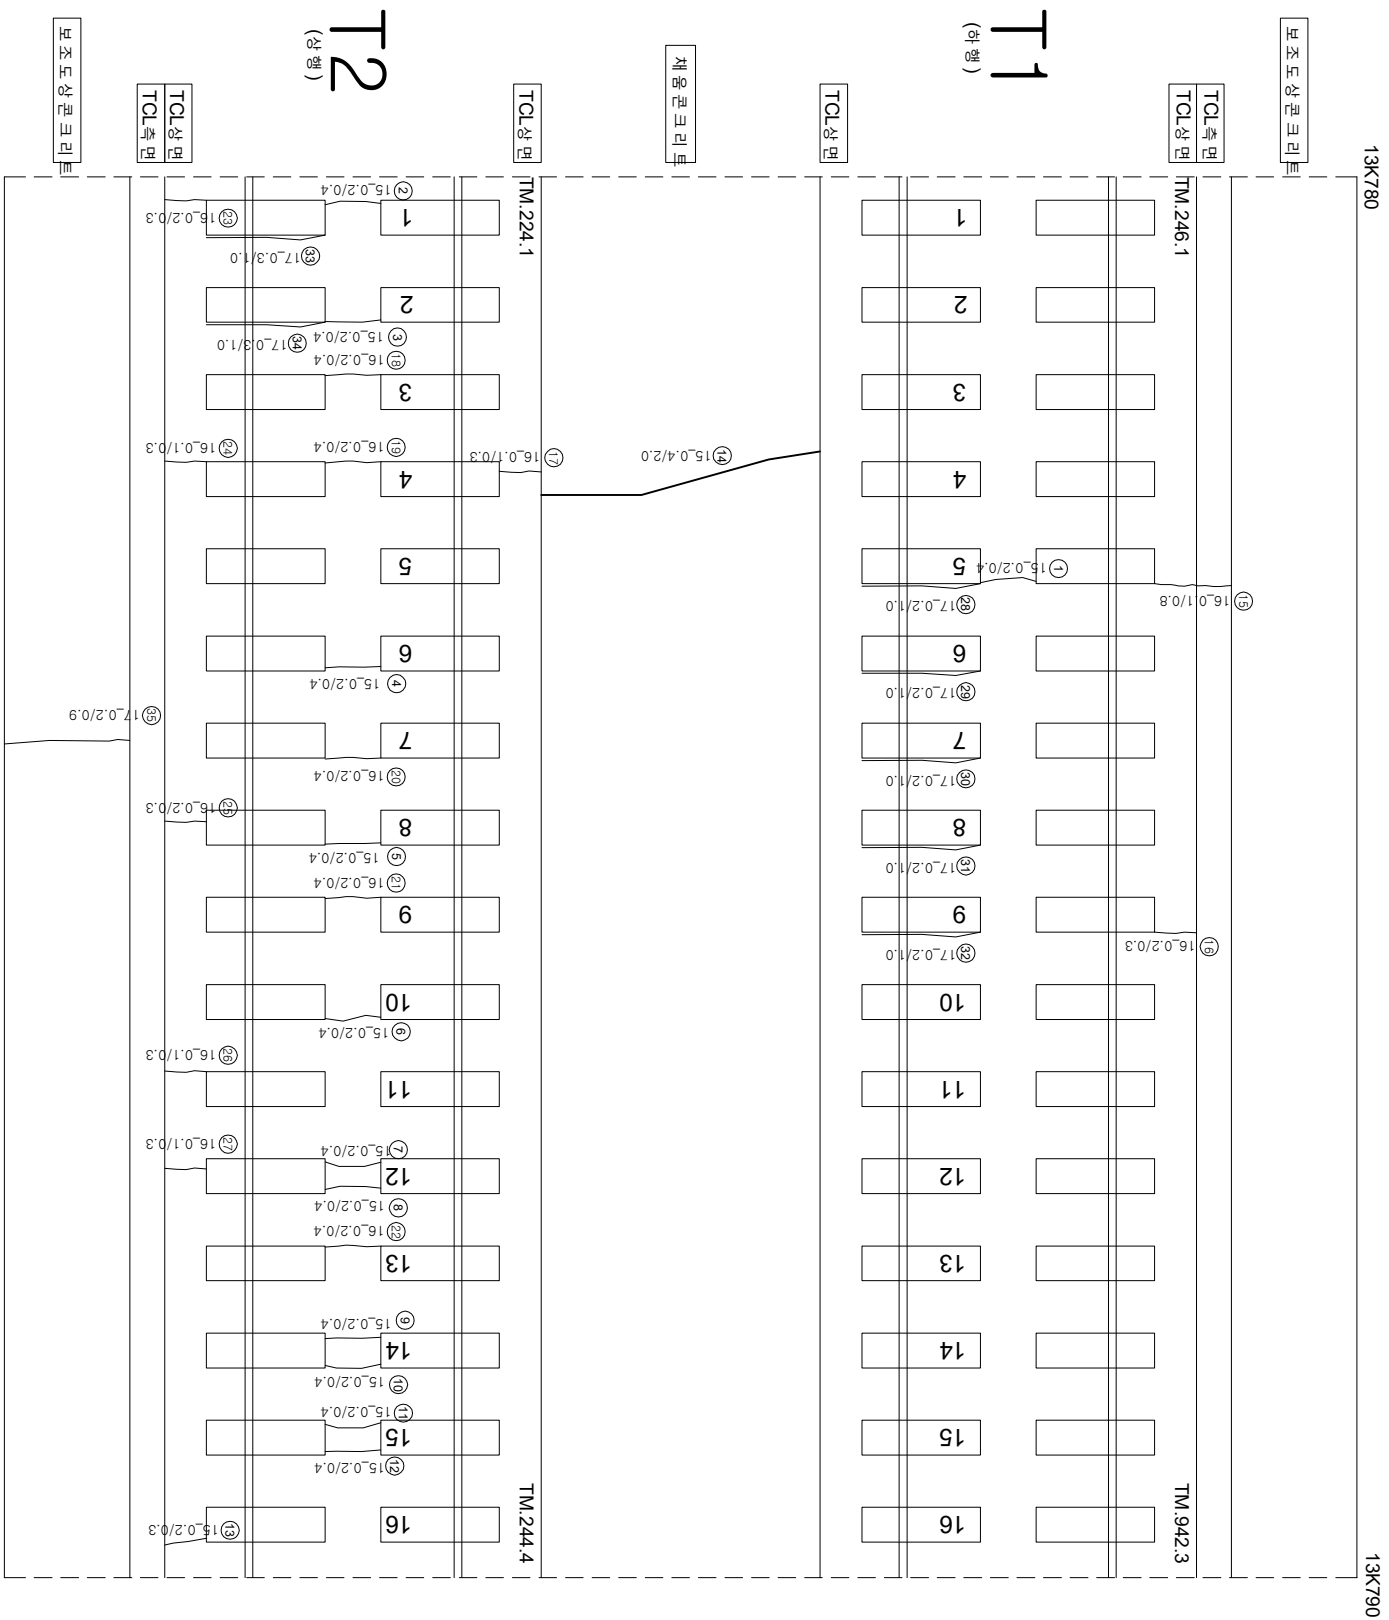

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2	mm	0.4 m		56			
2	균열	0.2	mm	0.4 m		57			
3	균열	0.2	mm	0.4 m		58			
4	균열	0.2	mm	0.4 m		59			
5	균열	0.2	mm	0.4 m		60			
6	균열	0.2	mm	0.4 m		61			
7	균열	0.2	mm	0.4 m		62			
8	균열	0.2	mm	0.4 m		63			
9	균열	0.2	mm	0.4 m		64			
10	균열	0.2	mm	0.4 m		65			
11	균열	0.2	mm	0.4 m		66			
12	균열	0.2	mm	0.4 m		67			
13	균열	0.2	mm	0.3 m		68			
14	균열	0.4	mm	2.0 m		69			
15	균열	0.1	mm	0.8 m		70			
16	균열	0.2	mm	0.3 m		71			
17	균열	0.1	mm	0.3 m		72			
18	균열	0.2	mm	0.4 m		73			
19	균열	0.2	mm	0.4 m		74			
20	균열	0.2	mm	0.4 m		75			
21	균열	0.2	mm	0.4 m		76			
22	균열	0.2	mm	0.4 m		77			
23	균열	0.2	mm	0.3 m		78			
24	균열	0.1	mm	0.3 m		79			
25	균열	0.2	mm	0.3 m		80			
26	균열	0.1	mm	0.3 m		81			
27	균열	0.1	mm	0.3 m		82			
28	균열부 균열	0.2	mm	1.0 m	신규	83			
29	균열부 균열	0.2	mm	1.0 m	신규	84			
30	균열부 균열	0.2	mm	1.0 m	신규	85			
31	균열부 균열	0.2	mm	1.0 m	신규	86			
32	균열부 균열	0.2	mm	1.0 m	신규	87			
33	균열부 균열	0.3	mm	1.0 m	신규	88			
34	균열부 균열	0.3	mm	1.0 m	신규	89			
35	균열	0.2	mm	0.9 m	신규	90			
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

시	행	사	영	역	명	영	역	사	이 표 영					
									과 업	업 장	분	아 발	책 임	지
KORAIL KOREA RAILROAD		한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 표 영	김 문 강 김 경 기	영	단		0.2220 (0.3mm이하 : 흑색)		차로본리		
										0.4620 (0.3mm초과 0.5mm이하 : 황색)		망상		철판노출
										0.6820 (0.5mm초과 1.0mm미만 : 적색)		바리,바락,파손		누수습윤부
										1.0020 (1.0mm이상 : 분홍색)		번태		시공이음본리,종본리