
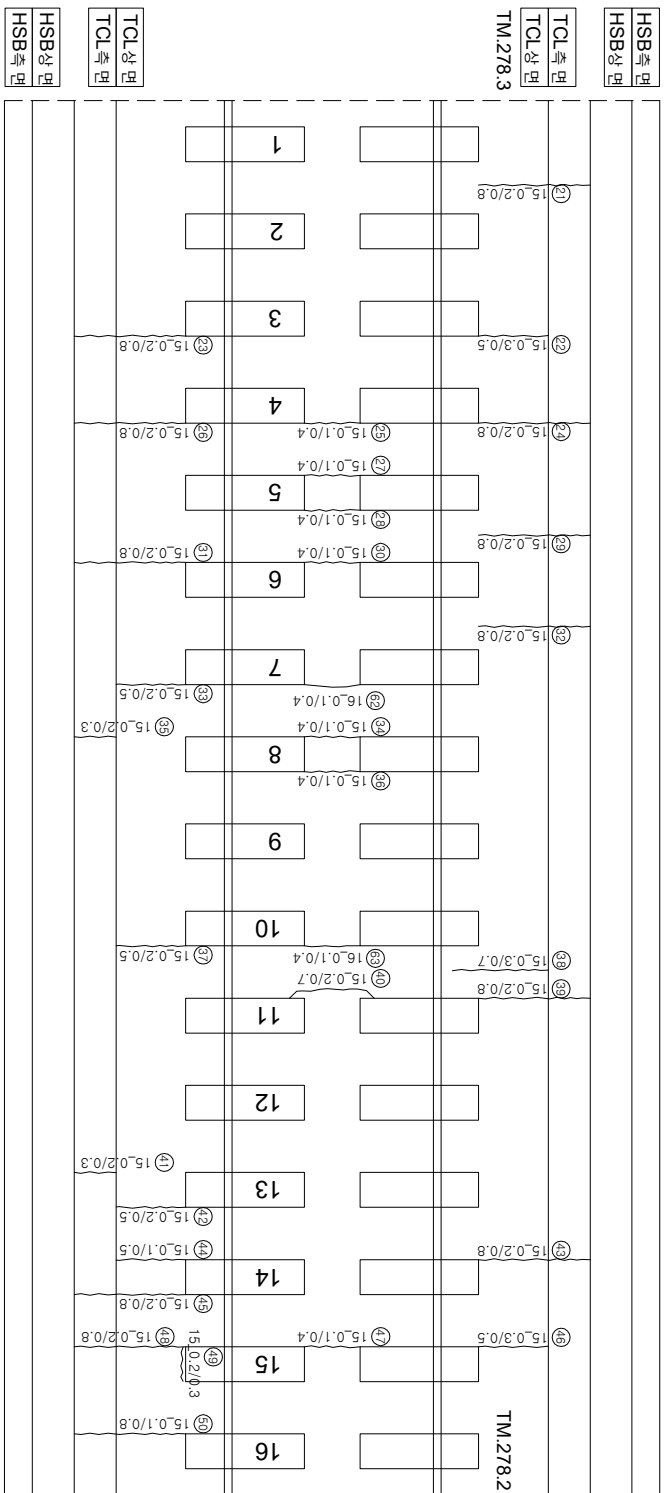


호남고속선 영천터널 - 토공노반 - 부본선 - 7(43.450~43.460km, L=10m)

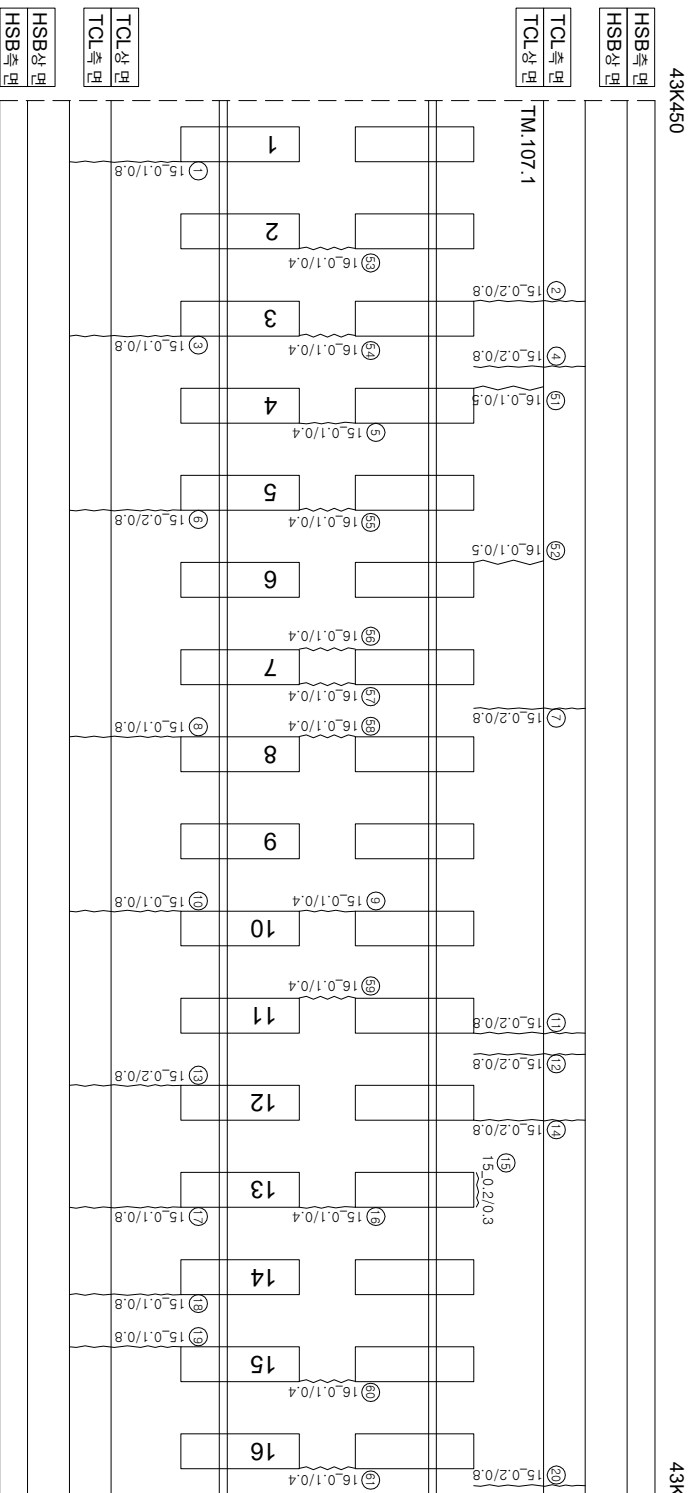

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.8 m		56	균열	0.1 mm	0.4 m	
2	균열	0.2 mm	0.8 m		57	균열	0.1 mm	0.4 m	
3	균열	0.1 mm	0.8 m		58	균열	0.1 mm	0.4 m	
4	균열	0.2 mm	0.8 m		59	균열	0.1 mm	0.4 m	
5	균열	0.1 mm	0.4 m		60	균열	0.1 mm	0.4 m	
6	균열	0.2 mm	0.8 m		61	균열	0.1 mm	0.4 m	
7	균열	0.2 mm	0.8 m		62	균열	0.1 mm	0.4 m	
8	균열	0.1 mm	0.8 m		63	균열	0.1 mm	0.4 m	
9	균열	0.1 mm	0.4 m		64				
10	균열	0.1 mm	0.8 m		65				
11	균열	0.2 mm	0.8 m		66				
12	균열	0.2 mm	0.8 m		67				
13	균열	0.2 mm	0.8 m		68				
14	균열	0.2 mm	0.8 m		69				
15	경계부 균열	0.2 mm	0.3 m		70				
16	균열	0.1 mm	0.4 m		71				
17	균열	0.1 mm	0.8 m		72				
18	균열	0.1 mm	0.8 m		73				
19	균열	0.1 mm	0.8 m		74				
20	균열	0.2 mm	0.8 m		75				
21	균열	0.2 mm	0.8 m		76				
22	균열	0.3 mm	0.5 m		77				
23	균열	0.2 mm	0.8 m		78				
24	균열	0.2 mm	0.8 m		79				
25	균열	0.1 mm	0.4 m		80				
26	균열	0.2 mm	0.8 m		81				
27	균열	0.1 mm	0.4 m		82				
28	균열	0.1 mm	0.4 m		83				
29	균열	0.2 mm	0.8 m		84				
30	균열	0.1 mm	0.4 m		85				
31	균열	0.2 mm	0.8 m		86				
32	균열	0.2 mm	0.8 m		87				
33	균열	0.2 mm	0.5 m		88				
34	균열	0.1 mm	0.4 m		89				
35	균열	0.2 mm	0.3 m		90				
36	균열	0.1 mm	0.4 m		91				
37	균열	0.2 mm	0.5 m		92				
38	균열	0.3 mm	0.7 m		93				
39	균열	0.2 mm	0.8 m		94				
40	균열	0.2 mm	0.7 m		95				
41	균열	0.2 mm	0.3 m		96				
42	균열	0.2 mm	0.5 m		97				
43	균열	0.2 mm	0.8 m		98				
44	균열	0.1 mm	0.5 m		99				
45	균열	0.2 mm	0.8 m		100				
46	균열	0.3 mm	0.5 m		101				
47	균열	0.1 mm	0.4 m		102				
48	균열	0.2 mm	0.8 m		103				
49	경계부 균열	0.2 mm	0.3 m		104				
50	균열	0.1 mm	0.8 m		105				
51	균열	0.1 mm	0.5 m		106				
52	균열	0.1 mm	0.5 m		107				
53	균열	0.1 mm	0.4 m		108				
54	균열	0.1 mm	0.4 m		109				
55	균열	0.1 mm	0.4 m		110				

시행사	영역명	용역사	이복영	김은강 김경기 윤석기	구간	구간					
						과업책임자	장	분과책임자			
KORAIL 한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송-광주승강간 콘크리트케도 정검구역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원					0.2220	(0.300이하 : 흑색)		재료분리	
							0.4820	(0.300초과 0.500이하 : 청색)		망상	
							0.6620	(0.500초과 1.000이하 : 적색)		바리·바락, 파손	
							1.0020	(1.000이상 : 분홍색)		변태	
										시공이음분리, 흙분리	