


호남고속선 호암교-94(46.970~46.977km, S19-3)

46K970

46K977
19 SPAN - 3

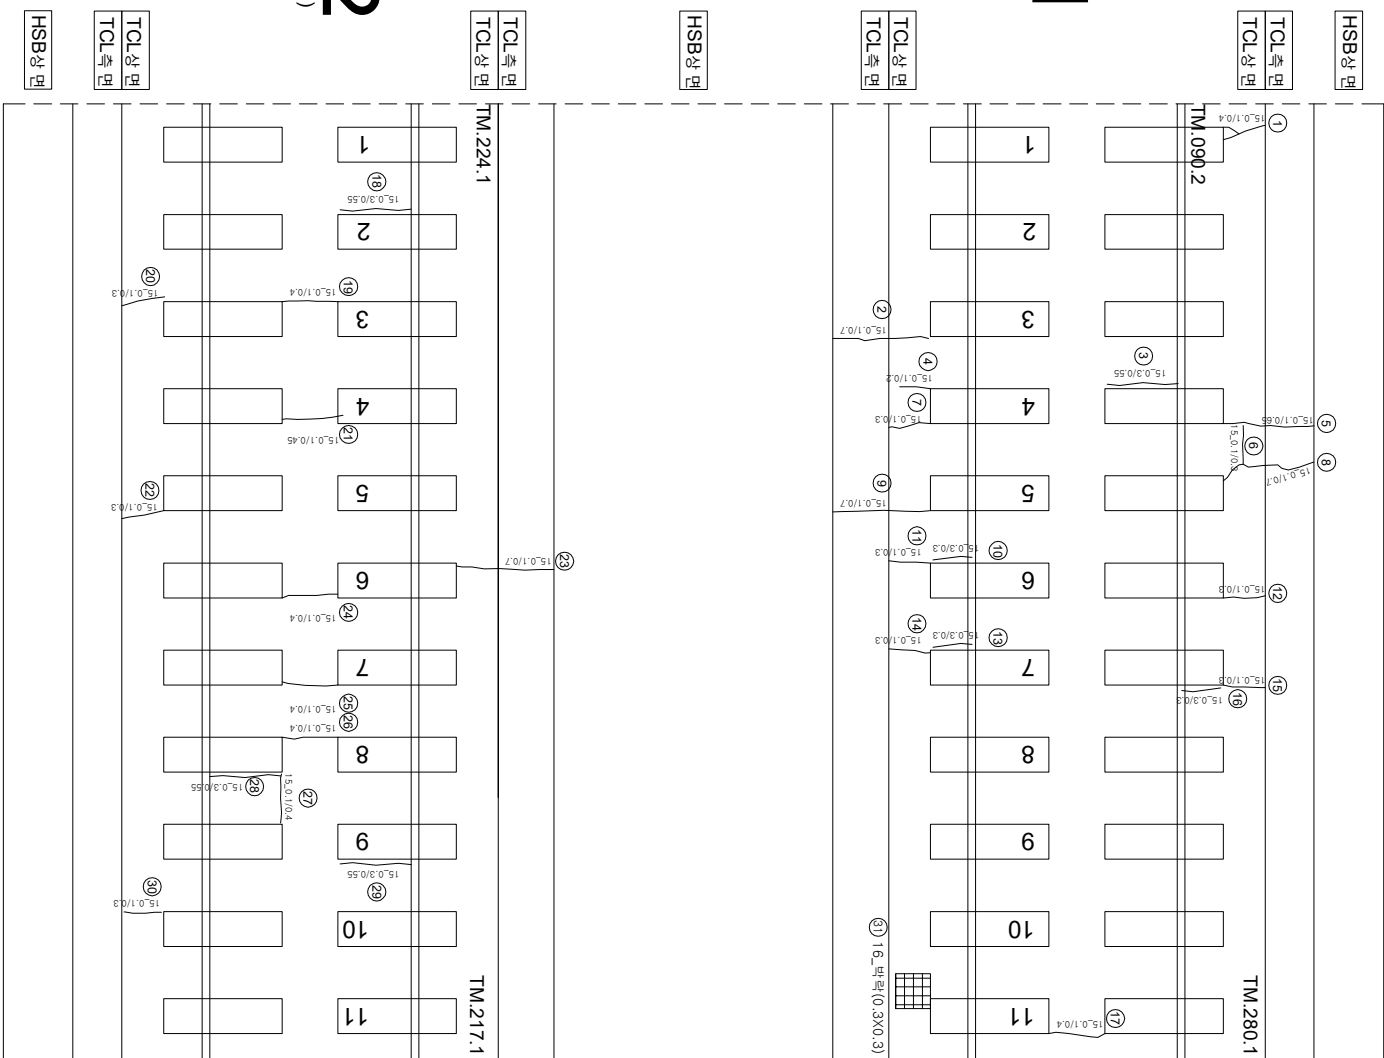

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	군열	0.1 mm	0.4 m		56				
2	군열	0.1 mm	0.7 m		57				
3	경계부 군열	0.3 mm	0.55 m		58				
4	군열	0.1 mm	0.2 m		59				
5	군열	0.1 mm	0.65 m		60				
6	군열	0.1 mm	0.3 m		61				
7	군열	0.1 mm	0.3 m		62				
8	군열	0.1 mm	0.7 m		63				
9	군열	0.1 mm	0.7 m		64				
10	경계부 군열	0.3 mm	0.3 m		65				
11	군열	0.1 mm	0.3 m		66				
12	군열	0.1 mm	0.3 m		67				
13	경계부 군열	0.3 mm	0.3 m		68				
14	군열	0.1 mm	0.3 m		69				
15	군열	0.1 mm	0.3 m		70				
16	경계부 군열	0.3 mm	0.3 m		71				
17	군열	0.1 mm	0.4 m		72				
18	경계부 군열	0.3 mm	0.55 m		73				
19	군열	0.1 mm	0.4 m		74				
20	군열	0.1 mm	0.3 m		75				
21	군열	0.1 mm	0.45 m		76				
22	군열	0.1 mm	0.3 m		77				
23	군열	0.1 mm	0.7 m		78				
24	군열	1.0 mm	0.4 m		79				
25	군열	0.1 mm	0.4 m		80				
26	군열	0.1 mm	0.4 m		81				
27	군열	0.1 mm	0.4 m		82				
28	경계부 군열	0.3 mm	0.55 m		83				
29	경계부 군열	0.3 mm	0.55 m		84				
30	군열	0.1 mm	0.3 m		85				
31	백악	0.3 m	0.3 m		86				
32					87				
33					88				
34					89				
35					90				
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

시	행	사	용	역	영	사	단		
							과업 책임지	장 소	
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영	간 윤 강 김 경 기 문 준 기	영원	 02220 (0.3mm이하 : 흑색)	 점도도상판리	 재료판리
							 04220 (0.3mm초과 0.5mm이하 : 황색)	 영상	 철근노출
							 06220 (0.5mm초과 1.0mm미만 : 적색)	 바리,바라,파손	 누수수온부
							 14220 (1.0mm이상 : 홍색)	 변태	 시공이음판리,홍판리