

호남고속선 호암교-100(47.012~47.019km, S20-4)

47K012


47K019
20 SPAN - 4

HSB 銀行

TCL추진	TCL상면
-------	-------

TM.235.1

TM.270.3

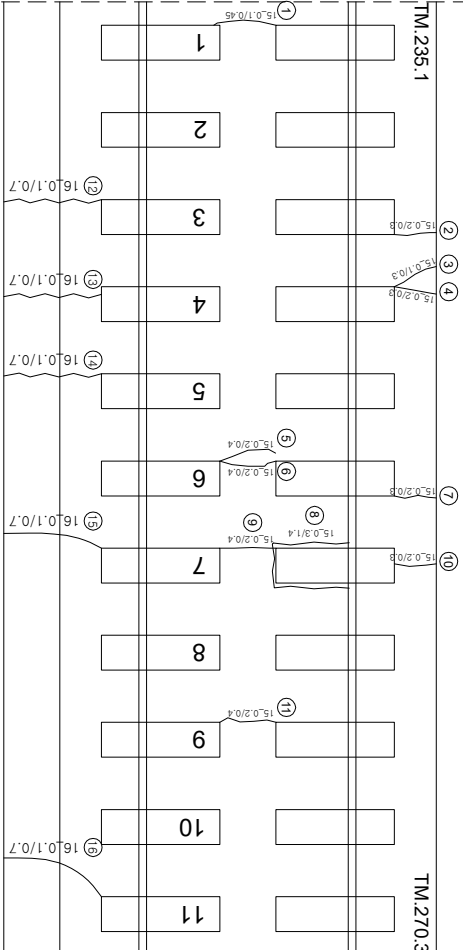

TCL상면	TCL측면
-------	-------

—

HSB상단

TCL	TCL
상	상
면	면

TM.236.3

12 (04/04)

(아
호)

TCL 상	TCL
TCL	TCL

—

HSB 01 01

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.45 m		56				
2	균열	0.2 mm	0.3 m		57				
3	균열	0.1 mm	0.3 m		58				
4	균열	0.2 mm	0.3 m		59				
5	균열	0.2 mm	0.4 m		60				
6	균열	0.2 mm	0.4 m		61				
7	균열	0.2 mm	0.3 m		62				
8	경계부 균열	0.3 mm	1.4 m		63				
9	균열	0.2 mm	0.4 m		64				
10	균열	0.2 mm	0.3 m		65				
11	균열	0.2 mm	0.4 m		66				
12	균열	0.1 mm	0.7 m		67				
13	균열	0.1 mm	0.7 m		68				
14	균열	0.1 mm	0.7 m		69				
15	균열	0.1 mm	0.7 m		70				
16	균열	0.1 mm	0.7 m		71				
17					72				
18					73				
19					74				
20					75				
21					76				
22					77				
23					78				
24					79				
25					80				
26					81				
27					82				
28					83				
29					84				
30					85				
31					86				
32					87				
33					88				
34					89				
35					90				
36					91				
37					92				
38					93				
39					94				
40					95				
41					96				
42					97				
43					98				
44					99				
45					100				
46					101				
47					102				
48					103				
49					104				
50					105				
51					106				
52					107				
53					108				
54					109				
55					110				

시행사	공사명	역명	역사	건설		건설	
				계획책임지	공사책임지		
한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송-광주선정가 본크리트케도 정검용역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이복영	김경기 윤석기	건설	 02220 (0.3m이하 : 열식)	 철도노출
						 04820 (0.3m초과 0.5m이하 : 광식)	 철도노출
						 06920 (0.5m초과 1.0m미만 : 광식)	 철도노출
						 14020 (1.0m이상 : 통행식)	 철도노출
						 14020 (1.0m이상 : 통행식)	 철도노출