


한남고속선 서평교 - 토아노반 - 22(48.200~48.210km, L=10m)

48K200

48K21C

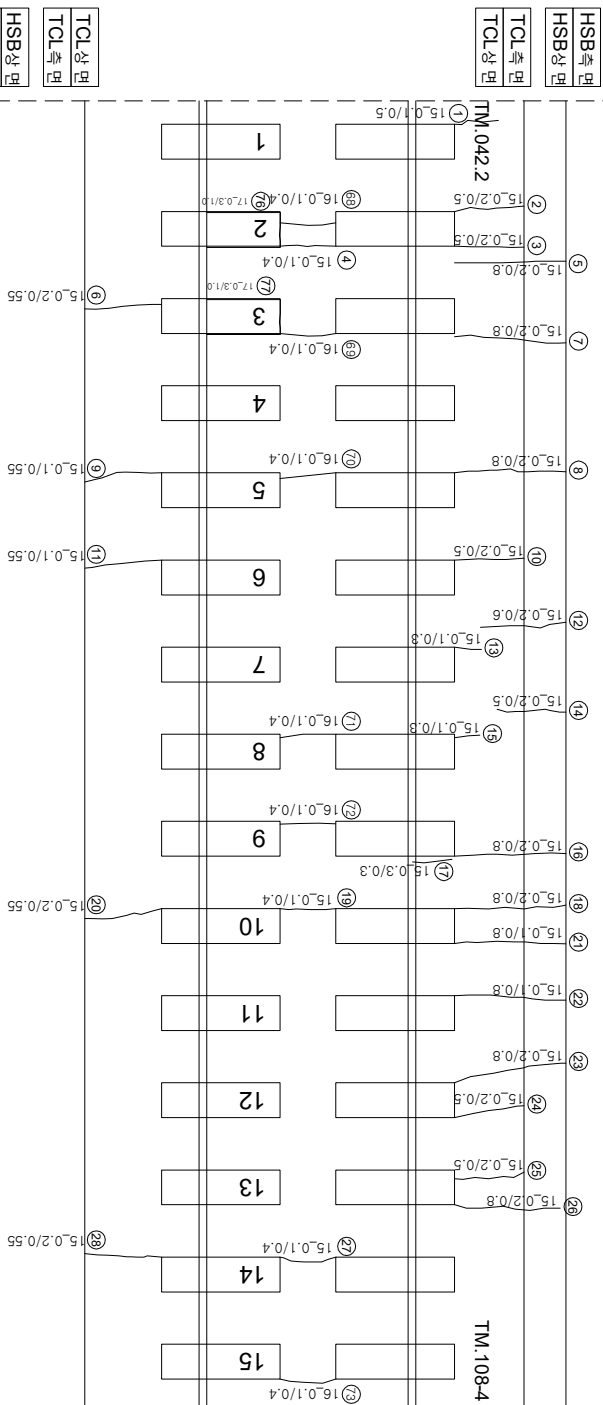

(아)

(와
0와
)

TCL상면	HSB상면
TCL측면	HSB측면

HSB 銀行


채움콘크리트

HSB	HSB
HSB	HSB

HSB 0101

TCL상면

TCL상표

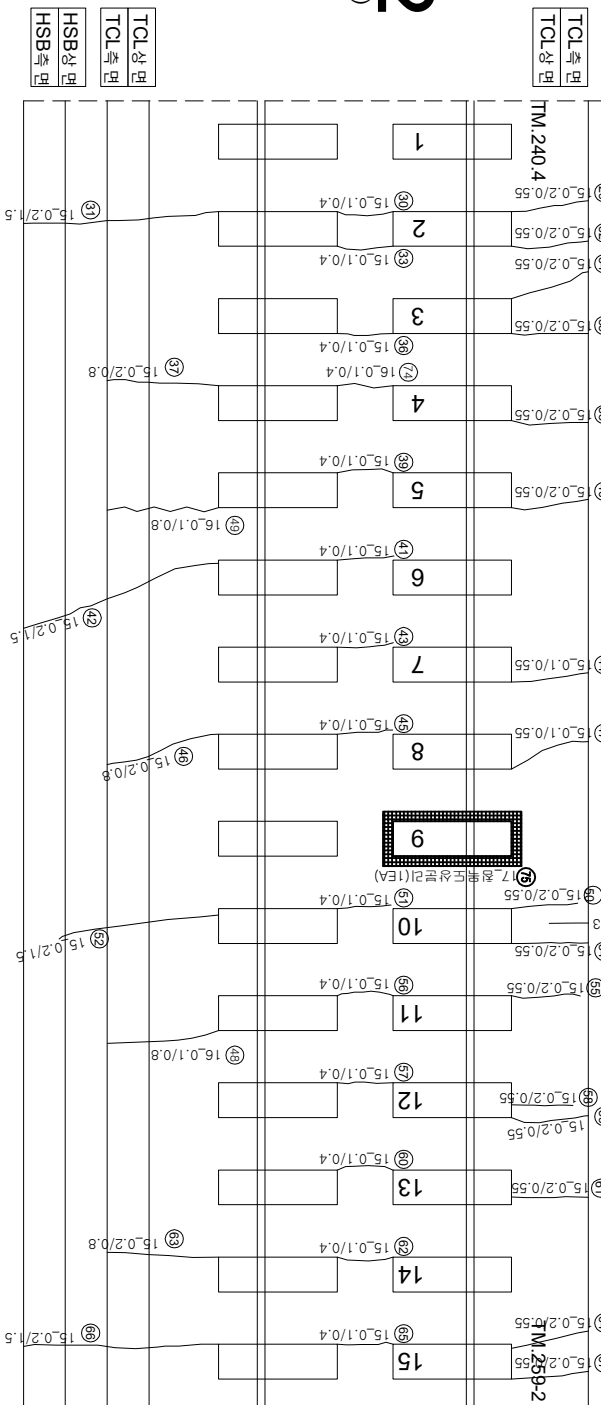

07
08

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

TCL상면	TCL클리어면
-------	---------

ICL

HSB 47

HSB KIR

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.2	0.5	m	56	균열	0.1	0.4	m
2	균열	0.2	0.5	m	57	균열	0.1	0.4	m
3	균열	0.2	0.5	m	58	균열	0.2	0.55	m
4	균열	0.1	0.4	m	59	균열	0.2	0.55	m
5	균열	0.2	0.8	m	60	균열	0.1	0.4	m
6	균열	0.2	0.55	m	61	균열	0.2	0.55	m
7	균열	0.2	0.8	m	62	균열	0.1	0.4	m
8	균열	0.2	0.8	m	63	균열	0.2	0.8	m
9	균열	0.1	0.55	m	64	균열	0.2	0.55	m
10	균열	0.2	0.5	m	65	균열	0.1	0.4	m
11	균열	0.1	0.55	m	66	균열	0.2	1.5	m
12	균열	0.2	0.6	m	67	균열	0.2	0.55	m
13	균열	0.1	0.3	m	68	균열	0.1	0.4	m
14	균열	0.2	0.5	m	69	균열	0.1	0.4	m
15	균열	0.1	0.8	m	70	균열	0.1	0.4	m
16	균열	0.2	0.8	m	71	균열	0.1	0.4	m
17	경계부 균열	0.3	0.3	m	72	균열	0.1	0.4	m
18	균열	0.2	0.4	m	73	균열	0.1	0.4	m
19	균열	0.1	0.4	m	74	균열	0.1	0.4	m
20	균열	0.2	0.55	m	75	선택도상판리	1.0	68	신규
21	균열	0.1	0.8	m	76	균열	0.3	1.0	m
22	균열	0.1	0.8	m	77	균열	0.3	1.0	m
23	균열	0.2	0.8	m	78				
24	균열	0.2	0.5	m	79				
25	균열	0.2	0.5	m	80				
26	균열	0.2	0.8	m	81				
27	균열	0.1	0.4	m	82				
28	균열	0.2	0.55	m	83				
29	균열	0.2	0.55	m	84				
30	균열	0.1	0.4	m	85				
31	균열	0.2	1.5	m	86				
32	균열	0.2	0.55	m	87				
33	균열	0.1	0.4	m	88				
34	균열	0.2	0.55	m	89				
35	균열	0.2	0.55	m	90				
36	균열	0.1	0.4	m	91				
37	균열	0.2	0.8	m	92				
38	균열	0.2	0.55	m	93				
39	균열	0.1	0.4	m	94				
40	균열	0.2	0.55	m	95				
41	균열	0.1	0.4	m	96				
42	균열	0.2	1.5	m	97				
43	균열	0.1	0.4	m	98				
44	균열	0.1	0.55	m	99				
45	균열	0.1	0.4	m	100				
46	균열	0.2	0.8	m	101				
47	균열	0.1	0.55	m	102				
48	균열	0.1	0.8	m	103				
49	균열	0.1	0.8	m	104				
50	균열	0.2	0.55	m	105				
51	균열	0.1	0.4	m	106				
52	균열	0.2	1.5	m	107				
53	균열	0.2	0.3	m	108				
54	균열	0.2	0.55	m	109				
55	균열	0.2	0.55	m	110				

[illegible]