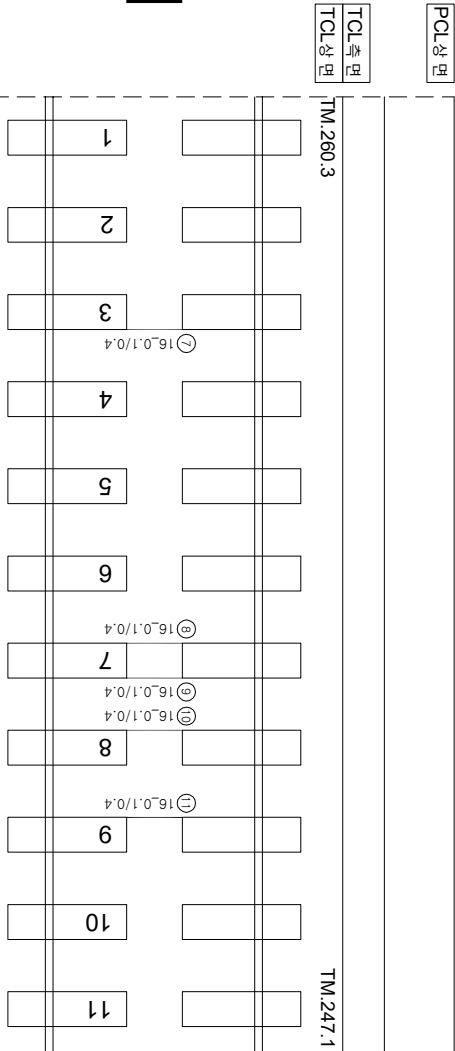



화남고속선장구교-103(49.209~49.216km, S21-2)

49K209


49K216
21 SPAN -2


$$\left(\frac{a}{0} \right)$$

(아호)

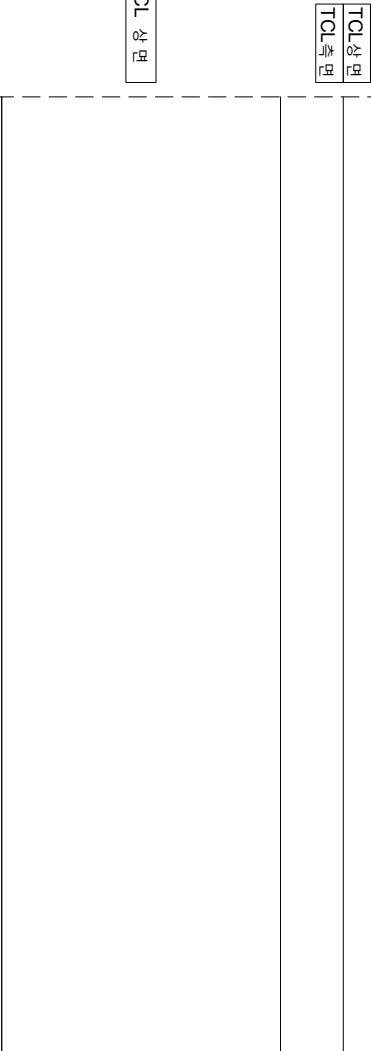

PCL 샘플

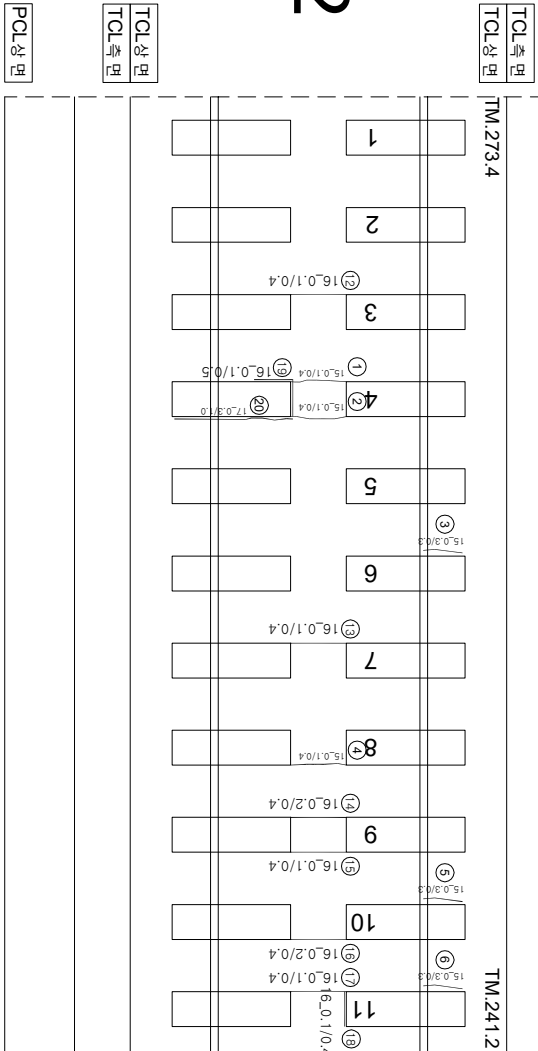

12 (04 05)

(유원)

연번	손상	폭	연장	비고	연번	손상	폭	연장	비고
1	균열	0.1 mm	0.4 m		55				
2	균열	0.1 mm	0.4 m		56				
3	강재부 균열	0.3 mm	0.3 m		57				
4	균열	0.1 mm	0.4 m		58				
5	강재부 균열	0.3 mm	0.3 m		59				
6	강재부 균열	0.3 mm	0.3 m		60				
7	균열	0.1 mm	0.4 m		61				
8	균열	0.1 mm	0.4 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.4 m		64				
11	균열	0.1 mm	0.4 m		65				
12	균열	0.1 mm	0.4 m		66				
13	균열	0.1 mm	0.4 m		67				
14	균열	0.2 mm	0.4 m		68				
15	균열	0.1 mm	0.4 m		69				
16	균열	0.2 mm	0.4 m		70				
17	균열	0.1 mm	0.4 m		71				
18	강재부 균열	0.1 mm	0.4 m		72				
19	강재부 균열	0.1 mm	0.5 m		73				
20	강재부 균열	0.3 mm	1.0 m	신규	74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]