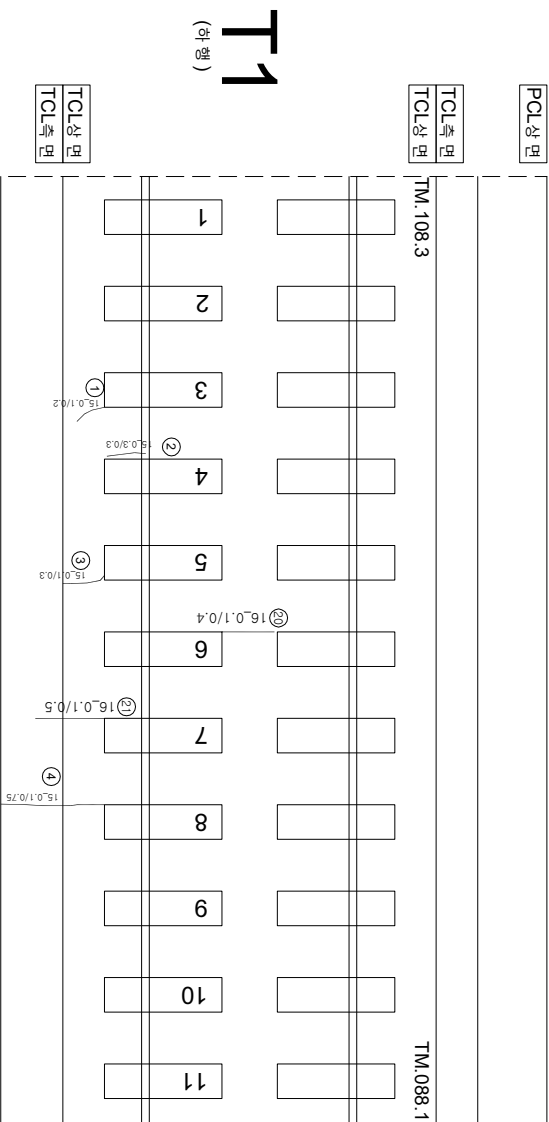
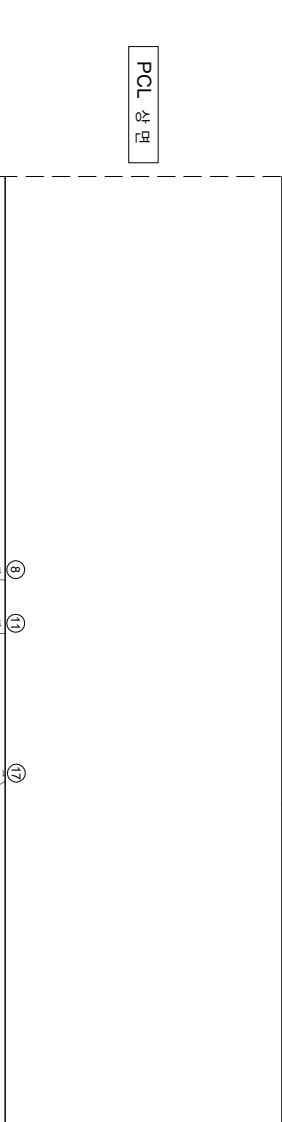


호남고속선 장구교_201(49.895~49.902km, S40-5)


P40
49K902

49K895


$$\left(\frac{a}{0^+} \right)$$
$$\left(\begin{array}{c} \text{아} \\ \hline 0\text{아} \\ \text{호} \end{array} \right)$$


PCL 상용

PCL 상용

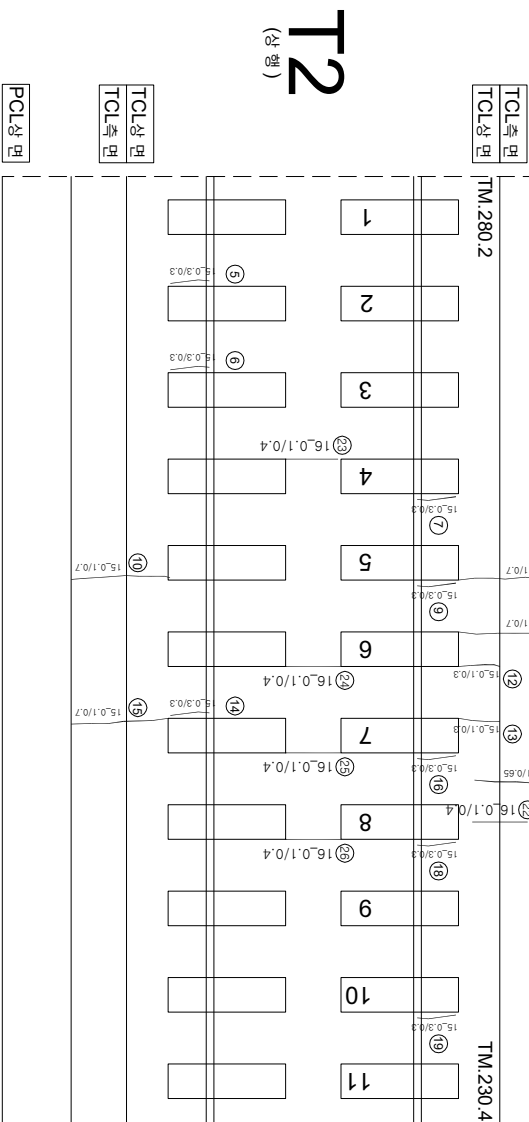

T2
(상하)

(상영)

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.2 m		55				
2	경계부 균열	0.3 mm	0.3 m		56				
3	균열	0.1 mm	0.3 m		57				
4	균열	0.1 mm	0.75 m		58				
5	경계부 균열	0.3 mm	0.3 m		59				
6	경계부 균열	0.3 mm	0.3 m		60				
7	경계부 균열	0.3 mm	0.3 m		61				
8	균열	0.1 mm	0.7 m		62				
9	경계부 균열	0.3 mm	0.3 m		63				
10	균열	0.1 mm	0.7 m		64				
11	균열	0.1 mm	0.7 m		65				
12	균열	0.1 mm	0.3 m		66				
13	균열	0.1 mm	0.3 m		67				
14	경계부 균열	0.3 mm	0.3 m		68				
15	균열	0.1 mm	0.7 m		69				
16	경계부 균열	0.3 mm	0.3 m		70				
17	균열	0.1 mm	0.65 m		71				
18	경계부 균열	0.3 mm	0.3 m		72				
19	경계부 균열	0.3 mm	0.3 m		73				
20	균열	0.1 mm	0.4 m		74				
21	균열	0.1 mm	0.5 m		75				
22	균열	0.1 mm	0.4 m		76				
23	균열	0.1 mm	0.4 m		77				
24	균열	0.1 mm	0.4 m		78				
25	균열	0.1 mm	0.4 m		79				
26	균열	0.1 mm	0.4 m		80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시행 사	영역	영역명	영역사	이북영역		연				
				과업책임자	장분야책임자					
 한국철도공사 KOREA RAILROAD	2017년도 호남고속선 오송-광주승강간 콘크리트케도 점검용역	(주)한국구조물안전연구원 (주)한국도로안전연구원 (제)한국건설품질연구원	강원강 김정기 윤석기	0.220	0.300이하 : 흑색		재료분리			
				0.420	0.300초과 0.500이하 : 청색		망상		철근노출	
				0.620	0.500초과 1.000미만 : 적색		바리,바리,파손		누수,습윤부	
				1.020	1.000이상 : 분홍색		변태		3% 이상 시공이음분리,층분리	
				~						