


화남고수선 신당교 - 132 (52.907~52.914km, S26-5)

52K914

52K907

26 SPAN - 5

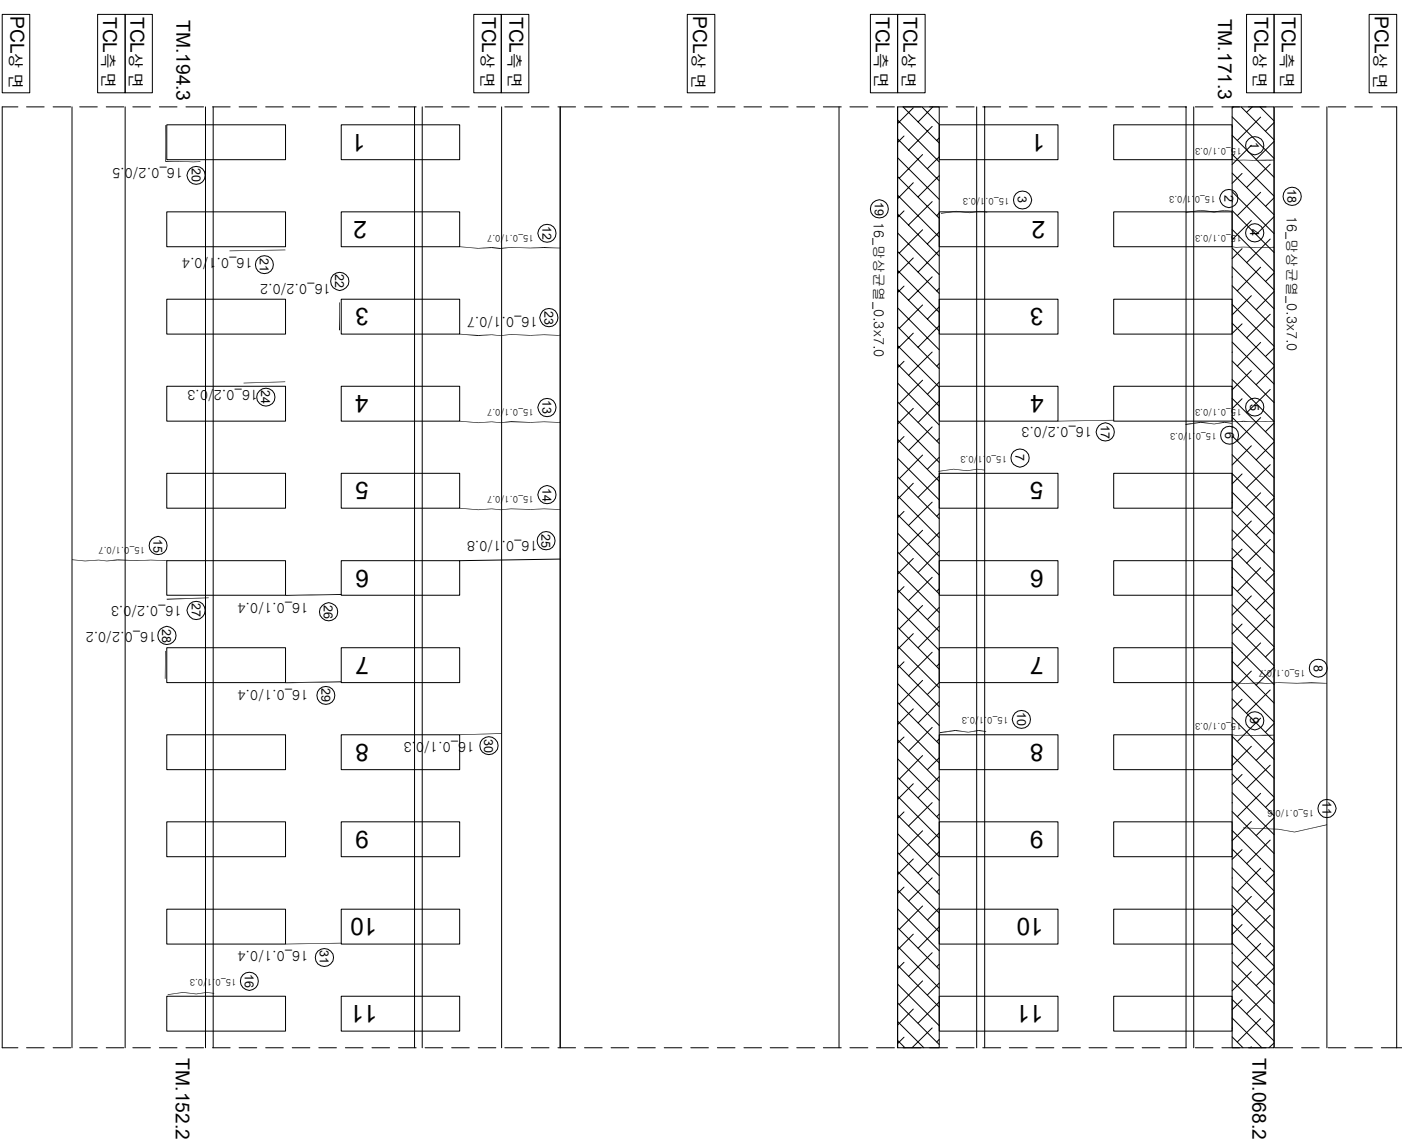

P26

연번	순상	북	연장	비고	연번	순상	북	연장	비고
1	군열	0.1 mm	0.3 m		56				
2	장계부 군열	0.1 mm	0.3 m		56				
3	장계부 군열	0.1 mm	0.3 m		57				
4	군열	0.1 mm	0.3 m		58				
5	군열	0.1 mm	0.3 m		59				
6	장계부 군열	0.1 mm	0.3 m		60				
7	장계부 군열	0.1 mm	0.3 m		61				
8	군열	0.1 mm	0.7 m		62				
9	군열	0.1 mm	0.3 m		63				
10	장계부 군열	0.1 mm	0.3 m		64				
11	군열	0.1 mm	0.6 m		65				
12	군열	0.1 mm	0.7 m		66				
13	군열	0.1 mm	0.7 m		67				
14	군열	0.1 mm	0.7 m		68				
15	군열	0.1 mm	0.7 m		69				
16	장계부 군열	0.1 mm	0.3 m		70				
17	군열	0.2 mm	0.3 m		71				
18	양상군열	0.3 m	7.0 m		72				
19	양상군열	0.3 m	7.0 m		73				
20	장계부 군열	0.2 mm	0.5 m		74				
21	장계부 군열	0.2 mm	0.4 m		75				
22	장계부 군열	0.2 mm	0.2 m		76				
23	군열	0.1 mm	0.7 m		77				
24	장계부 군열	0.2 mm	0.3 m		78				
25	군열	0.1 mm	0.4 m		79				
26	군열	0.1 mm	0.4 m		80				
27	장계부 군열	0.2 mm	0.3 m		81				
28	군열	0.2 mm	0.2 m		82				
29	군열	0.1 mm	0.4 m		83				
30	군열	0.1 mm	0.3 m		84				
31	군열	0.1 mm	0.4 m		85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

 KORAIL KOREA RAILROAD	한국철도공사	시행	사명	영역	영업	종업원 수	주요 업무 (주) 한국구조물안전연구원 (주) 한국로터오토탄연구원 (제) 한국건설품질연구회	이북영		영업권	간선	선형		기타				
								국립공원지	정비사업지			영역내지	국립공원지					
													0.2220 (0.3mm이하 : 흑색)		원목도상판리		제로판리	
													0.6420 (0.3mm초과 0.5mm이하 : 청색)		양산		철근노출	
													0.6820 (0.5mm초과 1.0mm이하 : 적색)		바리,바리,파손		누수수원부	
													1.0420 (1.0mm이상 : 분홍색)		변대		양양	
															시공아음반리,홍반리			