


한남고속선 중리터널 - 토공 노반 - 24(54.500~54.510km, L=10m)

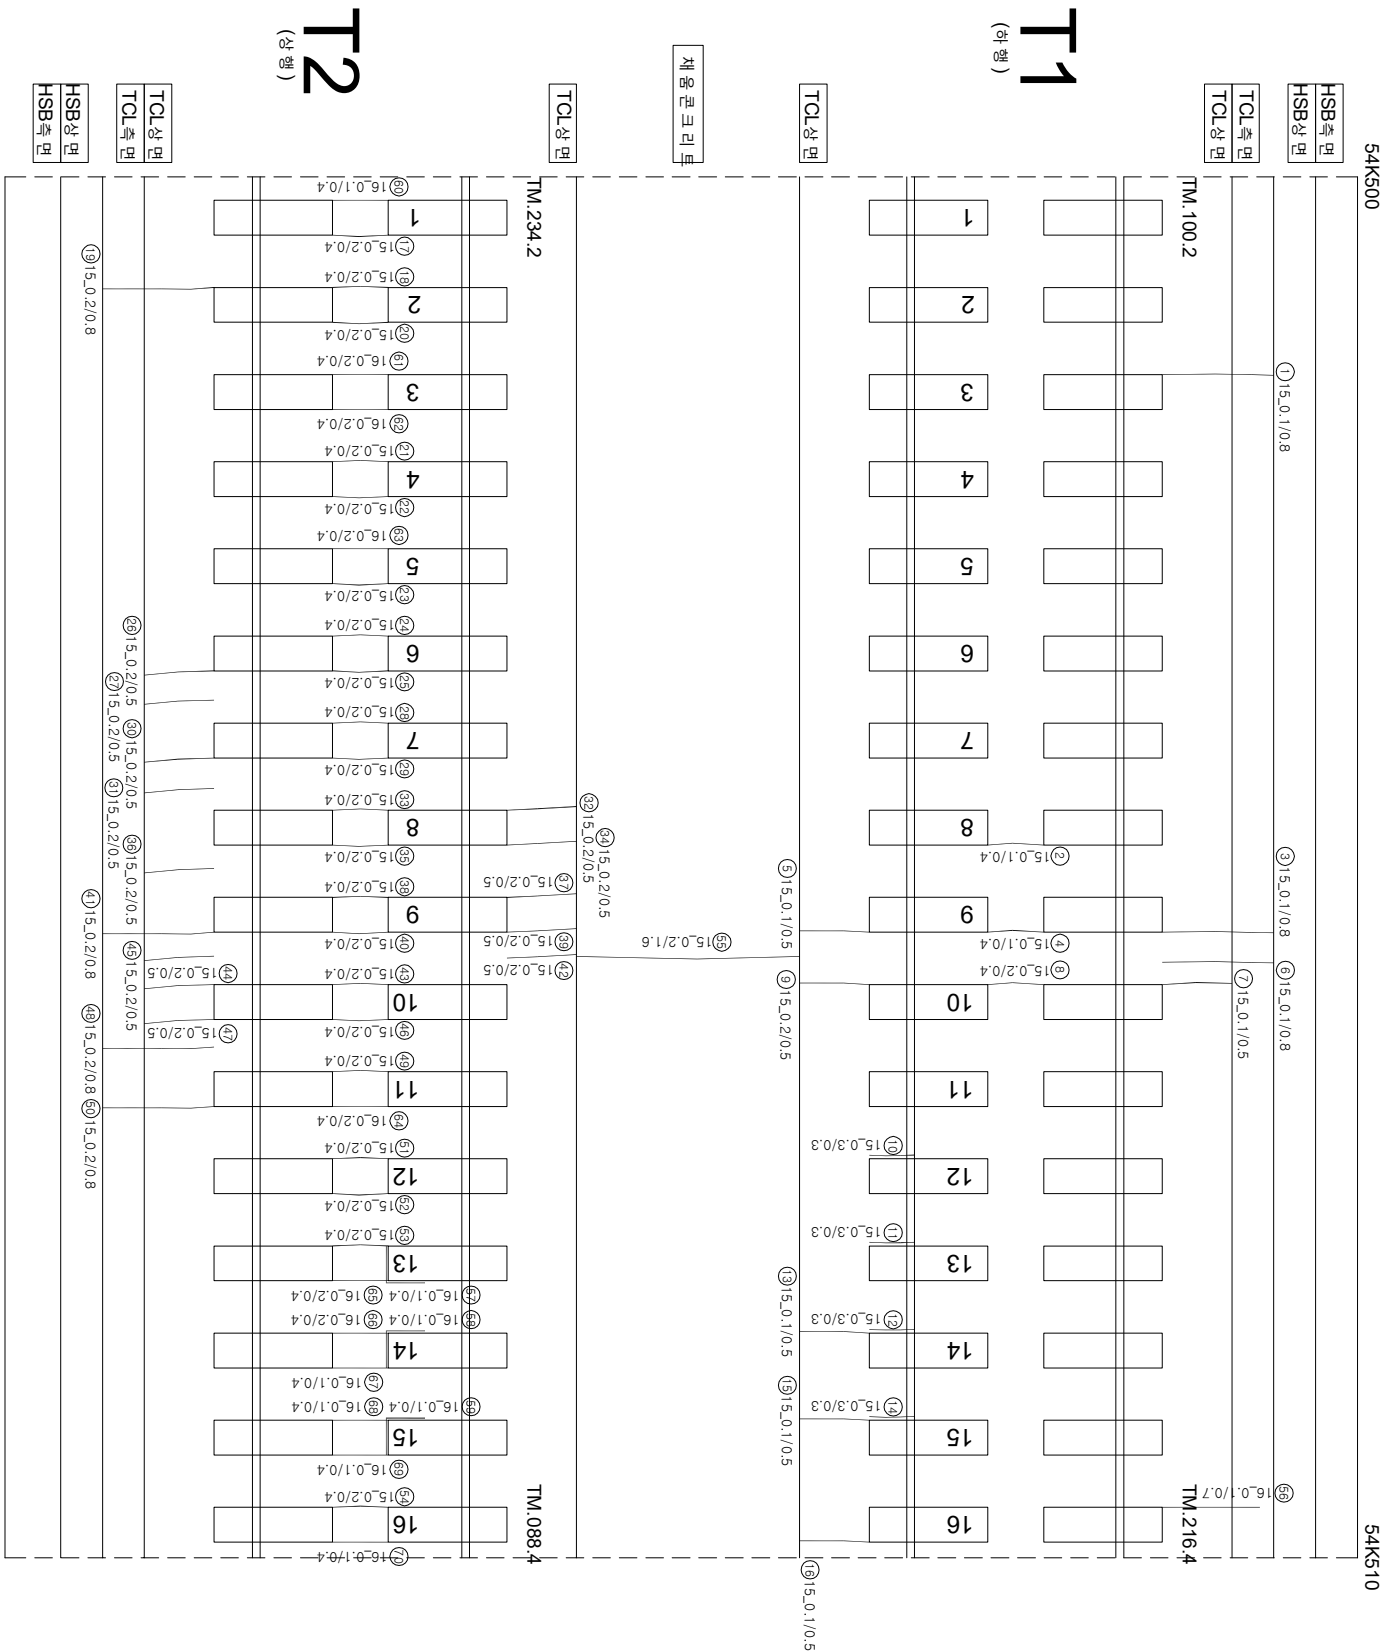

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	균열	0.1 mm	0.8 m		56	균열	0.2 mm	1.6 m	
2	균열	0.1 mm	0.4 m		55	균열	0.1 mm	0.7 m	
3	균열	0.1 mm	0.8 m		57	균열부 균열	0.1 mm	0.4 m	
4	균열	0.1 mm	0.4 m		58	균열부 균열	0.1 mm	0.4 m	
5	균열	0.1 mm	0.5 m		59	균열부 균열	0.1 mm	0.4 m	
6	균열	0.1 mm	0.8 m		60	균열	0.1 mm	0.4 m	
7	균열	0.1 mm	0.5 m		61	균열	0.2 mm	0.4 m	
8	균열	0.2 mm	0.4 m		62	균열	0.2 mm	0.4 m	
9	균열	0.2 mm	0.5 m		63	균열	0.2 mm	0.4 m	
10	균열부 균열	0.3 mm	0.3 m		64	균열	0.2 mm	0.4 m	
11	균열부 균열	0.3 mm	0.3 m		65	균열	0.2 mm	0.4 m	
12	균열부 균열	0.3 mm	0.3 m		66	균열	0.2 mm	0.4 m	
13	균열	0.1 mm	0.5 m		67	균열	0.1 mm	0.4 m	
14	균열부 균열	0.3 mm	0.3 m		68	균열	0.1 mm	0.4 m	
15	균열	0.1 mm	0.5 m		69	균열	0.1 mm	0.4 m	
16	균열	0.1 mm	0.5 m		70	균열	0.1 mm	0.4 m	
17	균열	0.2 mm	0.4 m		71				
18	균열	0.2 mm	0.4 m		72				
19	균열	0.2 mm	0.8 m		73				
20	균열	0.2 mm	0.4 m		74				
21	균열	0.2 mm	0.4 m		75				
22	균열	0.2 mm	0.4 m		76				
23	균열	0.2 mm	0.4 m		77				
24	균열	0.2 mm	0.4 m		78				
25	균열	0.2 mm	0.4 m		79				
26	균열	0.2 mm	0.5 m		80				
27	균열	0.2 mm	0.5 m		81				
28	균열	0.2 mm	0.4 m		82				
29	균열	0.2 mm	0.4 m		83				
30	균열	0.2 mm	0.5 m		84				
31	균열	0.2 mm	0.5 m		85				
32	균열	0.2 mm	0.5 m		86				
33	균열	0.2 mm	0.4 m		87				
34	균열	0.2 mm	0.5 m		88				
35	균열	0.2 mm	0.4 m		89				
36	균열	0.2 mm	0.5 m		90				
37	균열	0.2 mm	0.5 m		91				
38	균열	0.2 mm	0.4 m		92				
39	균열	0.2 mm	0.5 m		93				
40	균열	0.2 mm	0.4 m		94				
41	균열	0.2 mm	0.8 m		95				
42	균열	0.2 mm	0.5 m		96				
43	균열	0.2 mm	0.4 m		97				
44	균열	0.2 mm	0.5 m		98				
45	균열	0.2 mm	0.5 m		99				
46	균열	0.2 mm	0.4 m		100				
47	균열	0.2 mm	0.5 m		101				
48	균열	0.2 mm	0.8 m		102				
49	균열	0.2 mm	0.4 m		103				
50	균열	0.2 mm	0.8 m		104				
51	균열	0.2 mm	0.4 m		105				
52	균열	0.2 mm	0.4 m		106				
53	균열	0.2 mm	0.4 m		107				
54	균열	0.2 mm	0.4 m		108				

시	행 사	명	여 명	영 사	인 지		구 간		
					개 입 하 인 지	창 이 별 영 지			
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 편곡리트캐도 정검용역	(적) 한국구조물안전연구원 (주)한국도로안전연구원 (재)한국건설품질연구원	이 박 영	강 경 기 김 경 기 윤 석 기	영 연	 0.220 (0.3mm이하 : 황색)  0.420 (0.3mm초과 0.5mm이하 : 청색)  0.620 (0.5mm초과 1.0mm미만 : 적색)  1.020 (1.0mm이상 : 분홍색)	 참목도상본리  양산  바리,바락,파손  백태	 재료본리  철근노출  누수,슬럼부  시공이음본리,종본리