


호남고속선 정지코가_325(59.159~59.166km, S61-3)

59K166

59K159

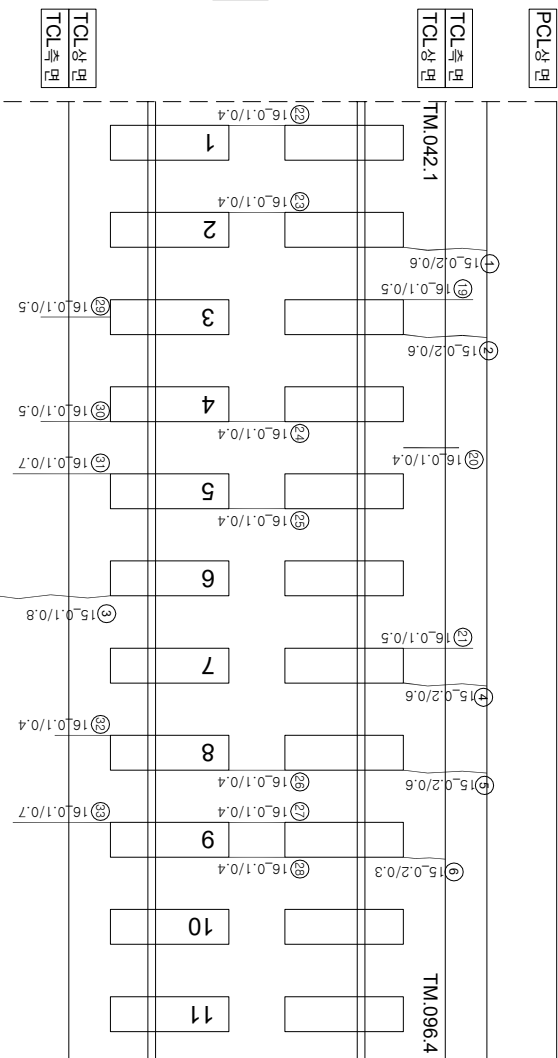

아
호


(아
안)

TCL 상미	TCL
TCL 키링	TCL

TCL集团

PCL 상용

PCL 상용

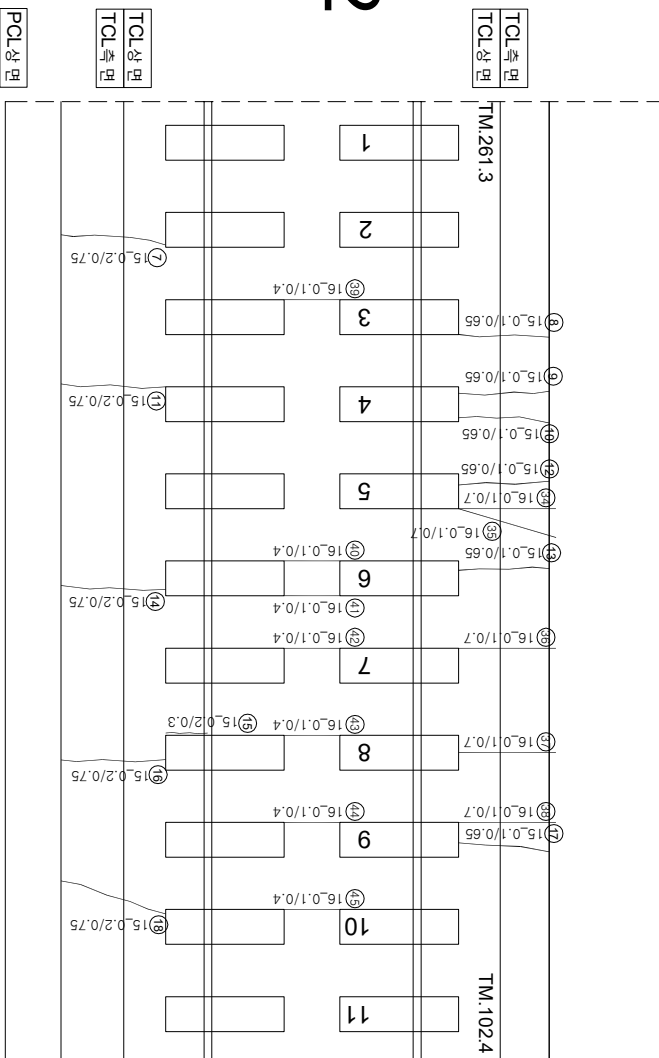

2차 (초, 중, 고)

(가) 0원

TCL상머	TCL
TCL축머	TCL

TCL 集团

PCL상면

PCL상면

연번	순상	목	연장	비고	연번	순상	목	연장	비고
1	균열	0.2 mm	0.6 m	m	55				
2	균열	0.2 mm	0.6 m	m	56				
3	균열	0.1 mm	0.8 m	m	57				
4	균열	0.2 mm	0.6 m	m	58				
5	균열	0.2 mm	0.6 m	m	59				
6	균열	0.2 mm	0.3 m	m	60				
7	균열	0.2 mm	0.8 m	m	61				
8	균열	0.1 mm	0.7 m	m	62				
9	균열	0.1 mm	0.7 m	m	63				
10	균열	0.1 mm	0.7 m	m	64				
11	균열	0.2 mm	0.8 m	m	65				
12	균열	0.1 mm	0.7 m	m	66				
13	균열	0.1 mm	0.7 m	m	67				
14	균열	0.2 mm	0.8 m	m	68				
15	균열	0.2 mm	0.3 m	m	69				
16	균열	0.2 mm	0.8 m	m	70				
17	균열	0.1 mm	0.7 m	m	71				
18	균열	0.2 mm	0.8 m	m	72				
19	균열	0.1 mm	0.5 m	m	73				
20	균열	0.1 mm	0.4 m	m	74				
21	균열	0.1 mm	0.5 m	m	75				
22	균열	0.1 mm	0.4 m	m	76				
23	균열	0.1 mm	0.4 m	m	77				
24	균열	0.1 mm	0.4 m	m	78				
25	균열	0.1 mm	0.4 m	m	79				
26	균열	0.1 mm	0.4 m	m	80				
27	균열	0.1 mm	0.4 m	m	81				
28	균열	0.1 mm	0.4 m	m	82				
29	균열	0.1 mm	0.5 m	m	83				
30	균열	0.1 mm	0.5 m	m	84				
31	균열	0.1 mm	0.7 m	m	85				
32	균열	0.1 mm	0.4 m	m	86				
33	균열	0.1 mm	0.7 m	m	87				
34	균열	0.1 mm	0.7 m	m	88				
35	균열	0.1 mm	0.7 m	m	89				
36	균열	0.1 mm	0.7 m	m	90				
37	균열	0.1 mm	0.7 m	m	91				
38	균열	0.1 mm	0.7 m	m	92				
39	균열	0.1 mm	0.4 m	m	93				
40	균열	0.1 mm	0.4 m	m	94				
41	균열	0.1 mm	0.4 m	m	95				
42	균열	0.1 mm	0.4 m	m	96				
43	균열	0.1 mm	0.4 m	m	97				
44	균열	0.1 mm	0.4 m	m	98				
45	균열	0.1 mm	0.4 m	m	99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]