

호남고속선 정지고가 _502(60.408~60.415km, S96-5)


P96
60K415

96

96 SPAN - 5

60K408

PCL상면

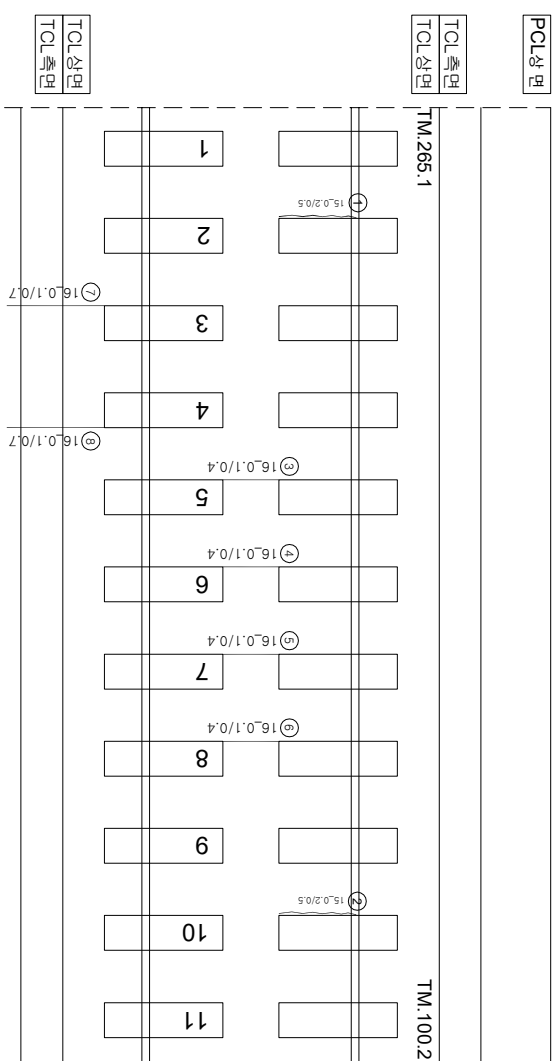


TCL 4000	TCL 4000
----------	----------

107

10.7

PCL 시험

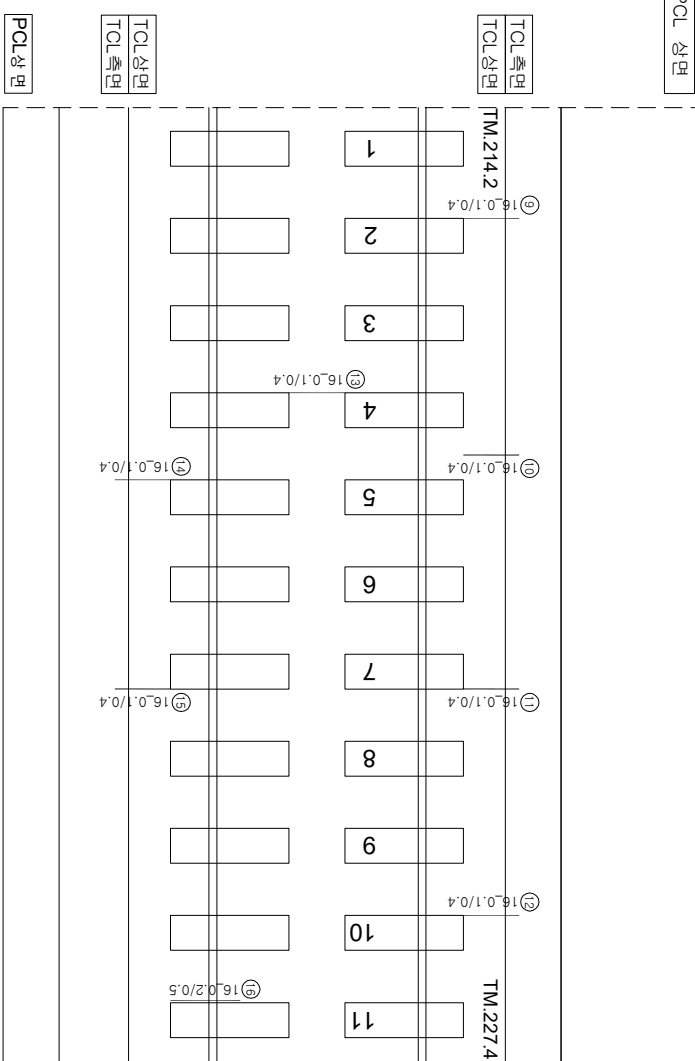

TCL 상용	TCL 추후
--------	--------

0.4/

 $\overline{0.4}$

/0.4

TM.227.4

TCL 40	TCL 40
TCL 40	TCL 40

0.4/

0.4

505

PCL상면

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	강계부 균열	0.2 mm	0.5 m		55				
2	강계부 균열	0.2 mm	0.5 m		56				
3	균열	0.1 mm	0.4 m		57				
4	균열	0.1 mm	0.4 m		58				
5	균열	0.1 mm	0.4 m		59				
6	균열	0.1 mm	0.4 m		60				
7	균열	0.1 mm	0.7 m		61				
8	균열	0.1 mm	0.7 m		62				
9	균열	0.1 mm	0.4 m		63				
10	균열	0.1 mm	0.4 m		64				
11	균열	0.1 mm	0.4 m		65				
12	균열	0.1 mm	0.4 m		66				
13	균열	0.1 mm	0.4 m		67				
14	균열	0.1 mm	0.4 m		68				
15	균열	0.1 mm	0.4 m		69				
16	강계부 균열	0.2 mm	0.5 m		70				
17					71				
18					72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

[illegible]