

호남고속선 정지 고가_565(60.849~60.856m, S109-3)

60K849

60K856
109 SPAN -3


109 SPAN-3

PCL상표

TCL 集团	TCL 产业
--------	--------

TM.235.2

TM.098.1

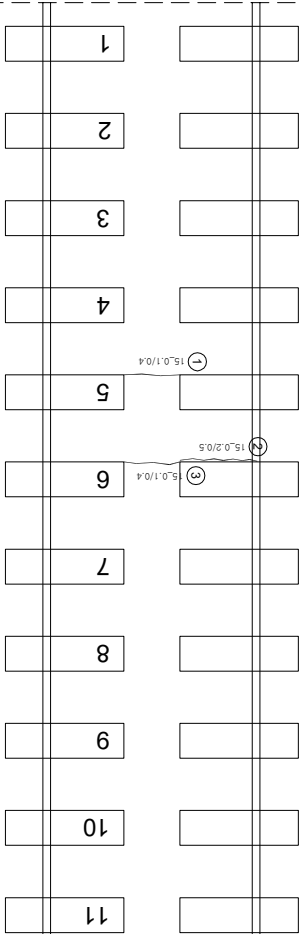


TCL 4059	TCL 4059
TCL 4059	TCL 4059

PCL 503

TCL 추면	TCL 상면
--------	--------

TM.086.3

TM.237.4

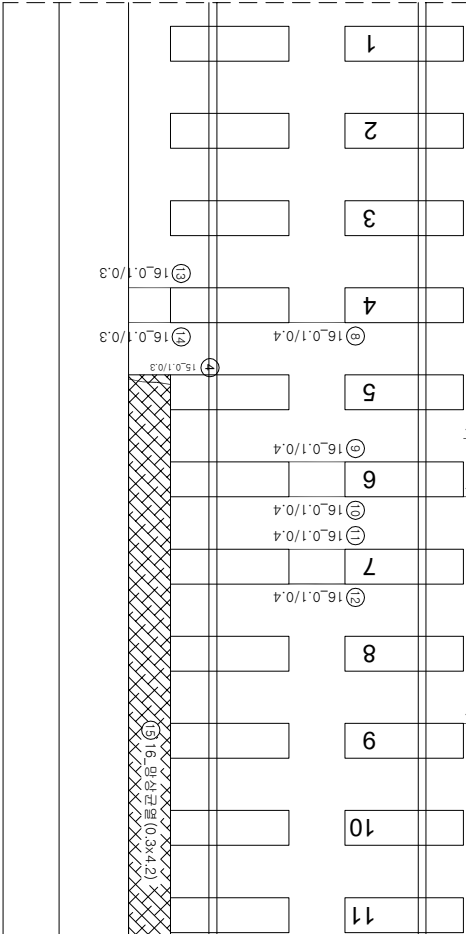

PCL상면

[

연번	내선	특	연장	비고	연번	내선	특	연장	비고
1	내선	0.1 mm	0.4 m		55				
2	간격부 내선	0.2 mm	0.5 m		56				
3	내선	0.1 mm	0.4 m		57				
4	내선	0.1 mm	0.3 m		58				
5	내선	0.1 mm	0.7 m		59				
6	내선	0.1 mm	0.7 m		60				
7	내선	0.1 mm	0.7 m		61				
8	내선	0.1 mm	0.4 m		62				
9	내선	0.1 mm	0.4 m		63				
10	내선	0.1 mm	0.4 m		64				
11	내선	0.1 mm	0.4 m		65				
12	내선	0.1 mm	0.4 m		66				
13	내선	0.1 mm	0.3 m		67				
14	내선	0.1 mm	0.3 m		68				
15	평균내선	0.3 m	4.2 m		69				
16					70				
17					71				
18					72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

시	행 사	종	여	명	사	단							
						과 제 별 인 지	장 아 별 책 영 지						
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점검용역			(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이 복 영	간 윤 경 김 경 기 문 선 기	정형		0.22% (0.5mm이하 : 흑색)		재료분리	
										0.42% (0.5mm초과 0.5mm이하 : 청색)		망상	
										0.62% (0.5mm초과 1.0mm이하 : 적색)		바리, 바락, 파손	
										1.02% (1.0mm이상 : 분홍색)		변태	