


호남고속선 중리교_38 (75.958~75.965km, S8-2)

75K958

PCL상표

75K965

8 SPAN - 2

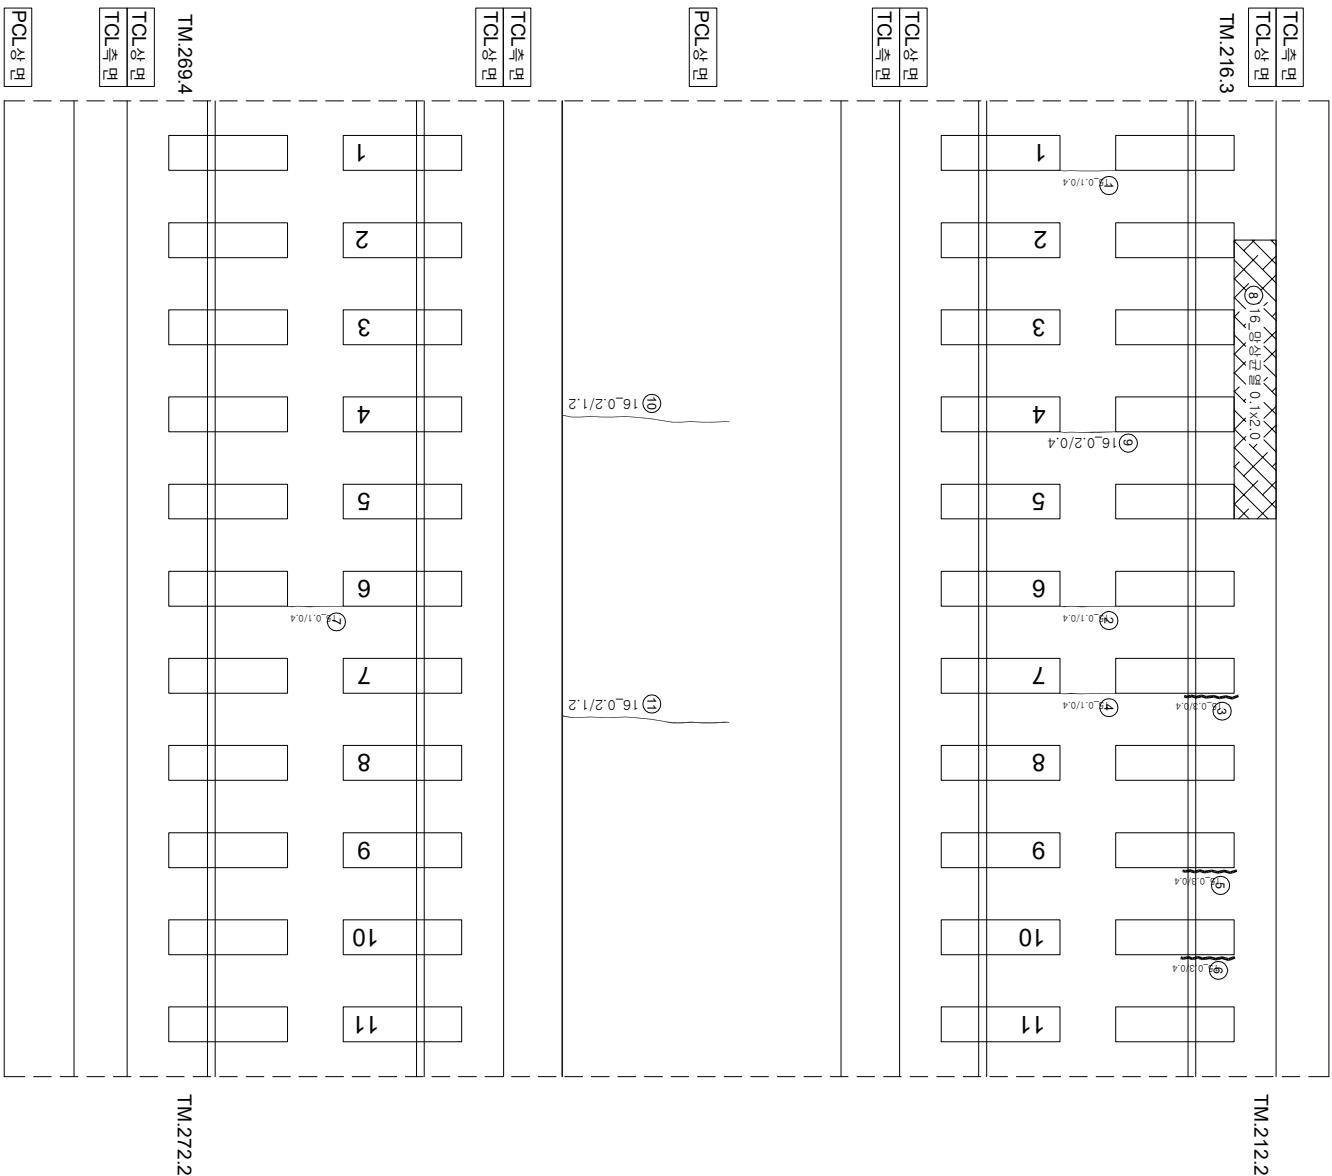

번호	순상	폭	연장	비고	번호	순상	폭	연장	비고
1	균열	0.1 mm	0.4 m		55				
2	균열	0.1 mm	0.4 m		56				
3	균열	0.3 mm	0.4 m		57				
4	균열	0.1 mm	0.4 m		58				
5	균열	0.3 mm	0.4 m		59				
6	균열	0.3 mm	0.4 m		60				
7	균열	0.1 mm	0.4 m		61				
8	평상 균열	0.1 m	2.0 m		62				
9	균열	0.2 mm	0.4 m		63				
10	균열	0.2 mm	1.2 m		64				
11	균열	0.2 mm	1.2 m		65				
12					66				
13					67				
14					68				
15					69				
16					70				
17					71				
18					72				
19					73				
20					74				
21					75				
22					76				
23					77				
24					78				
25					79				
26					80				
27					81				
28					82				
29					83				
30					84				
31					85				
32					86				
33					87				
34					88				
35					89				
36					90				
37					91				
38					92				
39					93				
40					94				
41					95				
42					96				
43					97				
44					98				
45					99				
46					100				
47					101				
48					102				
49					103				
50					104				
51					105				
52					106				
53					107				
54					108				

가
(아 앞)
(0앞)

(아
아)

T2
(0₊, 0₊)

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

시	행 사	영 역	영 역	공 공 사	관 령 지		구 간	
					개 설 제 입 지	분 야 별 적 입 지		
KORAIL KOREA RAILROAD	한국철도공사	2017년도 호남고속선 오송-광주승정간 콘크리트케도 점경구역	(주) 한국구조물안전연구원 (주) 한국도로안전연구원 (재) 한국건설품질연구원	이 복 영 김 완 강 김 경 기 문 준 석	관 령	 0220 (0.3mm이하 : 흑색)	 한목도상판리	 재료관리
						 0420 (0.3mm초과 0.5mm이하 : 황색)	 양상	 철타노출
						 0620 (0.5mm초과 1.0mm미만 : 적색)	 박리, 박락, 파손	 누수, 음압부
						 1020 (1.0mm이상 : 분홍색)	 백태	 시공이음관리, 총관리