



15. 원평천교 (B38)

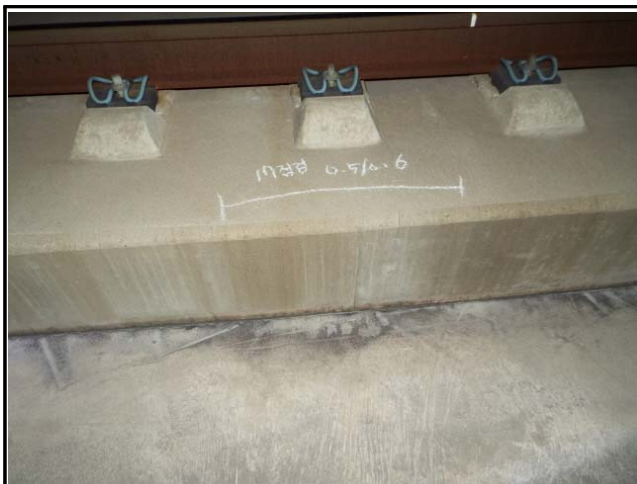


위치	28 SPAN -1	선별	T2	부위	TCL
내용	균열	Cw= 0.5/0.6			

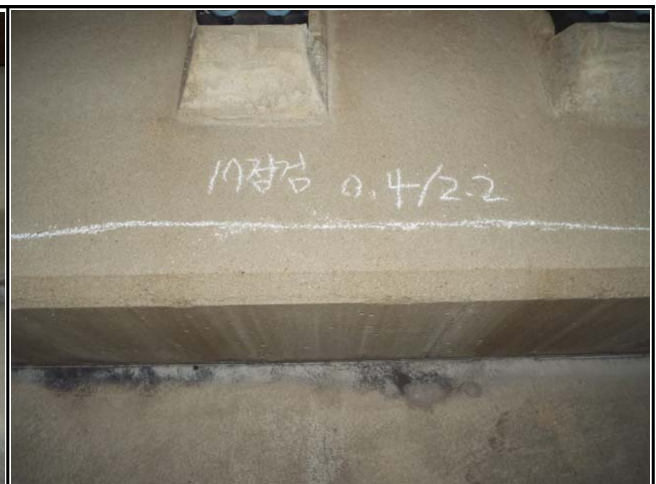

위치	28 SPAN -2	선별	T2	부위	TCL
내용	균열	Cw= 0.4/2.2			



위치	28 SPAN -2	선별	T2	부위	TCL
내용	균열	Cw= 0.5/0.4			

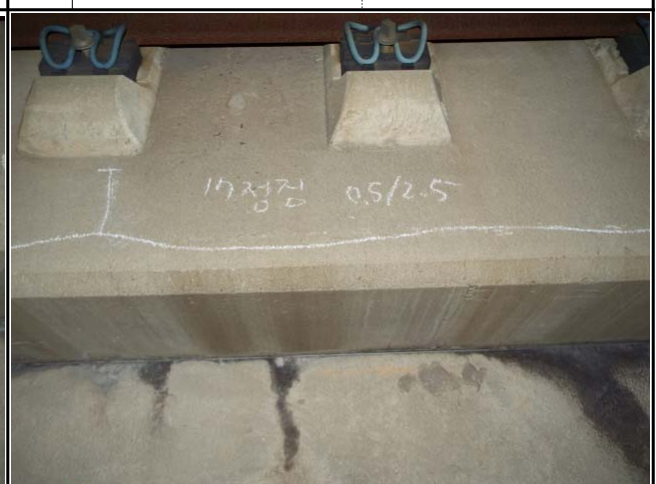

위치	28 SPAN -3	선별	T2	부위	TCL
내용	균열	Cw= 0.5/2.5			



위치	28 SPAN -4	선별	T2	부위	TCL
내용	균열	Cw= 0.5/4.5			




위치	29 SPAN -2	선별	T2	부위	TCL
내용	균열	Cw= 0.5/0.2			




위치	29 SPAN -3	선별	T2	부위	TCL
내용	균열	Cw= 0.5/0.2			



위치	41 SPAN -5	선별	T	부위	TCL
내용	망상균열	A= 0.5X1.2			

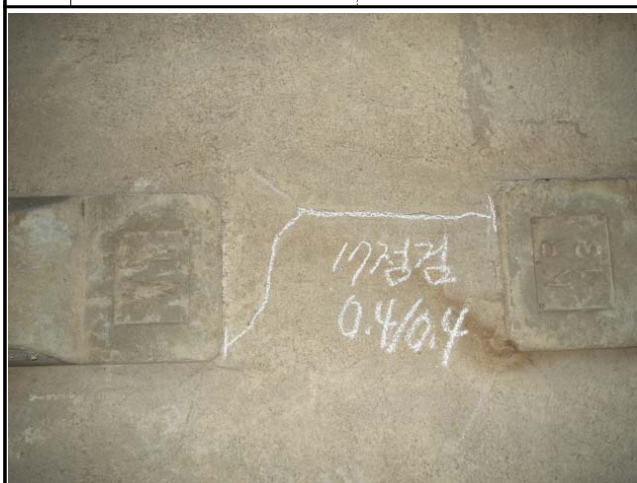

위치	63 SPAN -2	선별	T2	부위	TCL
내용	균열	Cw= 0.4/0.4			

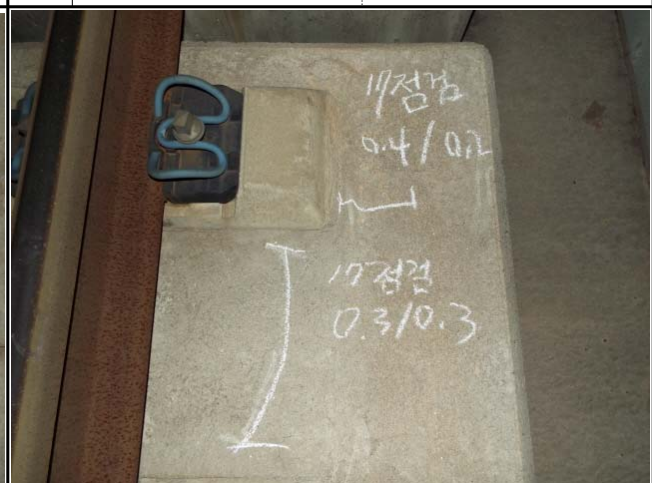

위치	70 SPAN -1	선별	T2	부위	TCL
내용	균열	Cw= 0.4/0.2			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	21 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.9			



위치	26 SPAN -5	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.4/2.3			




위치	58 SPAN -2	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/2.3			




위치	58 SPAN -2	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/2.3			



위치	60 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.4/0.9			

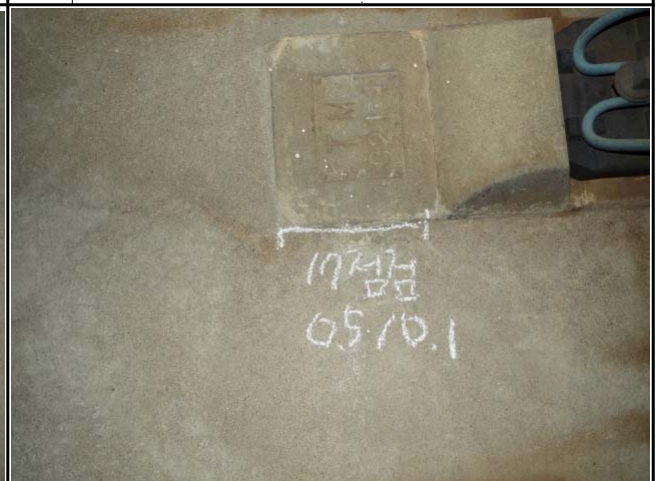

위치	64 SPAN -3	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.1			

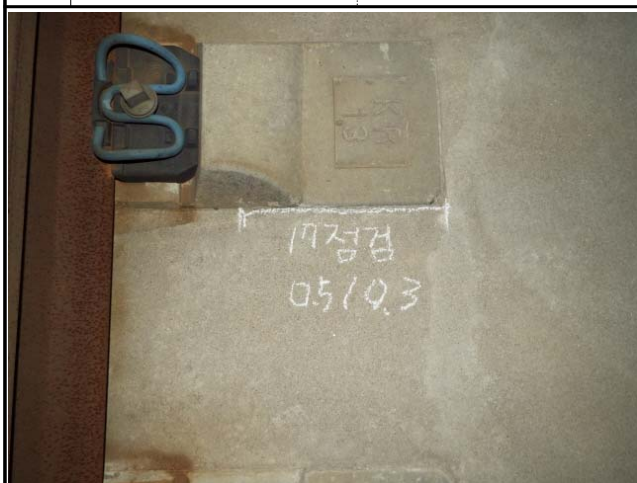

위치	65 SPAN -1	선별	T1	부위	침목
내용	경계부 균열	Cw= 0.5/0.3			




위치	26 SPAN -5	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			



위치	29 SPAN -1	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			



위치	29 SPAN -1	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			

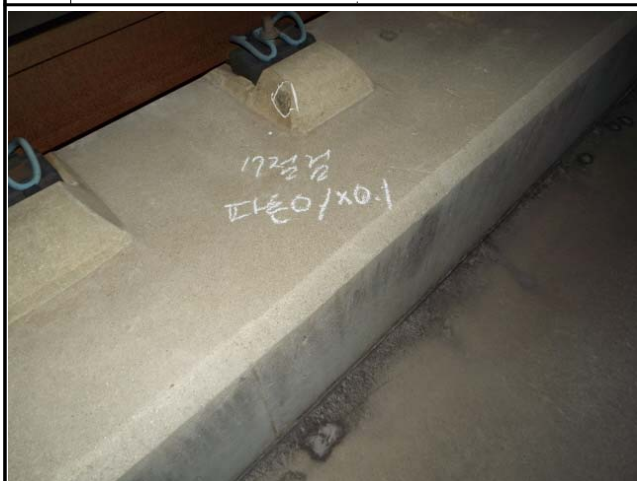


위치	29 SPAN -5	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			



위치	32 SPAN -4	선별	T1	부위	TCL
내용	재료분리	A= 0.3X0.5			




위치	32 SPAN -4	선별	T2	부위	TCL
내용	파손	A= 0.1X0.1			

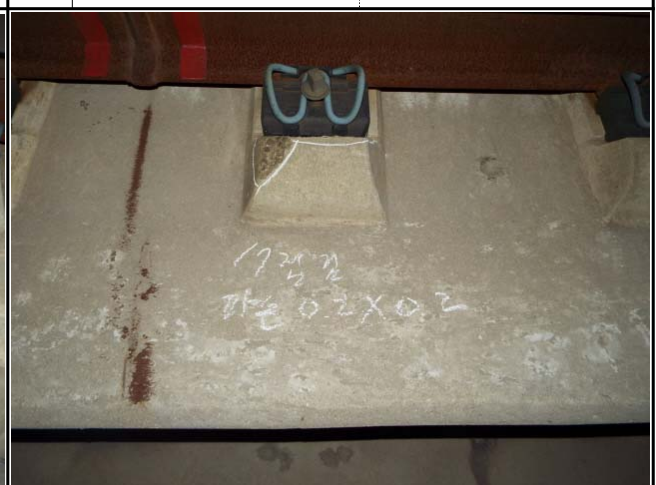

위치	33 SPAN -5	선별	T1	부위	침목
내용	침목 파손	A= 0.2X0.2			



위치	33 SPAN -5	선별	T2	부위	TCL
내용	재료분리	A= 0.1X2.0			

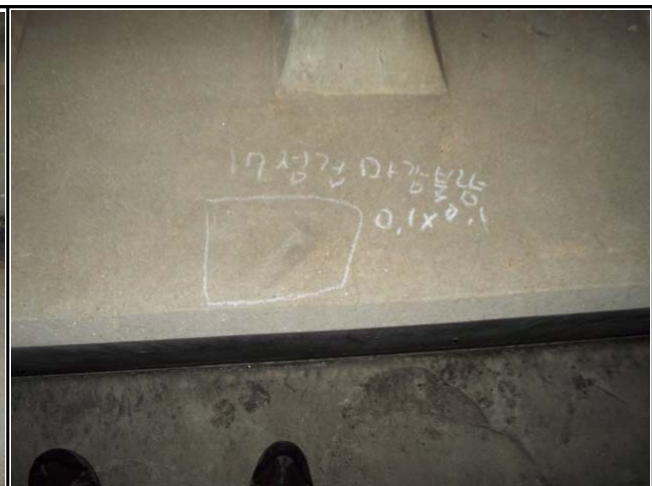

위치	36 SPAN -3	선별	T2	부위	TCL
내용	마감불량	A= 0.1X0.1			



위치	36 SPAN -4	선별	T1	부위	TCL
내용	재료분리	A= 0.4X0.2			



위치	37 SPAN -1	선별	T1	부위	TCL
내용	재료분리	A= 0.4X0.3			




위치	40 SPAN -1	선별	T2	부위	TCL
내용	파손	A= 0.1X0.1			




위치	47 SPAN -4	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			




위치	50 SPAN -5	선별	T1	부위	TCL
내용	파손	A= 0.1X0.1			

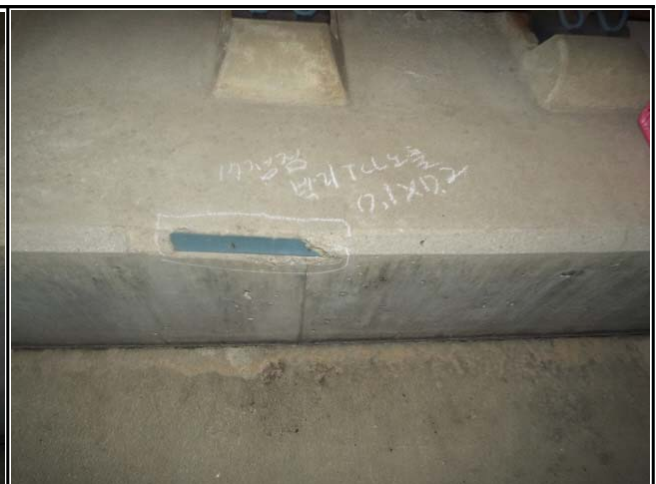


위치	54 SPAN -3	선별	T1	부위	TCL
내용	박리	A= 0.1X0.2			

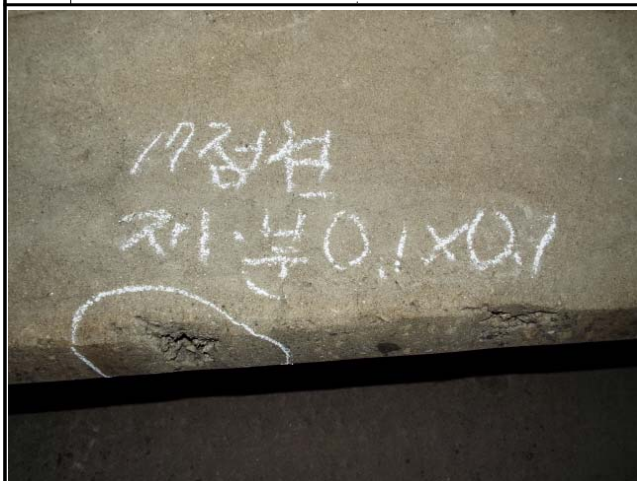

위치	58 SPAN -1	선별	T1	부위	TCL
내용	재료분리	A= 0.1X0.1			

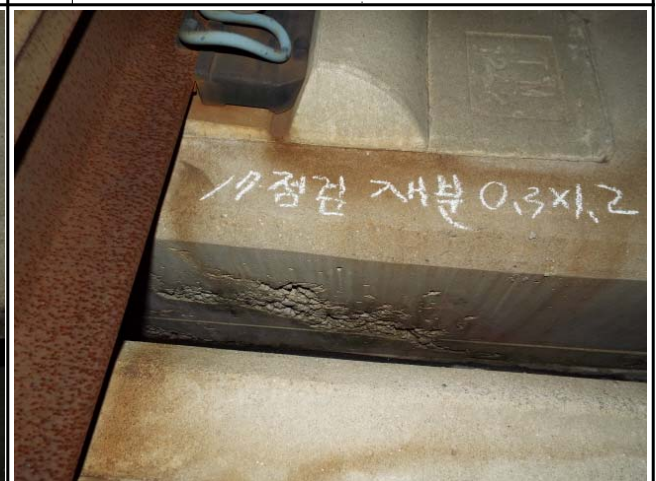

위치	59 SPAN -4	선별	T1	부위	침목
내용	재료분리	A= 0.3X1.2			

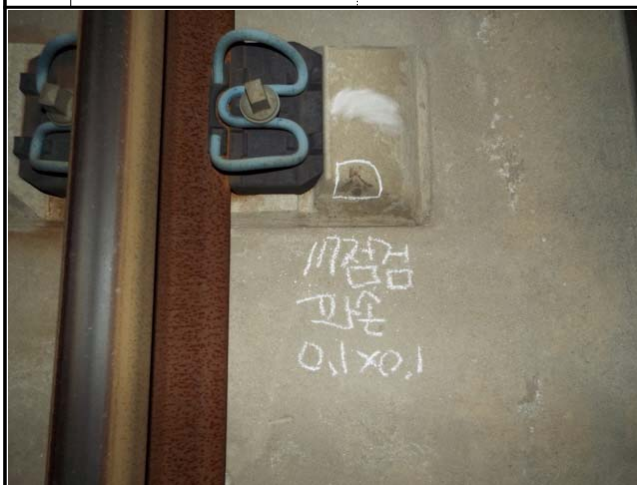

위치	62 SPAN -4	선별	T1	부위	침목
내용	파손	A= 0.1X0.1			



위치	65 SPAN -1	선별	T1	부위	침목
내용	침목 파손	A= 0.1X0.1			