

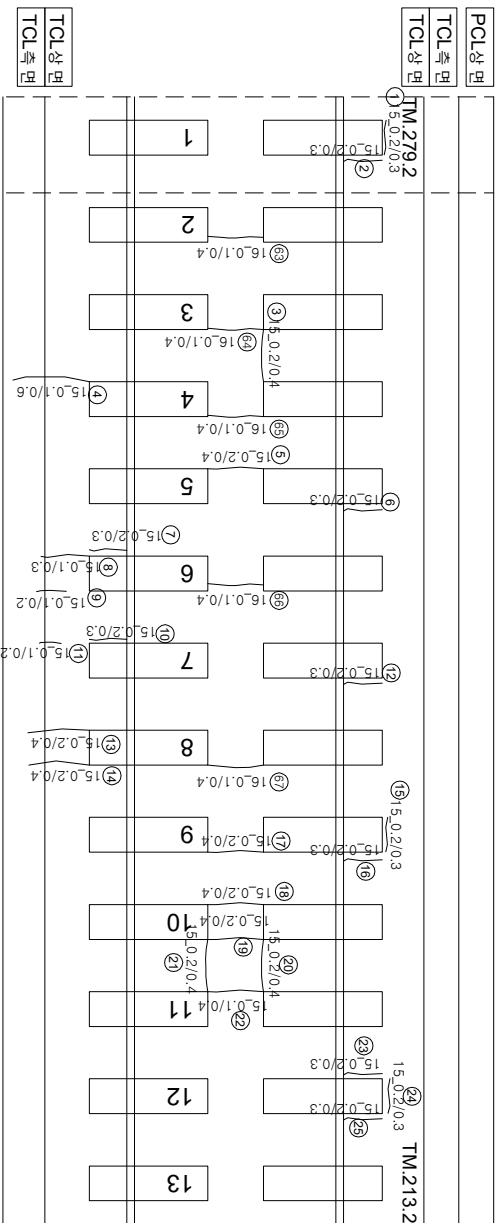
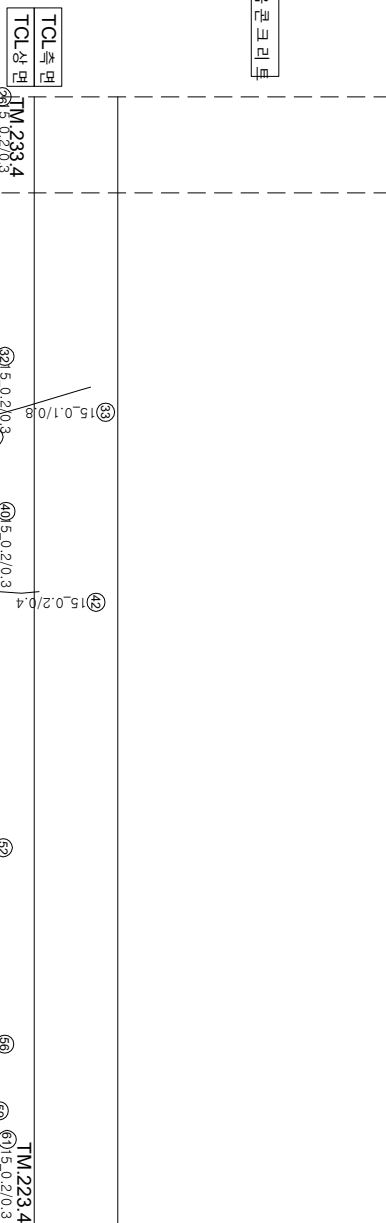
한남고속선 화물고가 _127(17.789~17.797, S24-2)

P23

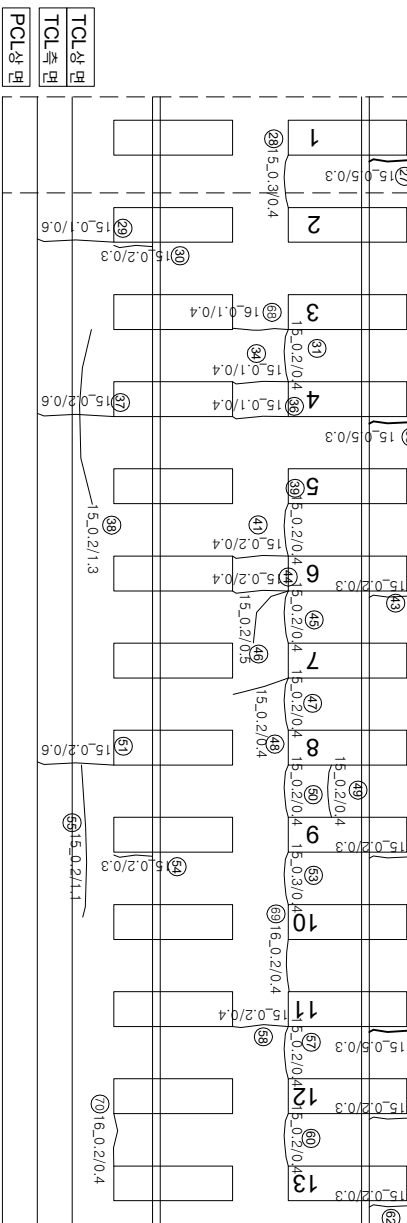
17K797

17K789 17K790

24 SPAN - 2


$$\begin{pmatrix} \text{아} \\ \text{아} \end{pmatrix}$$
$$\begin{pmatrix} \text{아} \\ \text{아} \end{pmatrix}$$


채움콘크리트



12 (앞 0주)

$$\begin{pmatrix} 0 & 1 \\ 1 & 0 \end{pmatrix}$$

연번	순상	폭	연장	비고	연번	순상	폭	연장	비고
1	장계부 군열	0.2	0.3 m		56	장계부 군열	0.2	0.3 m	
2	장계부 군열	0.2	0.3 m		57	군열	0.2	0.4 m	
3	군열	0.2	0.4 m		58	군열	0.2	0.4 m	
4	군열	0.1	0.6 m		59	장계부 군열	0.2	0.3 m	
5	군열	0.2	0.4 m		60	군열	0.2	0.4 m	
6	장계부 군열	0.2	0.3 m		61	군열	0.2	0.3 m	
7	장계부 군열	0.2	0.3 m		62	장계부 군열	0.2	0.3 m	
8	군열	0.1	0.3 m		63	군열	0.1	0.4 m	
9	군열	0.1	0.2 m		64	군열	0.1	0.4 m	
10	장계부 군열	0.2	0.3 m		65	군열	0.1	0.4 m	
11	군열	0.1	0.2 m		66	군열	0.1	0.4 m	
12	장계부 군열	0.2	0.3 m		67	군열	0.1	0.4 m	
13	군열	0.2	0.4 m		68	군열	0.2	0.4 m	
14	군열	0.2	0.4 m		69	군열	0.2	0.4 m	
15	장계부 군열	0.2	0.3 m		70	군열	0.2	0.4 m	
16	장계부 군열	0.2	0.3 m		71				
17	군열	0.2	0.4 m		72				
18	군열	0.2	0.4 m		73				
19	군열	0.2	0.4 m		74				
20	군열	0.2	0.4 m		75				
21	군열	0.2	0.4 m		76				
22	군열	0.1	0.4 m		77				
23	장계부 군열	0.2	0.3 m		78				
24	장계부 군열	0.2	0.3 m		79				
25	장계부 군열	0.2	0.3 m		80				
26	장계부 군열	0.2	0.3 m		81				
27	장계부 군열	0.5	0.3 m		82				
28	군열	0.3	0.4 m		83				
29	군열	0.1	0.6 m		84				
30	장계부 군열	0.2	0.3 m		85				
31	군열	0.2	0.4 m		86				
32	장계부 군열	0.2	0.3 m		87				
33	군열	0.1	0.8 m		88				
34	장계부 군열	0.1	0.4 m		89				
35	군열	0.5	0.3 m		90				
36	군열	0.1	0.4 m		91				
37	군열	0.2	0.6 m		92				
38	군열	0.2	1.3 m		93				
39	군열	0.2	0.4 m		94				
40	장계부 군열	0.2	0.3 m		95				
41	군열	0.2	0.4 m		96				
42	군열	0.2	0.3 m		97				
43	장계부 군열	0.2	0.3 m		98				
44	군열	0.2	0.4 m		99				
45	군열	0.2	0.4 m		100				
46	군열	0.2	0.5 m		101				
47	군열	0.2	0.4 m		102				
48	군열	0.2	0.4 m		103				
49	군열	0.2	0.4 m		104				
50	군열	0.2	0.4 m		105				
51	군열	0.2	0.6 m		106				
52	장계부 군열	0.2	0.3 m		107				
53	군열	0.3	0.4 m		108				
54	군열	0.2	0.3 m		109				
55	군열	0.5	1.1 m		110				

시행사	영역명	용역사	이복영	김은강 김경기 윤석기	구간	구간							
						과업책임자	장	분과책임자					
KORAIL 한국철도공사 KOREA RAILROAD	2017년도 함남고속선 오송-광주승강간 콘크리트케도 정검구역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원					0.2220	(0.300이하 : 흑색)		재료분리			
							0.4820	(0.300초과 0.500이하 : 청색)		망상		철근노출	
							0.6620	(0.500초과 1.000이하 : 적색)		바리,바락,바손		누수수문부	
							1.0020	(1.000이상 : 분홍색)		뱀태		시공이음분리,홍분리	