



하남고속도로포터블-토아반-18(40.130~40.140km, L=10m)

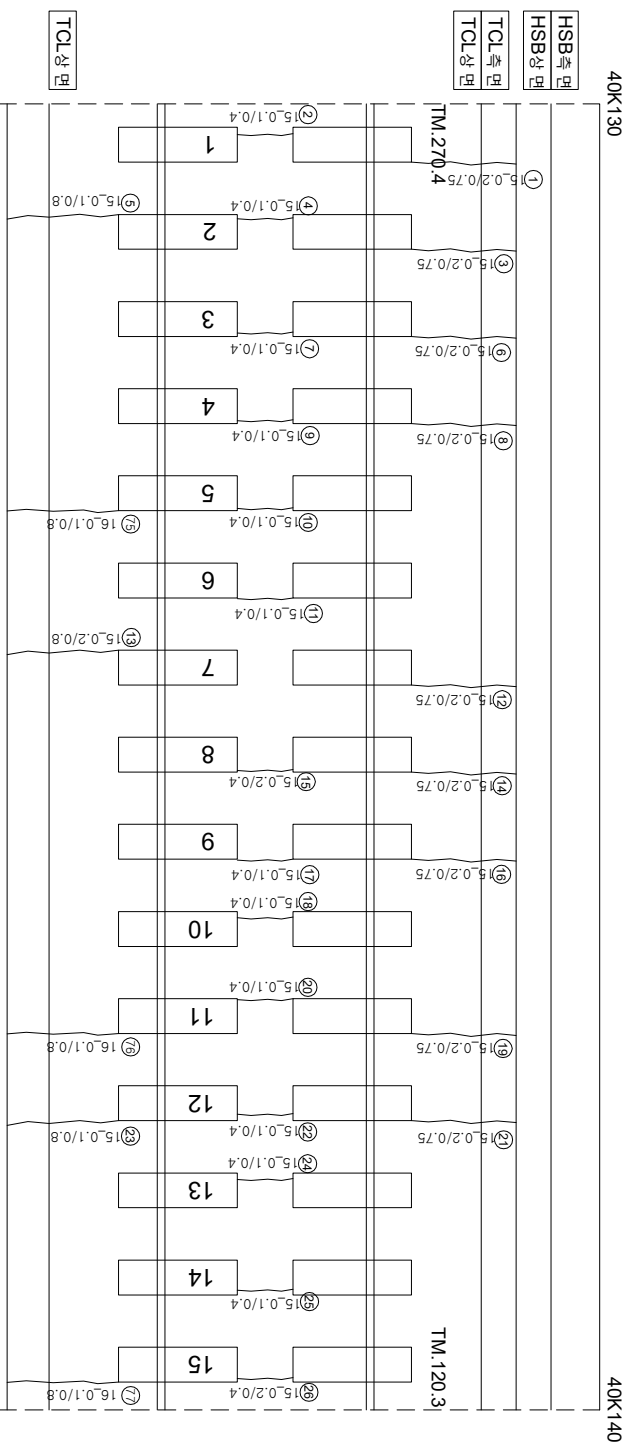

(아) (09)

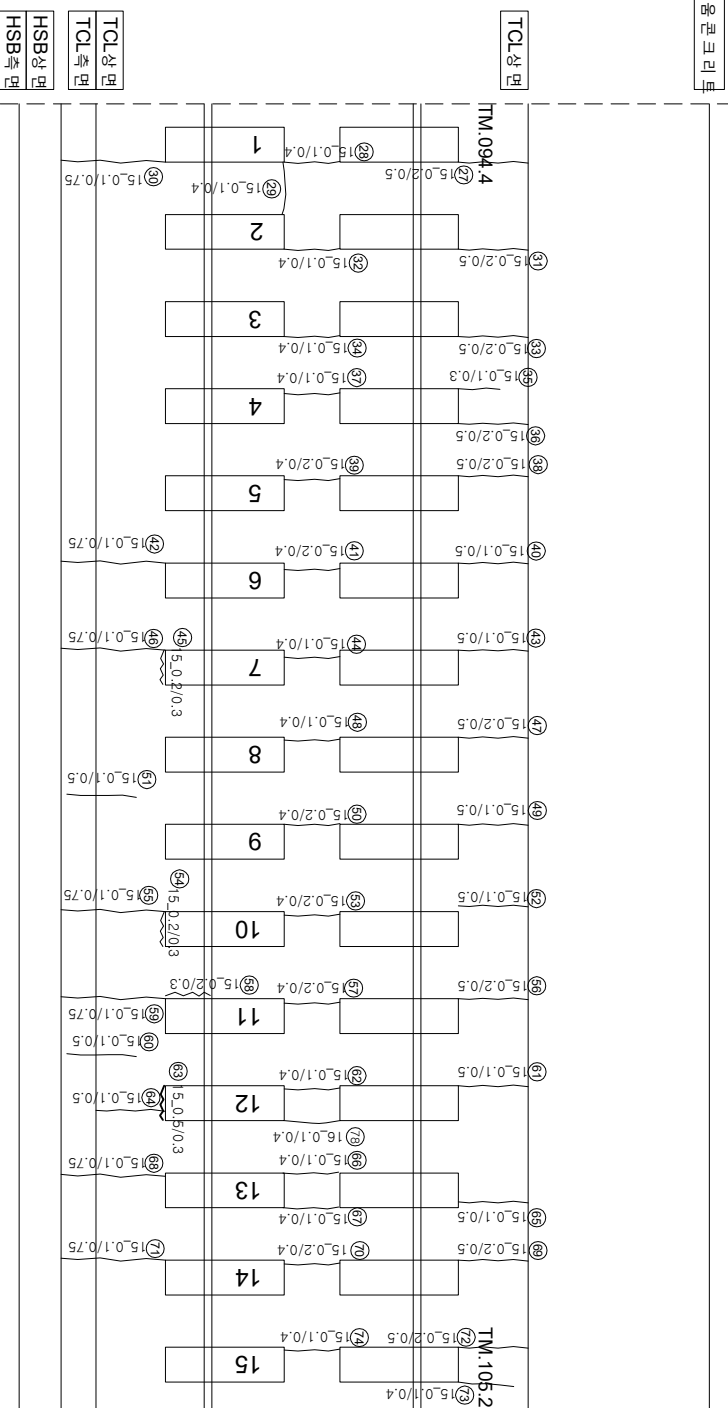

12 (0 $\frac{1}{2}$ 0 $\frac{1}{2}$)

연번	순차	특	연장	비고	연번	순차	특	연장	비고
1	균열	0.1	0.75 m		56	균열	0.2	0.5 m	
2	균열	0.2	mm 0.4 m		57	균열	0.2	mm 0.4 m	
3	균열	0.2	mm 0.75 m		58	균열	0.2	mm 0.3 m	
4	균열	0.1	mm 0.4 m		59	균열	0.1	mm 0.75 m	
5	균열	0.1	mm 0.8 m		60	균열	0.1	mm 0.5 m	
6	균열	0.2	0.75 m		61	균열	0.1	mm 0.5 m	
7	균열	0.1	mm 0.4 m		62	균열	0.1	mm 0.4 m	
8	균열	0.2	0.75 m		63	경계부 균열	0.5	mm 0.3 m	
9	균열	0.1	mm 0.4 m		64	균열	0.1	mm 0.5 m	
10	균열	0.1	mm 0.4 m		65	균열	0.1	mm 0.5 m	
11	균열	0.1	mm 0.4 m		66	균열	0.1	mm 0.4 m	
12	균열	0.2	mm 0.75 m		67	균열	0.1	mm 0.4 m	
13	균열	0.2	mm 0.8 m		68	균열	0.1	mm 0.75 m	
14	균열	0.2	mm 0.75 m		69	균열	0.2	mm 0.5 m	
15	균열	0.2	mm 0.4 m		70	균열	0.2	mm 0.4 m	
16	균열	0.2	mm 0.75 m		71	균열	0.1	mm 0.75 m	
17	균열	0.1	mm 0.4 m		72	균열	0.2	mm 0.5 m	
18	균열	0.1	mm 0.4 m		73	균열	0.1	mm 0.4 m	
19	균열	0.2	mm 0.75 m		74	균열	0.1	mm 0.4 m	
20	균열	0.1	mm 0.4 m		75	균열	0.1	mm 0.8 m	
21	균열	0.2	mm 0.75 m		76	균열	0.1	mm 0.8 m	
22	균열	0.1	mm 0.4 m		77	균열	0.1	mm 0.8 m	
23	균열	0.1	mm 0.8 m		78	균열	0.1	mm 0.4 m	
24	균열	0.1	mm 0.4 m		79				
25	균열	0.1	mm 0.4 m		80				
26	균열	0.2	mm 0.4 m		81				
27	균열	0.2	mm 0.5 m		82				
28	균열	0.1	mm 0.4 m		83				
29	균열	0.1	mm 0.4 m		84				
30	균열	0.1	mm 0.75 m		85				
31	균열	0.2	mm 0.5 m		86				
32	균열	0.1	mm 0.4 m		87				
33	균열	0.2	mm 0.5 m		88				
34	균열	0.1	mm 0.4 m		89				
35	균열	0.1	mm 0.3 m		90				
36	균열	0.2	mm 0.5 m		91	균열			
37	균열	0.1	mm 0.4 m		92				
38	균열	0.2	mm 0.5 m		93				
39	균열	0.2	mm 0.4 m		94				
40	균열	0.1	mm 0.5 m		95				
41	균열	0.2	mm 0.4 m		96				
42	균열	0.1	mm 0.75 m		97				
43	균열	0.1	mm 0.5 m		98				
44	균열	0.1	mm 0.4 m		99				
45	경계부 균열	0.2	mm 0.3 m		100				
46	균열	0.1	mm 0.75 m		101				
47	균열	0.2	mm 0.5 m		102				
48	균열	0.1	mm 0.4 m		103				
49	균열	0.1	mm 0.5 m		104				
50	균열	0.2	mm 0.4 m		105				
51	균열	0.1	mm 0.5 m		106				
52	균열	0.1	mm 0.5 m		107				
53	균열	0.2	mm 0.4 m		108				
54	경계부 균열	0.2	mm 0.3 m		109				
55	균열	0.1	mm 0.75 m		110				

시행사	영역명	용역사	이력영	구간	구간		재료분리
					과업책임자	장분야책임자	
한국철도공사 KOREA RAILROAD	2017년도 화남고속선 오송-광주승강간 콘크리트케도 정검영역	(주) 한국구조물안전연구원 (주) 한국국토안전연구원 (재) 한국건설품질연구원	이력영 김정기 윤석기	구간	 0.2220 (0.300이하 : 흑색)  0.4820 (0.300초과 0.500이하 : 청색)  0.6620 (0.500초과 1.000이하 : 적색)  1.0020 (1.000이상 : 분홍색)	 한목도상분리  망상  바리·바라·바순  뱀태	 재료분리  철근노출  누수수문부  시공이음분리, 혼분리